



AUDI Q3

Q3 40 TDI quattro S tronic

VIN NO WAUZZZF30P1011245
Registration Number 30P1011245



MOT Date

2025-08-01

Last Service



Number of Owners

1

Last Service Mileage



Number of Keys

2

First Registration Date

2022-08-05

Odometer Reading

110921 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250918105058
Inspection Date / Place	2025-09-18 / BCA Oberndorf	Cosmetic Grade	3

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Diesel	Road Worthy	Yes
Colour	White	Engine Size (cc)	1968
Engine Size	2.0	No of Doors	5
Body Type	SUV	Drive Train	All-Wheel-Drive permanent
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Cloth
Charging Cables		WLTP CO2 Emissions	
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Missing	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			







Equipment

Tinted Glass	Airbag Status	Ambientlighting	Anti-lock braking
Bluetooth telephone interface	Diesel particulate filter	Digitaldashboard	Heated wing mirrors
Remote central locking	Roof rails	Stability control	Electrictailgate
Leather steering wheel	Radio	USB Socket	Alloys wheels
AndroidAuto	AppleCarPlay	Cruise control	Digital Radio
Front parking sensors	Remote adjusting wing mirrors	Reversing Camera	Satellite navigation
Electrically folding wing mirrors	Keyless Entry	LED Headlamps	Rear parking sensors

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	18
Extra Wheel / Tyre Set	Winter Tyres - Alloy	Seat Heating	Front

Wheels & Tyres


Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5
Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	7	Extra Wheel - 4 Tyre Depth	8

Cosmetic Damage

10 Schäden

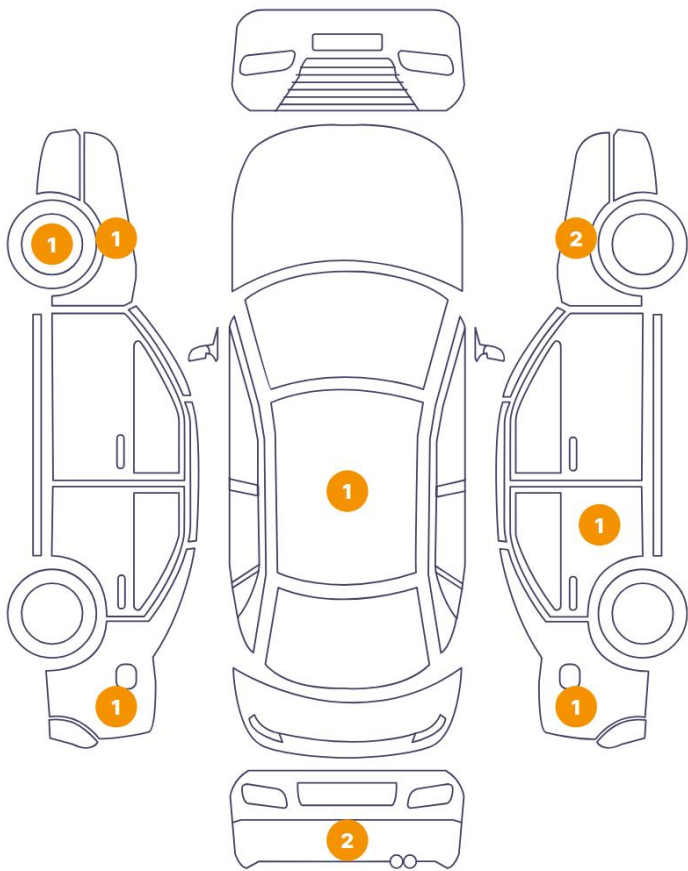

2 Schäden

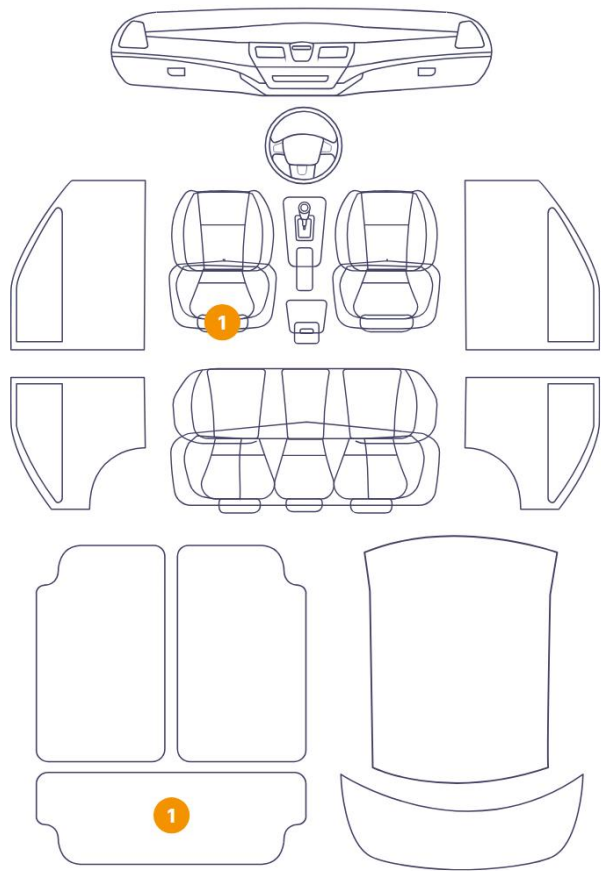

Component		Damage	Comments
1	Luggage Space Cover / Back	Interior / Scratched	
2	Seat / Front Left	Interior / Dirty	
3	Bumper / Back	Paint / Scratch / Scuff	
4	Rim / Front Left	Out of Bodywork / Scratch	
5	Side Panel / Back Left	Bodywork / Dent / Dent	
6	Wing Stick / Front Right	Paint / Scratch / Scuff	
7	Door / Back Right	Bodywork / Dent / Dent	
8	Bumper / Back	Paint / Scratch / Scuff	
9	Roof	Paint / Stone Chip	
10	Fender / Front Left	Paint / Poor Previous Repair	
11	Fender / Front Right	Paint / Poor Previous Repair	
12	Side Panel / Back Right	Paint / Poor Previous Repair	



1. Luggage Space Cover / Back Interior / Scratched -




2. Seat / Front Left Interior / Dirty -



3. Bumper / Back Paint / Scratch / Scuff -



4. Rim / Front Left Out of Bodywork / Scratch -

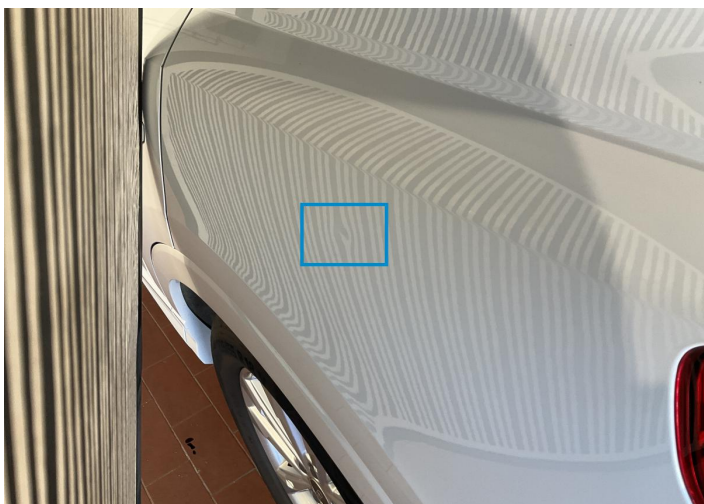

5. Side Panel / Back Left Bodywork / Dent / Dent -



6. Wing Stick / Front Right Paint / Scratch / Scuff -



7. Door / Back Right
Bodywork / Dent / Dent -



8. Bumper / Back
Paint / Scratch / Scuff -



9. Roof
Paint / Stone Chip -



10. Fender / Front Left
Paint / Poor Previous Repair -



11. Fender / Front Right
Paint / Poor Previous Repair -



12. Side Panel / Back Right
Paint / Poor Previous Repair -

Mechanical Condition

Control Lights

Display Defect	✓	Service Light	!
ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Diesel Particulate Filter Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
No Dashboard Lights	✓		

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	!
Electric Windows	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	AC / Heating System	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	NA
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel

Steering | Noise / Anomaly 





Engine

Engine Noise  Fume Quantity 

Power Loss 

General

Test Driven Status Not Performed

-  No troubles detected, good condition or correct tests, according to vehicle age and mileage
-  Damages or malfunction detected that requires repairs by the buyer
-  Not applicable
-  Not tested

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)