



Expertise

Protocol number: 41301466
Order No. / Reference: 25118546
Inspection date: 29 Aug 2025

Manufacturer: Audi

Model: Q3 45 TFSIe S tronic S line

VIN: WAUZZZF36N1135937



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q3 45 TFSIe S tronic S line	
Vehicle Identification number	WAUZZZF36N1135937
Mileage (Read)	54,409 km
First registration	12 Jul 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext. edition / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	ibisweiss (Y9C)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,600 km
Last maintenance on / at	01/2025 at 45,882 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GJ210476
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BYE 00075		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,320 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R18 100V	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Electromechanical parking brake • EV button • Electric windows front and rear • Speed limiter, adjustable • Transmission: S tronic 6-speed • Rear window wiper • Child safety lock electrically operated • 2-zone comfort automatic climate control • Headrests (5) front and rear • Mode 3 charging cable for public charging • Light/rain sensor • Front center armrest • Wheel: Tire pressure monitoring indicator • Radio: MMI Radio plus • Radio accessories: Digital radio reception (DAB) • Seats: Standard seats in the front • Lane change warning • Start-stop system with recuperation • Glazing: Windscreen with thermal insulation and acoustic glazing • Airbag for driver and front passenger • Acoustic vehicle warning system • Audi connect Emergency Call & Service • Audi pre sense basic • Hill start assist • Roof rails black • Digital instrument cluster - fully digital instrument cluster in 10.25 inches • Door sills with aluminum insert | <ul style="list-style-type: none"> • Electronic Stabilization Control (ESC) • Chassis: Comfort chassis • Floor mats front and rear • Legal emergency call • Heated rear window • Hybrid drive system PHEV • ISOFIX and Top Tether child seat attachment for the outer rear seats • Paint finish: Uni • Charging cable: Industrial plug CEE 16 A, 400 V, long and straight • Gasoline particulate filter • Wheel: Tire repair kit • Radio accessories: 4 front speakers • Power steering, electromechanical • Lane Departure Warning • Parking air conditioning • Phone: Bluetooth interface • Electronic immobilizer • Central locking • Airbag: Front side airbags and head airbag system • Anti-lock braking system (ABS) • Audi drive select • Audi pre sense front • Brake light, third • Micrometallic silver decorative inlays • tachometer • e-tron charging system compact |
|--|--|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Business package (MMI navigation plus - leather steering wheel in 3-spoke design with multifunction plus - Audi virtual cockpit plus - Audi phone box - Audi connect navigation & infotainment plus - cruise control) • Electrically adjustable, heated, and foldable exterior mirrors, automatically dimming on both sides (including automatic curbside mirror function for the passenger side mirror with integrated LED indicators, including heated windshield washer nozzles. The automatic curbside mirror folds down when reverse gear is engaged, giving the driver a better view of the curb) | <ul style="list-style-type: none"> • Audi connect Remote & Control (for MMI navigation) (Audi connect Remote & Control services connect the vehicle to your smartphone. The myAudi app allows remote access to the vehicle and displays the last parking position and current vehicle status. - Parking position - Vehicle status and driving data - Remote locking and unlocking - Remote charging - Remote air conditioning (45 TFSI e) and auxiliary heating - Push notification for the anti-theft alarm system) • Cruise control (maintains the individually set speed between 20 and 250 km/h, engine power permitting. It is operated via a separate steering column stalk. The set speed is shown on the display. The system does not react to vehicles ahead with distance control.) • Frameless, automatically dimming interior mirror (can increase safety by reducing glare, which can improve the perception of oncoming traffic at night. Reduced glare at night can, among other factors, help you see other vehicles in the interior mirror more quickly and clearly. Reduced glare can help prevent eye fatigue.) |
|--|---|



- LED headlights with LED taillights (functions: daytime running lights, low beam, high beam (from MY20), position lights, indicator lights, cornering lights, all-weather lights, motorway lights (extended range at high speeds), maneuvering lights (illumination of the swivel area when reversing), static cornering lights, automatic-dynamic headlight range control, intersection lights (only with MMI Navigation plus), indicator lights, brake, tail, reversing, and rear license plate lights in LED technology)
- Luggage compartment lid, electrically opening and closing (The luggage compartment lid can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the luggage compartment lid handle. Closing the luggage compartment lid is just as easy and convenient as opening it: simply press the button on the inside of the luggage compartment lid, the button in the driver's door, or the button on the optional convenience key. A closing aid makes manual closing easier when necessary.)
- Phone: Audi Phone Box (A smartphone can be paired with the vehicle via Bluetooth to either play music or make phone calls. This connects to the vehicle antenna, improving reception and call quality. Furthermore, the smartphone can be charged via wireless charging with the Qi standard or via a USB port if the smartphone is still in the storage compartment.)
- Rear seat bench plus with center armrest and cup holder (rear seat backrest foldable in a 40:20:40 ratio - rear seat bench adjustable in length - rear seat backrest angle adjustable - including rear center armrest and cup holder)
- Wheel: Audi new car tire warranty (36 months from vehicle handover to the first customer)
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Parking Aid Plus (assists the driver with acoustic signals and a display on the MMI screen when parking and maneuvering. The parking aid is activated by engaging reverse gear or via a button on the center console, or automatically when the distance to a detected object is less than 90 cm. Automatic activation can be switched on and off.)
- Seat upholstery in leather/synthetic leather mono.pur 550 combination (front and both outer rear seats in leather - seat side bolsters inside and outside, middle rear seat and front center armrest (if ordered) in synthetic leather mono.pur 550 - accent stripes on the seat in leather)
- Steering wheel: 3-spoke leather steering wheel with multifunction plus (The steering wheel impresses with its high-quality appearance and aluminum trim and fits comfortably in the hand. The height and reach of the steering wheel are manually adjustable. The steering wheel is equipped with 12 multifunction buttons for convenient operation of the extensive standard and optional infotainment features.)
- Wheel: Winter alloy wheels in 5-spoke Secare design (6.5 J x 17 with 215/65 R17 winter tires)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smooth repair work
2	Rear bumper	Spoiler - Scratch(es) - Smart repair
3	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Mudguard - left side	Mudguard - left side - Stone chips - No deduction



No.	Component group	Description
2	Bonnet	Bonnet - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Side panel - rear right side	Sill - Abrasion - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer	2.376,96 €
2	Rear, Provided by user / customer	2.992,68 €

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	222 µm
----------------------	--------

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigten, nicht demontierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

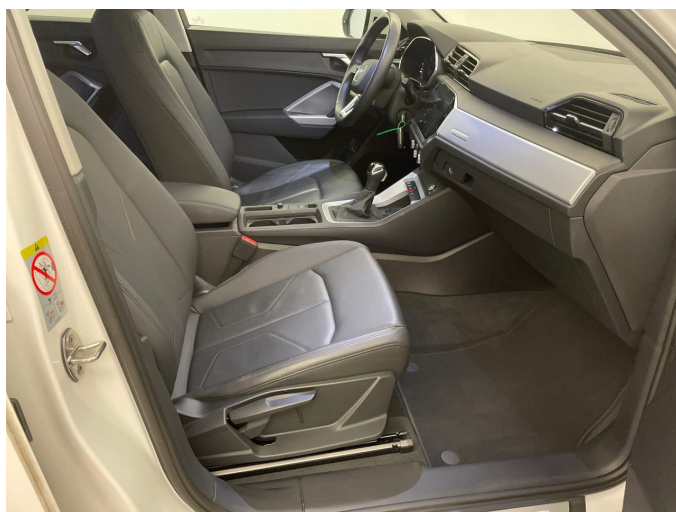


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

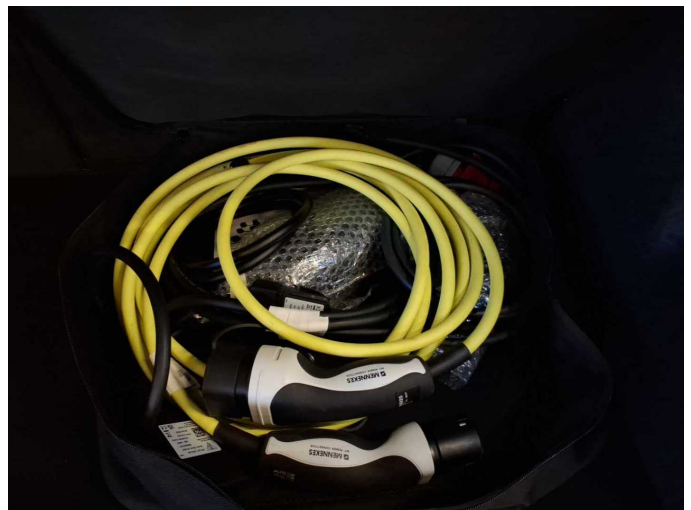


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

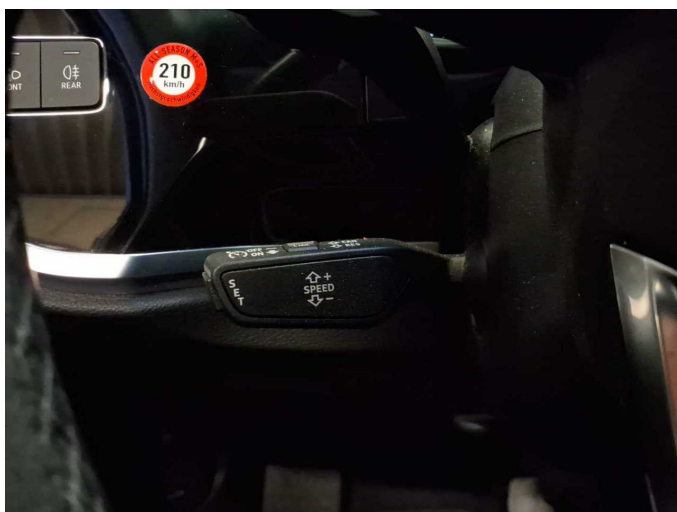


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

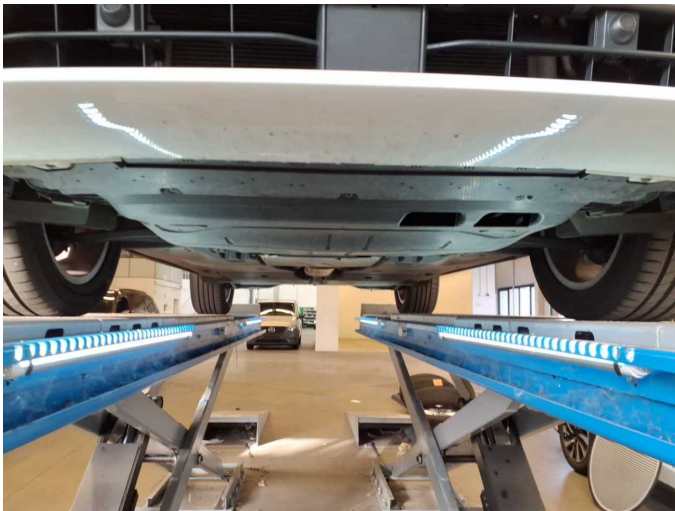


Figure 27: Misc.



Figure 28: Misc.



Damage 1: Door - front right side: Door - dent(s) - Smooth repair work



Damage 1: Door - front right side: Door - dent(s) - Smooth repair work



Damage 2: Rear bumper: Spoiler - Scratch(es) - Smart repair



Damage 2: Rear bumper: Spoiler - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF36N1135937
Hersteller / Modell: AUDI AUDI Q3 45 TFSIe S tronic S line

Datum	KM-Stand	Beschreibung
15.01.2025	45.882	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.03.2024	29.797	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.06.2023	15.225	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges