



Expertise

Protocol number: 41325200
Order No. / Reference: 25110394
Inspection date: 2 Sept 2025

Manufacturer: Audi

Model: A4 Avant 35 TDI S tronic advanced

VIN: WAUZZZF43MA002382



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 35 TDI S tronic advanced	
Vehicle Identification number	WAUZZZF43MA002382
Mileage (Read)	135,991 km
First registration	26 Aug 2020
Number of holders	2
Next periodical technical inspection	08/2027
(Report on hand)	
Power / Engine displacement	120 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Manhattangrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	5,100 km
Last maintenance on / at	11/2024 at 114,207 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FU611525
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BPK 00179		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,165 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/50 R17 94H	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	225/50 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2024		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • AdBlue tank (12 liters) • Airbag: Front side airbags and head airbag system • Anti-lock braking system (ABS) • Audi connect emergency call & service with Audi connect Remote & Control • Exterior mirror housings in body color • Brake light, third raised • Roof rails black • Diesel particulate filter (DPF) • Door sills with aluminum inserts at the front • Electronic differential lock (EDS) • Driver Information System • Electric window lifter • Radio key, without SafeLock • Cruise control including speed limiter • Rear window wiper • Interior lighting • Parental controls • Automatic air conditioning • trunk floor mat • Load compartment cover manually • LED headlights • Steering column, manually height and axially adjustable • Light/rain sensor • Front center armrest • Wheel: Light alloy wheels, 5-arm dynamic • Radio: MMI Radio plus • Radio accessories: Digital radio reception (DAB) • Tire repair kit • Seat covers in fabric index • Seats: Folding rear seat backrest • Start-stop system • Glazing: Windscreen in acoustic glazing • Electronic immobilizer • Central locking "Keyless-Go" without safe security | <ul style="list-style-type: none"> • Airbag for driver and front passenger • Accent surfaces matt black • Traction control (ASR) • Audi pre sense city • Exterior mirrors electrically adjustable and heated • Vehicle tool kit • Fabric headliner • Decorative inlays diamond lacquer silver grey • tachometer • Electromechanical parking brake • Electronic Stabilization Control (ESC) • Chassis: Standard chassis • Window sill strips in black (rubber) • Floor mats front and rear • Transmission: S tronic 7-speed • Top speed limited to 210 km/h • Dimmable interior mirror • ISOFIX and Top Tether child seat attachment for the outer rear seats • Headrests (5) • LED rear lights • Steering wheel: Leather steering wheel in 3-spoke design with multifunction • Mild hybrid • Non-smoking version • Wheel: Rolling resistance optimized tires, speed limited • Radio accessories: 8 speakers (passive) front and rear • Tire pressure monitoring display • Power steering, electromechanical • Seats: Standard seats in the front • Seats: Front seats manually adjustable • Bandage material with warning triangle • Glazing: Heat-insulating glazing tinted green • Turning loading floor |
|--|--|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Business package (MMI navigation plus with MMI touch (including driver information system with color display) - Audi phone box - 3-spoke leather steering wheel with multifunction plus - Heated front seats - Frameless, automatically dimming interior mirror - Electrically adjustable, heated, and folding exterior mirrors with automatic dimming on both sides - Rear parking aid - High beam assistant - Manual sunblind for the rear door windows) • Paint finish: metallic | <ul style="list-style-type: none"> • Audi connect navigation & infotainment • Driver information system with color display • Exterior mirrors electrically adjustable, heated and foldable, automatically dimming on both sides • Heated front seats • High beam assistant |
|--|---|



- Pivoting tow bar (mechanically pivoting ball head with electric release - ball bar and ball head made of forged steel - operated via button in the luggage compartment - including trailer stabilization via the Electronic Stability Control (ESC) - the integrated pivoting system socket allows continuous operation of electrical devices in the trailer or caravan while driving)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus
- Parking Aid Plus (Acoustic and visual parking aids at the front and rear assist with parking and maneuvering. With selective, visual display of the distance to detected objects on the MMI display, depending on the current steering angle and direction of travel. The virtual lane indicator also offers lateral guidance lines that are calculated in advance based on the currently selected steering angle. Measurement is performed by ultrasonic sensors discreetly integrated into the bumpers.)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - rear left side	Door - dent(s) - Smooth repair work
3	Door - front right side	Door edge - Scratch(es) - Smart repair
4	Side panel - rear left side	Side panel - dent(s) - Smart repair
5	Rear bumper	Spoiler - Scratch(es) - Replace
6	Boot lid / rear door	Boot lid - Scratch(es) - Paint
7	Side panel - rear right side	Side panel (+ Kratzer) - dent(s) - Repair and paint
8	Door - front left side	Door - Scratch(es) - Paint
9	Rear bumper	Rear bumper - Scratch(es) - Repair and paint
10	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
11	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
12	Door - rear right side	Window guide - Damaged - Replace
13	Front bumper	Front bumper - Scratch(es) - Paint
14	Bonnet	Bonnet (+ Steinschläge) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Grille - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 15 Oct 2020	2.057,06 €



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs



ALPHABET

Figure 1: Diagonal front (left)



ALPHABET

Figure 2: Diagonal front (right)



ALPHABET

Figure 3: Diagonal rear (left)



ALPHABET

Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area

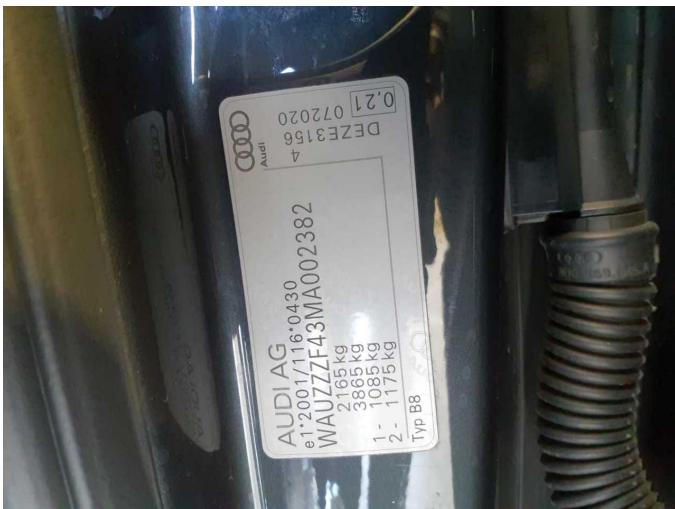


Figure 11: VIN



Figure 12: Mounted tyres

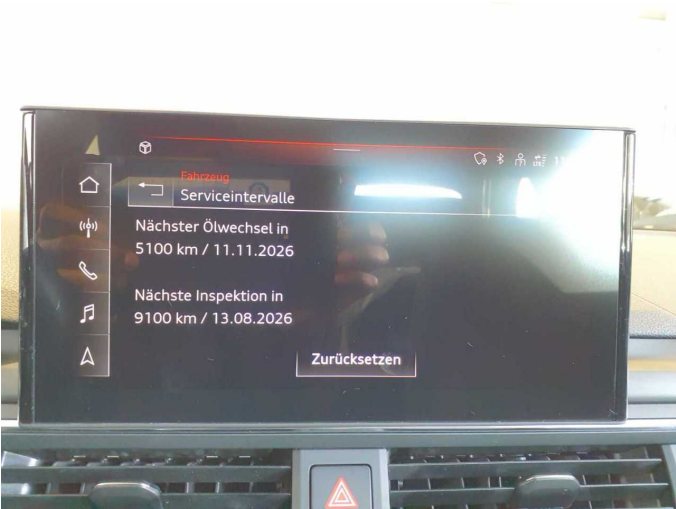


Figure 13: Documents



Figure 14: Documents

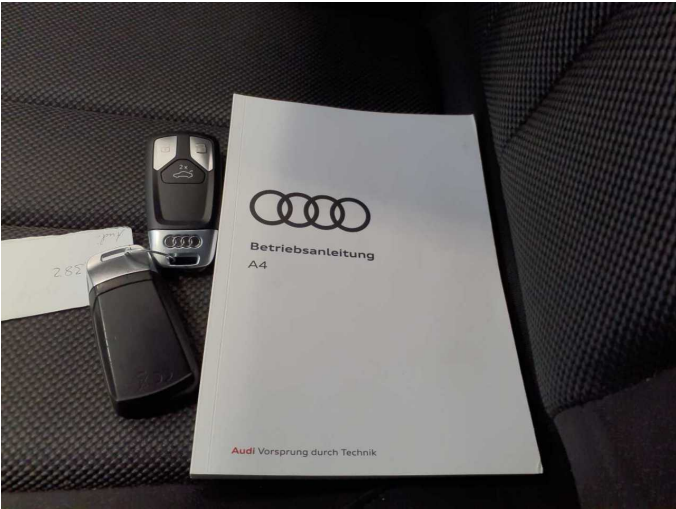


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

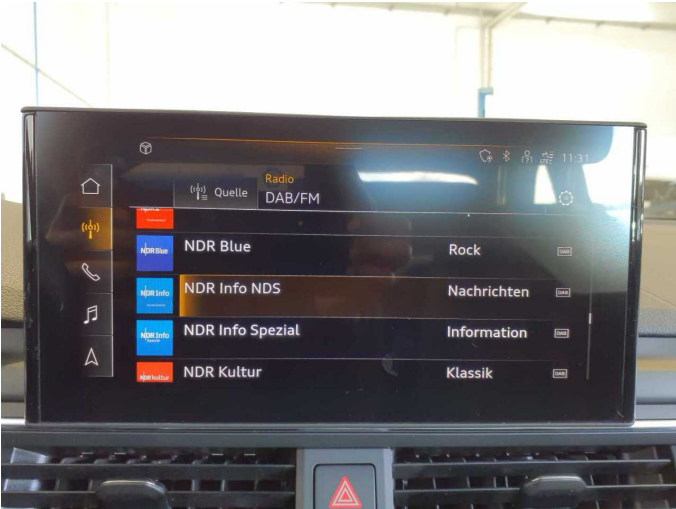


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

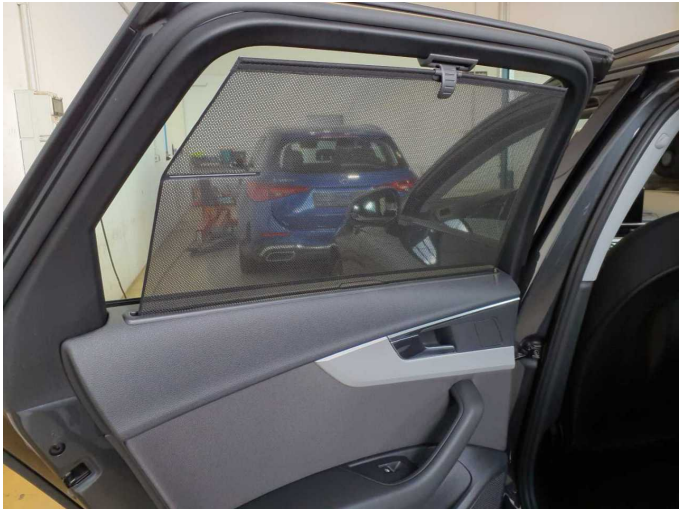


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

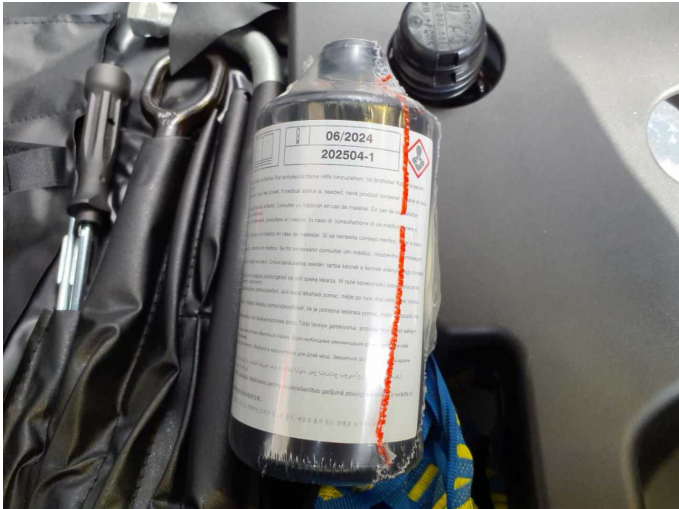



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

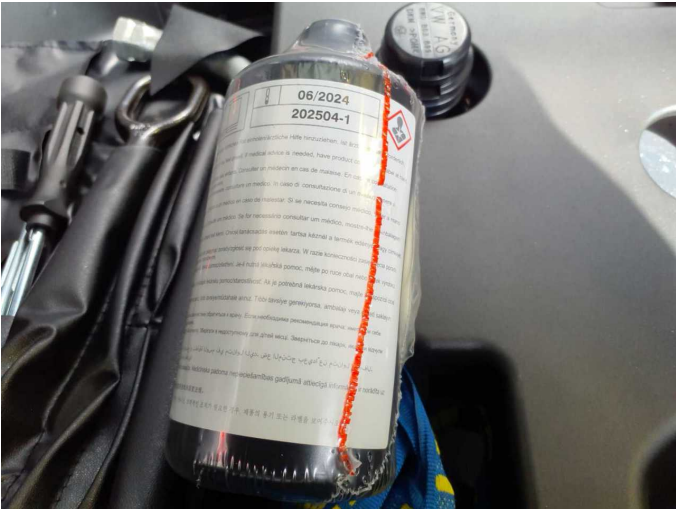

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 3: Door - front right side: Door edge - Scratch(es) - Smart repair

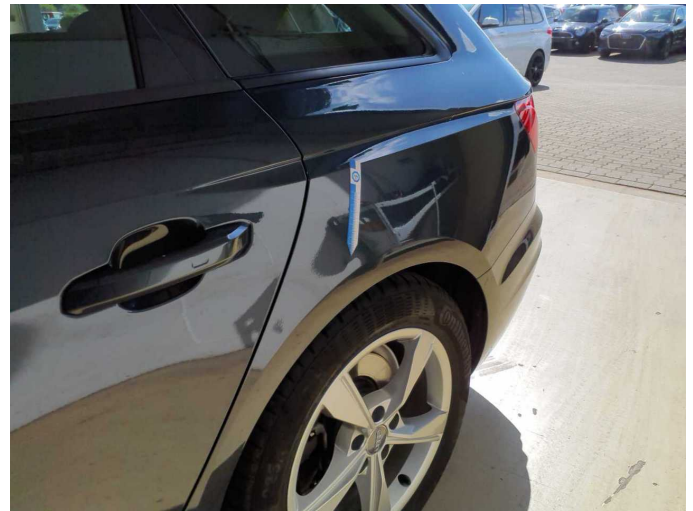

Damage 4: Side panel - rear left side: Side panel - dent(s) - Smart repair

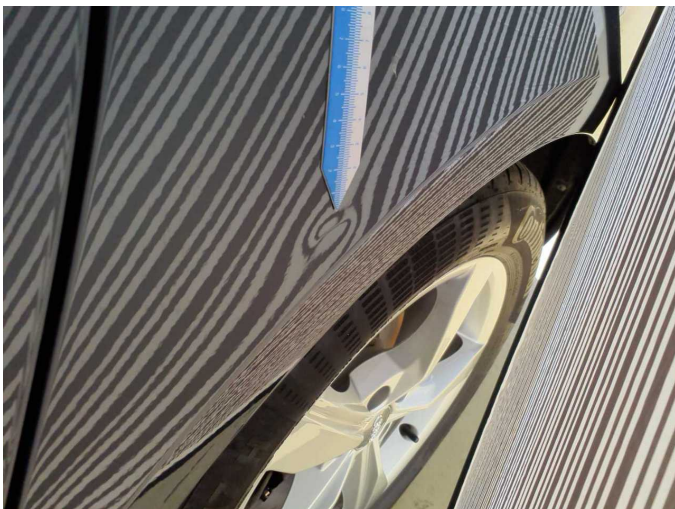

Damage 4: Side panel - rear left side: Side panel - dent(s) - Smart repair

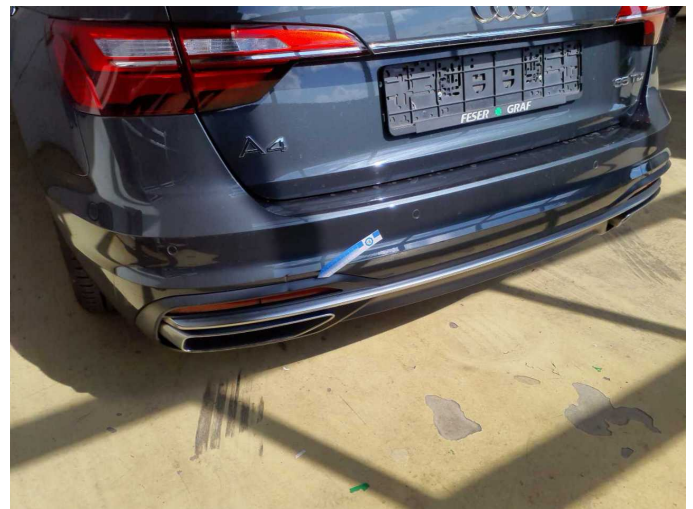


Damage 5: Rear bumper: Spoiler - Scratch(es) - Replace




Damage 5: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 5: Rear bumper: Spoiler - Scratch(es) - Replace

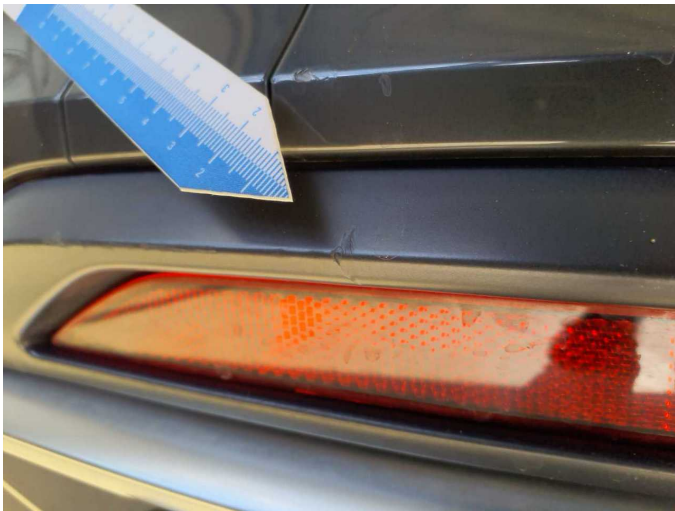

Damage 5: Rear bumper: Spoiler - Scratch(es) - Replace

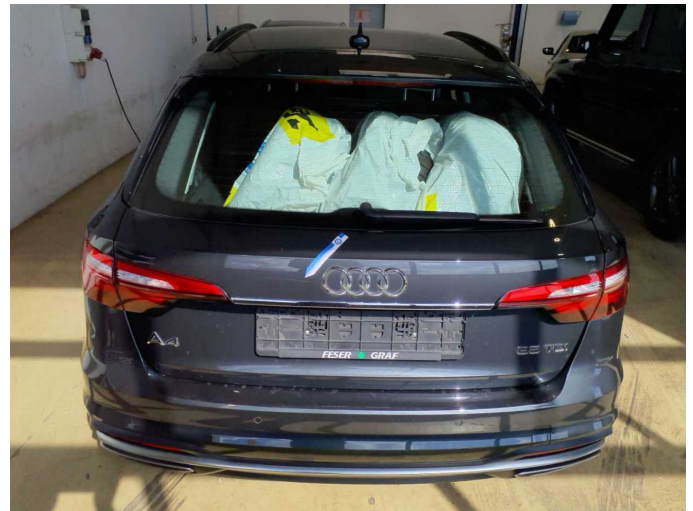

Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 7: Side panel - rear right side: Side panel (+ Kratzer) - dent(s) - Repair and paint

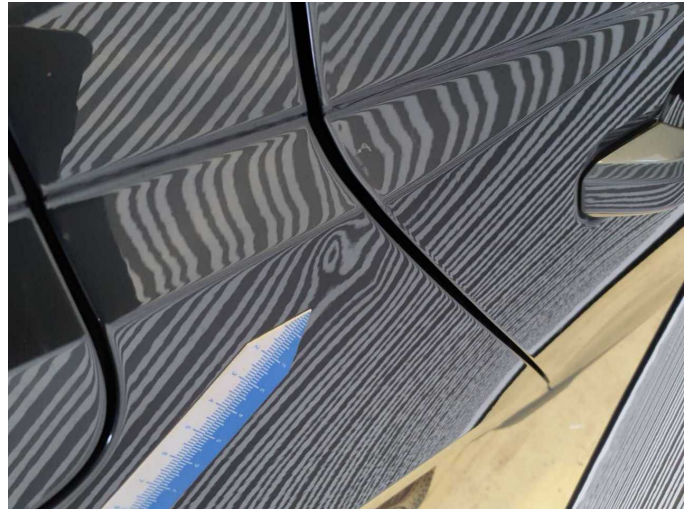

Damage 7: Side panel - rear right side: Side panel (+ Kratzer) - dent(s) - Repair and paint



Damage 7: Side panel - rear right side: Side panel (+ Kratzer) - dent(s) - Repair and paint



Damage 7: Side panel - rear right side: Side panel (+ Kratzer) - dent(s) - Repair and paint



Damage 8: Door - front left side: Door - Scratch(es) - Paint



Damage 8: Door - front left side: Door - Scratch(es) - Paint



Damage 8: Door - front left side: Door - Scratch(es) - Paint



Damage 8: Door - front left side: Door - Scratch(es) - Paint




Damage 8: Door - front left side: Door - Scratch(es) - Paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

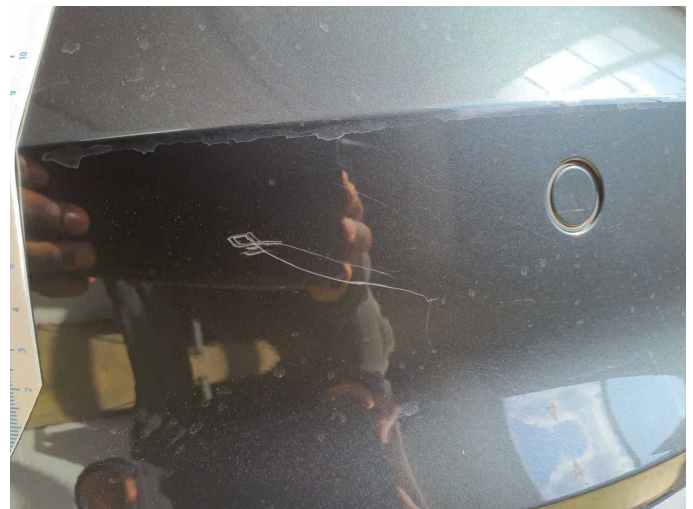


Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

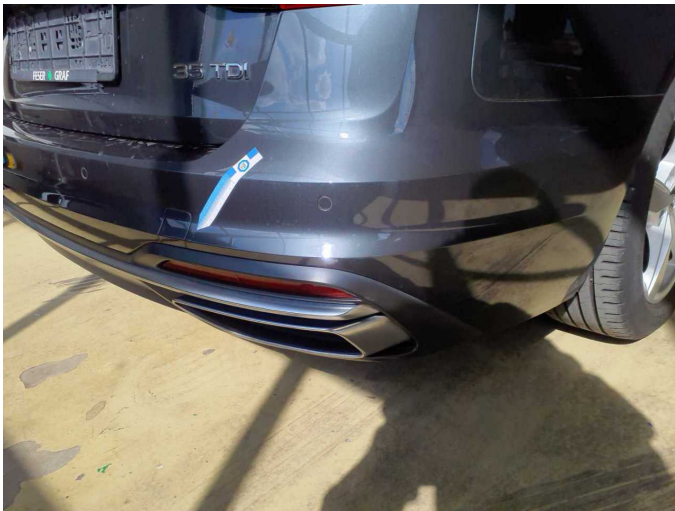


Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Repair and paint




Damage 10: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

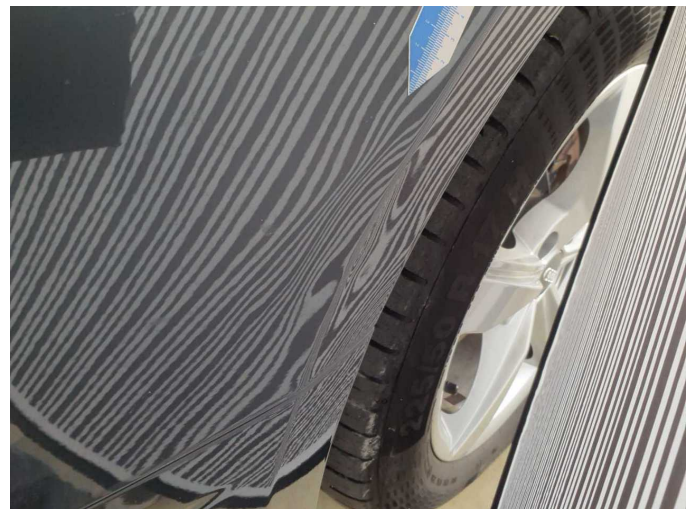

Damage 10: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage 10: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

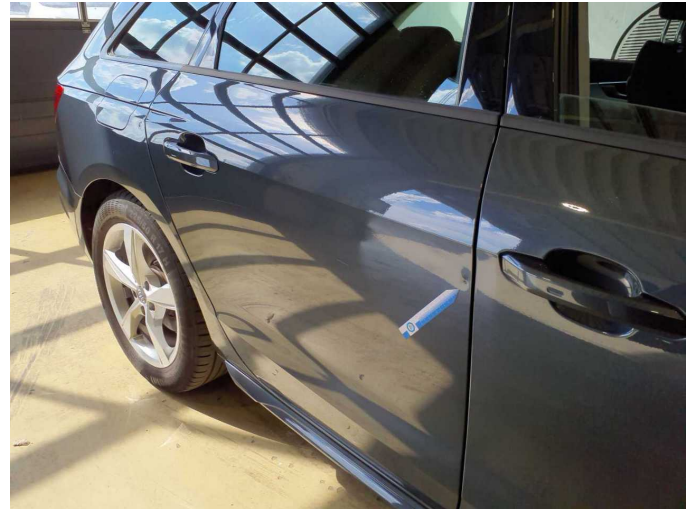


Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 11: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

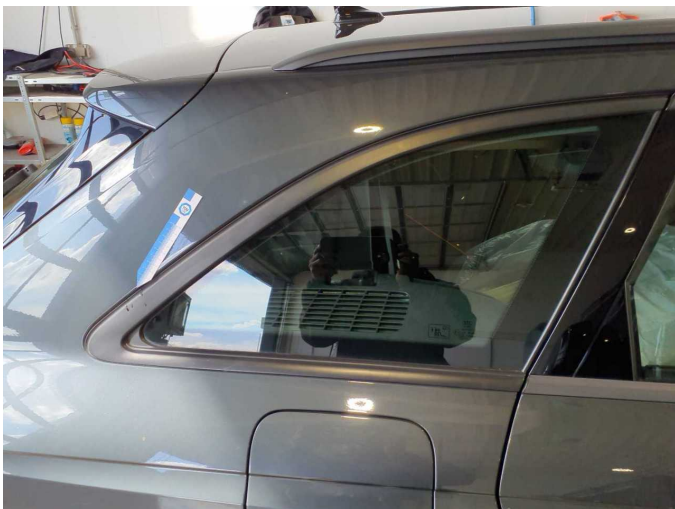

Damage 12: Door - rear right side: Window guide - Damaged - Replace

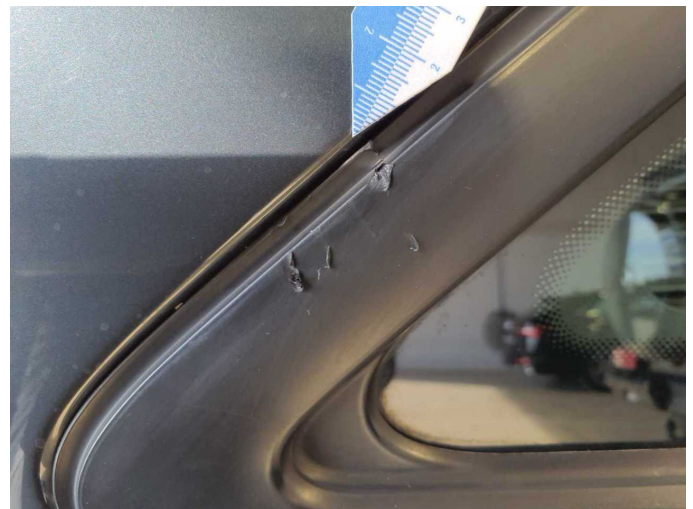

Damage 12: Door - rear right side: Window guide - Damaged - Replace



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint




Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint

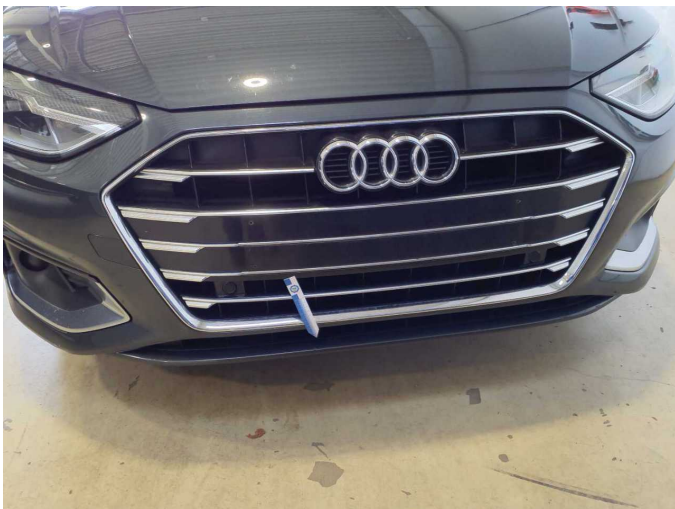

Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint




Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Front bumper: Front bumper - Scratch(es) - Paint

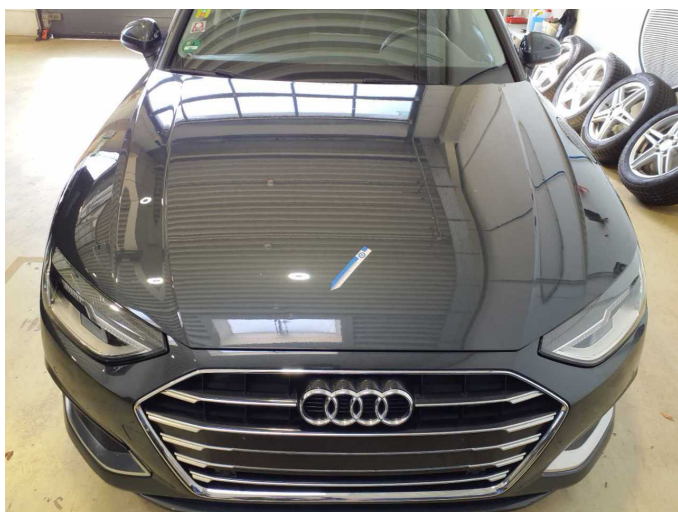

Damage 14: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage - Repair and paint



Damage 14: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage - Repair and paint



Damage 14: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage
- Repair and paint



Damage 14: Bonnet: Bonnet (+ Steinschläge) - Dent / paintcoat damage
- Repair and paint



Wear and tear 1: Front bumper: Grille - Scratch(es) - No deduction



Wear and tear 1: Front bumper: Grille - Scratch(es) - No deduction



Wear and tear 1: Front bumper: Grille - Scratch(es) - No deduction



Wear and tear 1: Front bumper: Grille - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF43MA002382
Hersteller / Modell: AUDI AUDI A4 Avant 35 TDI S tronic

Datum	KM-Stand	Beschreibung
15.08.2025	135.826	AU; Wartung Sonstiges
18.11.2024	114.207	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
22.08.2024	105.029	Bremsflüssigkeit; Bremsflüssigkeit ern
09.07.2024	101.962	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
15.11.2023	87.009	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.07.2023	78.154	HU + AU
03.01.2023	57.975	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
16.11.2022	55.677	Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst; Wartung Sonstiges
02.09.2022	45.456	Bremsflüssigkeit; Bremsflüssigkeit ern; Reparatur Sonstiges
13.04.2022	29.880	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges