



Expertise

Protocol number: 41285805  
Order No. / Reference: 25124382  
Inspection date: 29 Aug 2025

Manufacturer: Audi

Model: A4 Avant 35 TDI S tronic

VIN: WAUZZZF4XNA017298



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 35 TDI S tronic	
Vehicle Identification number	WAUZZZF4XNA017298
Mileage (Read)	89,241 km
First registration	10 Feb 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	
Power / Engine displacement	120 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	ibisweiss (Y9C)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / complete	<b>Next maintenance in</b>	14,200 km
<b>Last maintenance on / at</b>	07/2025 at 88,386 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	GF507010
<b>Previous damage / Accident</b>	None detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	0588 / BPK 00740		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	2,165 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98Y	Summer tyres on Light alloy	Sonstige	5mm / 5mm
2)	225/50 R17 94H	Summer tyres on Light alloy	Pirelli	5mm / 5mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2025		

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

## Equipment

### Standard equipment

- |   |   |
|---|---|
| <ul style="list-style-type: none"> <li>• AdBlue tank (12 liters)</li> <li>• Airbag: Front side airbags and head airbag system</li> <li>• Anti-lock braking system (ABS)</li> <li>• Audi connect emergency call &amp; service with Audi connect Remote &amp; Control</li> <li>• Exterior mirror housings in body color</li> <li>• Brake light, third raised</li> <li>• Roof rails black</li> <li>• Diesel particulate filter (DPF)</li> <li>• Door sills with aluminum inserts at the front</li> <li>• Electronic differential lock (EDS)</li> <li>• Driver Information System</li> <li>• Electric window lifter</li> <li>• Windscreen with acoustic glazing</li> <li>• Floor mats front and rear</li> <li>• Transmission: S tronic 7-speed</li> <li>• Top speed limited to 210 km/h</li> <li>• Dimmable interior mirror</li> <li>• ISOFIX and Top Tether child seat attachment for the outer rear seats</li> <li>• Headrests (5)</li> <li>• LED rear lights</li> <li>• Steering wheel: Leather steering wheel in 3-spoke design with multifunction</li> <li>• Mild hybrid</li> <li>• Non-smoking version</li> <li>• Wheel: Rolling resistance optimized tires, speed limited</li> <li>• Radio accessories: 8 speakers (passive) front and rear</li> <li>• Tire pressure monitoring display</li> <li>• Power steering, electromechanical</li> <li>• Seats: Standard seats in the front</li> <li>• Seats: Front seats manually adjustable</li> <li>• Bandage material with warning triangle</li> <li>• Electronic immobilizer</li> <li>• Turning loading floor</li> </ul> | <ul style="list-style-type: none"> <li>• Airbag for driver and front passenger</li> <li>• Accent surfaces matt black</li> <li>• Traction control (ASR)</li> <li>• Audi pre sense city</li> <li>• Exterior mirrors electrically adjustable and heated</li> <li>• Vehicle tool kit</li> <li>• Fabric headliner</li> <li>• Decorative inlays diamond lacquer silver grey</li> <li>• tachometer</li> <li>• Electromechanical parking brake</li> <li>• Electronic Stabilization Control (ESC)</li> <li>• Chassis: Standard chassis</li> <li>• Window sill strips in black (rubber)</li> <li>• Radio key, without SafeLock</li> <li>• Cruise control including speed limiter</li> <li>• Rear window wiper</li> <li>• Interior lighting</li> <li>• Parental controls</li> <li>• Automatic air conditioning</li> <li>• trunk floor mat</li> <li>• Load compartment cover manually</li> <li>• LED headlights</li> <li>• Steering column, manually height and axially adjustable</li> <li>• Light/rain sensor</li> <li>• Front center armrest</li> <li>• Wheel: light alloy wheels, 5-arm</li> <li>• Radio: MMI Radio plus</li> <li>• Radio accessories: Digital radio reception (DAB)</li> <li>• Tire repair kit</li> <li>• Seat covers in fabric index</li> <li>• Seats: Folding rear seat backrest</li> <li>• Start-stop system</li> <li>• Glazing: Windscreen with thermal insulation and acoustic glazing</li> <li>• Central locking "Keyless-Go" without safe security</li> </ul> |
|---|---|

### Extra equipment

- |  |  |
|--|--|
| <ul style="list-style-type: none"> <li>• Business package (MMI navigation plus with MMI touch (including driver information system with color display) - Audi phone box - 3-spoke leather steering wheel with multifunction plus - Heated front seats - Frameless, automatically dimming interior mirror - Electrically adjustable, heated, and folding exterior mirrors with automatic dimming on both sides - Rear parking aid - High beam assistant - Manual sunblind for the rear door windows)</li> </ul> | <ul style="list-style-type: none"> <li>• 3-zone comfort automatic climate control (in addition to the automatic climate control: - climate control panel with large TFT display and capacitive rocker switches - electronically regulates the air temperature and distribution individually for the driver and front passenger - additional climate control panel for adjusting the rear compartment temperature in the rear center console - automatic air recirculation control with dust and odor-separating allergen filter - residual heat utilization)</li> <li>• Matt brushed aluminum decorative inlays (for dashboard, door panels and center console)</li> </ul> |
|--|--|



- Electrically adjustable, heated, and folding exterior mirrors, automatically dimming on both sides, with memory (including automatic curb-closing function for the passenger exterior mirror with integrated LED indicators, including heated windshield washer nozzles, aspherical mirror glass. The automatic curb-closing function folds the passenger exterior mirror down when reverse gear is engaged, giving the driver a better view of the curb.)
- Elimination of model name and performance/technology lettering
- Front sports seats
- Fuel tank with increased filling volume (54 l)
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Heated front seats
- High Beam Assistant (within the system's limits, it automatically detects the headlights of oncoming traffic, the taillights of other road users, and light sources in built-up areas. Depending on the traffic situation, the high beam is automatically switched on or off. The system thus improves the driver's visibility and increases comfort.)
- LED headlights and LED taillights with dynamic indicators (daytime running lights, dipped beam, high beam, position light, indicator, cornering light, all-weather light, maneuvering light, motorway light (extended lighting range from a speed of 110 km/h), static cornering light, automatic dynamic headlight range control, intersection light (in conjunction with MMI navigation system) - indicator, brake, tail, reversing and rear license plate lights in LED technology. - brake lights in LED technology)
- Paint finish: Uni
- Rearview camera (facilitates maneuvering by displaying the area behind the vehicle on the MMI display with dynamic and static auxiliary elements. Two modes (perpendicular parking and trailer mode with factory-installed tow bars) can be selected. Depending on the selected mode, the calculated lane as well as auxiliary and guide lines are displayed. The rearview camera is discreetly integrated into the handle bar of the trunk lid. Activated by engaging reverse gear.)
- Wheel: Light alloy wheels, 10-spoke (size 7.5 J x 17 with tires 225/50 R 17 forged)
- Parking Aid Plus (Acoustic and visual parking aids at the front and rear assist with parking and maneuvering. With selective, visual display of the distance to detected objects on the MMI display, depending on the current steering angle and direction of travel. The virtual lane indicator also offers lateral guidance lines that are calculated in advance based on the currently selected steering angle. Measurement is performed by ultrasonic sensors discreetly integrated into the bumpers.)
- Phone: Audi Phone Box (same features as Bluetooth interface; additional functions: - inductive charging function (Qi standard) with 5 watts including forget-phone warning and charging status display in the MMI - telephone holder measuring 170 × 87 mm in the front center armrest - hands-free calling with up to two connected mobile phones possible, including in-vehicle coupling antenna for connecting the mobile phone to the external antenna, thus reducing radiation in the vehicle interior and significantly improving reception quality; with LTE support)
- S line interior package (front sports seats - S line seat upholstery in black sequence fabric/leather combination with S embossing on the front seat backrests - 3-spoke leather steering wheel with black multi-color plus (steering wheel grips in perforated leather) with S emblem; with contrasting stitching, color-coordinated with the respective interior color; with shift paddles - matt brushed aluminum trim inserts - black glass-look accent panels - front door sills with aluminum inserts, illuminated - stainless steel pedals and footrest - front floor mats - black fabric headliner)
- Seat covers in Sequenz fabric/leather (seat center panels in Sequenz fabric black, seat side bolsters and headrest center panels in black leather with contrast stitching - with S-embossing in the front seat backrests)
- Steering wheel: Sport contour leather steering wheel in 3-spoke design, flattened at the bottom with multifunction plus (with more contoured steering wheel rim; adjustable in height and reach; with 12 multifunction buttons for convenient operation of the existing infotainment features and shift paddles for manual gear changes with automatic transmission)

## Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

## Value reducing factors



No.	Component group	Description
1	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
2	Door - rear left side	Door (Abdunkelungsnetz) - Deformed - Replace

## Wear and tear

No.	Component group	Description
1	Steering system	Steering wheel - Abrasion - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Front bumper	Front bumper - Scratch(es) - No deduction
4	Seat - front	Seat cover - left side - Abrasion - No deduction
5	Side panel - rear right side	Sill (1) - dent(s) - No deduction
6	Side panel - rear left side	Sill - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

## Missing parts

### Description

2nd wheel set - 1 wheel cover (1x Nabendeckel)

## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



## Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

## Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigten, nicht demontierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.

Der Winterradsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.





**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)




**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front

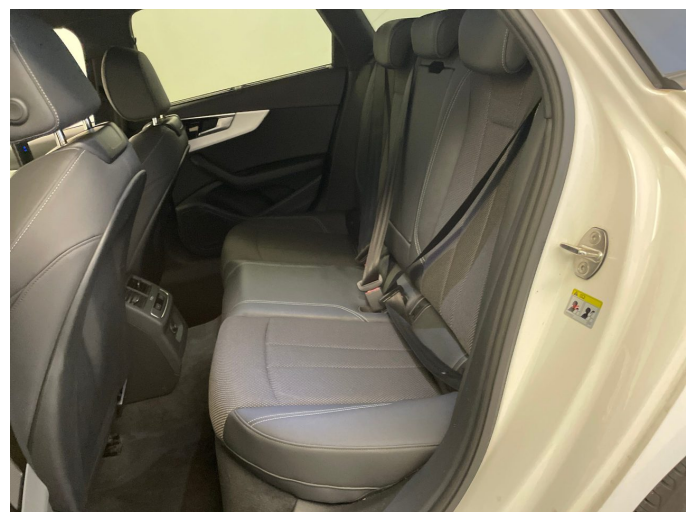

**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

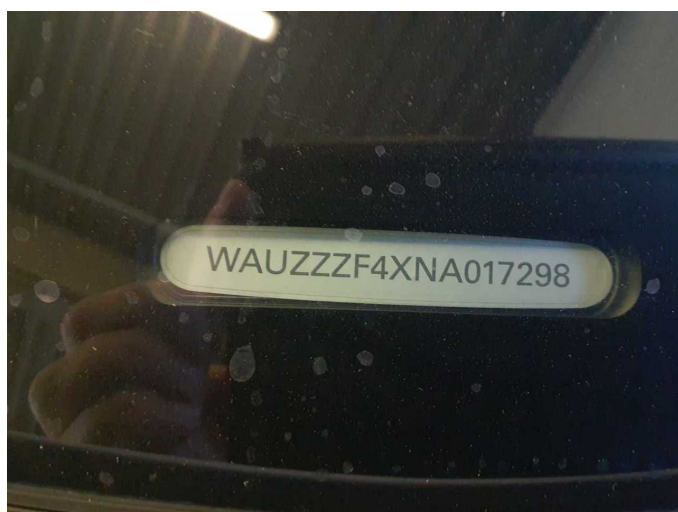


Figure 12: VIN





Figure 13: Mounted tyres

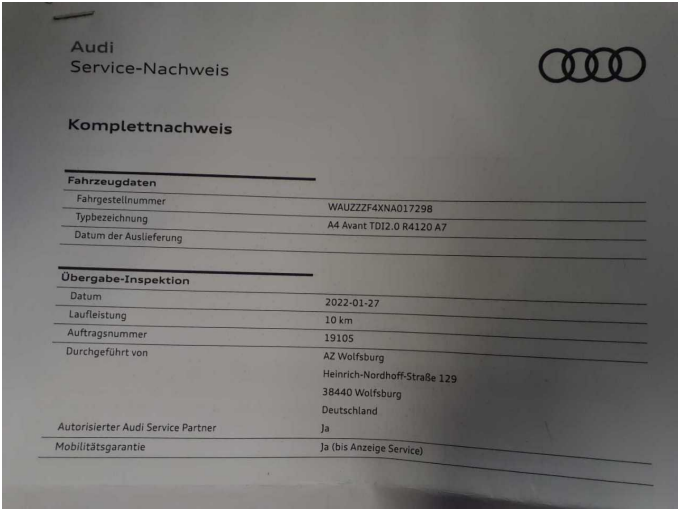


Figure 14: Documents

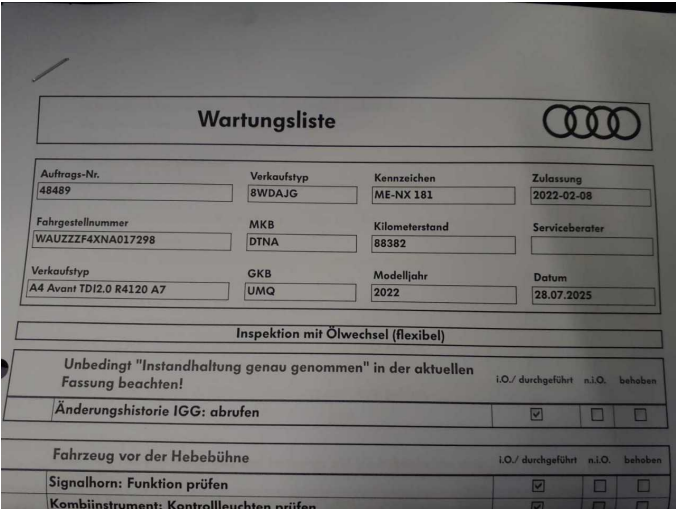


Figure 15: Documents

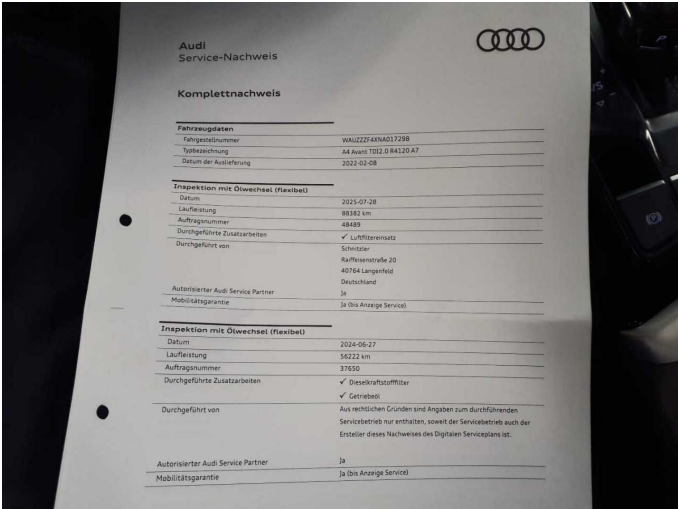


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation

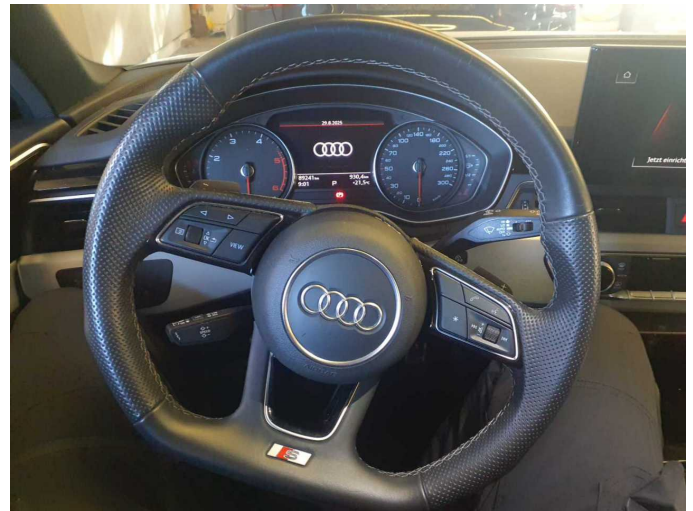


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



**Damage 1:** Door - front right side: Door handle - outside - Scratch(es) - Smart repair



**Damage 1:** Door - front right side: Door handle - outside - Scratch(es) - Smart repair



**Damage 2:** Door - rear left side: Door (Abdunkelungsnetz) - Deformed - Replace






**Damage 2:** Door - rear left side: Door (Abdunkelungsnetz) - Deformed - Replace



**Wear and tear 1:** Steering system: Steering wheel - Abrasion - No deduction

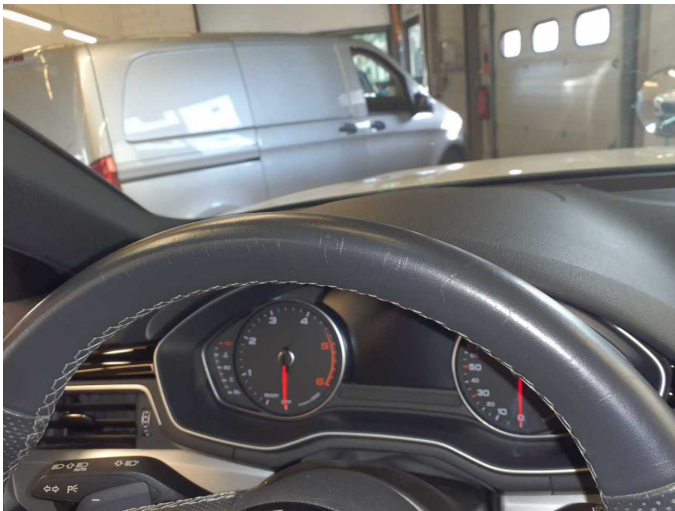

**Wear and tear 1:** Steering system: Steering wheel - Abrasion - No deduction



**Wear and tear 1:** Steering system: Steering wheel - Abrasion - No deduction



**Missing part 1:** 2nd wheel set: 1 wheel cover (1x Nabendeckel) - Missing - Replace



**Missing part 1:** 2nd wheel set: 1 wheel cover (1x Nabendeckel) - Missing - Replace



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF4XNA017298  
Hersteller / Modell: AUDI AUDI A4 Avant 35 TDI S tronic

Datum	KM-Stand	Beschreibung
28.07.2025	88.386	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.03.2025	67.461	AU
28.06.2024	56.222	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
01.02.2024	48.240	Bremsflüssigkeit; Bremsflüssigkeit ern
24.08.2023	40.215	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
17.03.2023	27.711	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.09.2022	13.999	Motoröl b. Wartung; Ölwechsel