



status report

customer: Bank 11, Neuss
contract number: 965399630
reference:

vehicle data

Audi A5 Sportback 40 TDI sport

Vehicle identification number	WAUZZZF57KA068424	mileage read:	154314 km
First Registration / construction year:	02.08.2019 / 2019	Visit Date / place of birth:	17.07.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	hatchback	KBA no. :	0588//BJN
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	1968 ccm / 140 kW (190 PS)	Engine:	front-wheel drive
paint:	Manhattangrau Metallic	Number of previous owners:	Unbekannt
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / fabric
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	3 - Average
visit condition:	-	condition inside:	3 - Average
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
Hard Disk Drive	2	no / -	- / -

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	aluminum
1st axis - Left / states .	Anderer	225/50/R17/94H 2 mm
1st axis - right / states .	Anderer	225/50/R17/94H 2 mm
2nd axis - Left / states .	Anderer	225/50/R17/94H 5 mm
2nd axis - right / states .	Anderer	225/50/R17/94H 5 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag deactivated • Anti-Blockier-System (ABS) • Audi Drive Select • Mirrors aspheric, right • LED turn signals integrated into outside mirrors • • Electron. Stability control (ESC) • Velour floor mats • Transmission 7-speed - dual-clutch S -tronic • Tailgate opening automatically • • Light sensor (Coming Home , Leaving Home) • Engine 2.0 ltr. - 140 kW 16V TDI • Non smoking package • Tire repair kit • • • Windscreen wipers with rain sensor • • Front sports seats <i>Sitze vorn mit ausziehbarer Oberschenkelauflage</i> • LED daytime running lights •	• Airbag driver / passenger side • • Mirrors aspherical, left • Exterior mirror body color • brake Assist • Electron. Stability Program (ESP) • Driving Assistance System City Emergency Braking (Audi pre sense City) • Speed ??Begrenzeranlage • Gloss package • Isofix seats for child seat • • • Multi Media Interface MMI Basic Plus / MMI Radio Plus • Electro-mechanical parking brake • Tire Pressure Monitoring System • Rear seat back split / hinged (402040) • Heated windshield washer nozzles • SCR (AdBlue technology) • Power steering electro-mechanical • Start / Stop system • • Central locking / starting system Keyless-Go

special Features	
• Storage and luggage compartment package • Assistance package Town <i>Einparkhilfe vorn und hinten, optisch (APS Plus), Fahrassistenz-System: Insassen-Schutzsystem (Audi pre sense basic), Rückfahrkamera, Fahrassistenz-System:</i>	• Trailer hitch (ball head pivots) • Assistance package tour <i>Fahrassistenz-System: Adaptive Geschwindigkeitsregelanlage (Adaptive Cruise Control) mit Autom. Distanzregelung, Fahrassistenz-System: Bremsassistent (Audi pre sense front),</i>



Querverkehrs-Assistent Heck, Fahrassistenten-System:

Spurwechselassistent (Side Assist) inkl. Audi pre sense rear

- Audi connect (emergency call and assistance system)
- Equipment package S line sports package / Plus
Einstiegsleisten mit Aluminiumeinlage und Schriftzug, beleuchtet, Innenausstattung: Dekoreinlagen Aluminium Matt, Dachhimmel Stoff, schwarz, Sitzbezug / Polsterung: Leder / Stoff Sequenz mit Logo-Prägung in Vordersitzlehnen, Sportsitze vorn, Sitze vorn mit ausziehbarer Oberschenkelaufgabe, Sport-Fahrwerk, LM-Felgen
- Bluetooth hands-free kit with voice recognition (Audi Phone Box)
- Driving Assistance System Traffic Sign Recognition
- Urea tank (SCR) 24 Ltr .
- Rearview mirror with auto dip
- Convenience key with sensor-controlled tailgate release
- Fuel tank 54 Ltr .
-
-
- Metallic paint
- Multi-Media Interface MMI Navigation plus with MMI touch
Audi connect (Internetbasierende Dienste), Fahrer- Informations-System (FIS) mit Farbdisplay
- Sound system DSP / Audi sound system
- jack

Fahrassistenten-System: Stauassistent, Fahrassistenten-System:

Prädiktiver Effizienz-Assistent, Fahrassistenten-System:

Ausweich-Assistent, Fahrassistenten-System: Abbiege-Assistent links

- Outfit S line Package Selection
Exterieur-Paket S line, Einstiegsleisten mit Aluminiumeinlage und Schriftzug, beleuchtet, Schwellerleisten Sport-Design, Stoßfänger Sport-Design mit Diffusoreinsatz hinten, Scheinwerfer LED, Abbiege- und Allwetterlicht, Heckleuchten LED mit dynamischem Blinklicht, Tagfahrlicht LED, LM-Felgen
- Power side mirrors . adjustable , heating and folding
Außenspiegel mit Bordsteinautomatik, rechts
- Driving Assistance System Start Assist (hold assist)
- Rear seats (3 seats)
- Interior Interior elements in imitation leather
- Comfort climate control 3 zones
-
- LM rims 8x18 (10 parallel spokes, for winter tires)
- Steering wheel (sports / leather - 3-spoke , flat-bottomed) with multifunction plus
- Audi Matrix LED headlights
Abbiege- und Allwetterlicht, Heckleuchten LED mit dynamischem Blinklicht, Scheinwerfer-Reinigungsanlage (SRA)
- Front center armrest with compartment
-
- USB interface for rear passengers

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:

not possible

A visit to the underside of your vehicle could not be performed.

Hoist or lifting means not available .

Mileage plausible:

not testable

not testable

reference:

Note Road Safe:

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit					
Alternator / Generator:		examined limited	Battery / accumulator:		examined limited
oil loss:		examined limited			
air conditioning:		examined limited	lighting system:		examined limited
coupling:		unavailable	exhaust System:		examined limited
engine running:		examined limited	shock absorber:		not possible
transmission:		examined limited			

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Kosten- und Schadenserweiterung möglich.

damage



component	Damage	Rep kind
1. proof of maintenance	Missing	Replace
2.	Scratch(es)	Replace
3. tire front - right	Worn	Replace
4. tire front - right	Worn	Replace
5. Sidewall - Rear - right	Delle	Smart repair
6. Rear bumper	Scratch(es)	Refurbish and paint
7. Rear door - left	Delle	Smart repair
8. hood	Chipping from stones	Smart repair
9. Front bumper	Scrape	Refurbish and paint
10. Windshield	Wear and tear	acceptable
11. maintenance	Due	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims




engine compartment

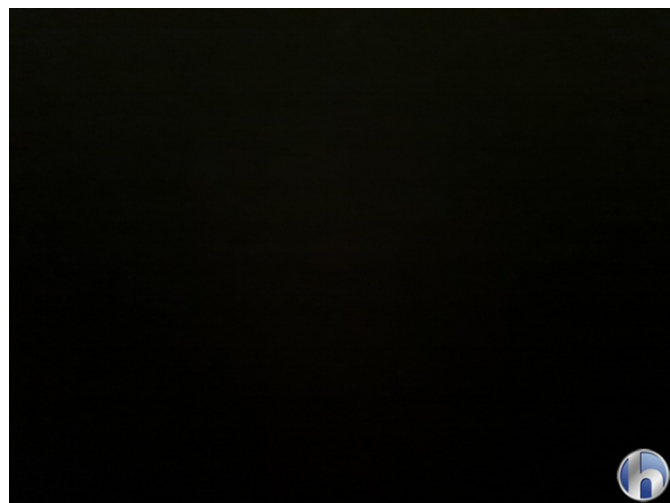

service book



Others

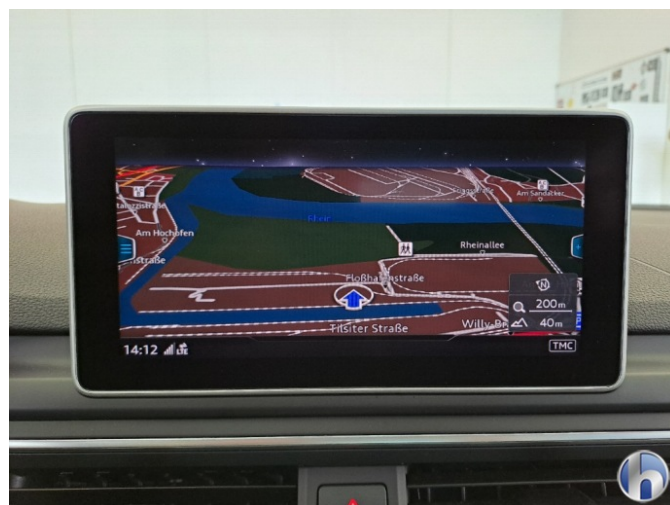

Navigation system



2.



3. tire front - right



4. tire front - right



5. Sidewall - Rear - right



5. Sidewall - Rear - right



6. Rear bumper



6. Rear bumper



6. Rear bumper



7. Rear door - left




7. Rear door - left




7. Rear door - left



8. hood

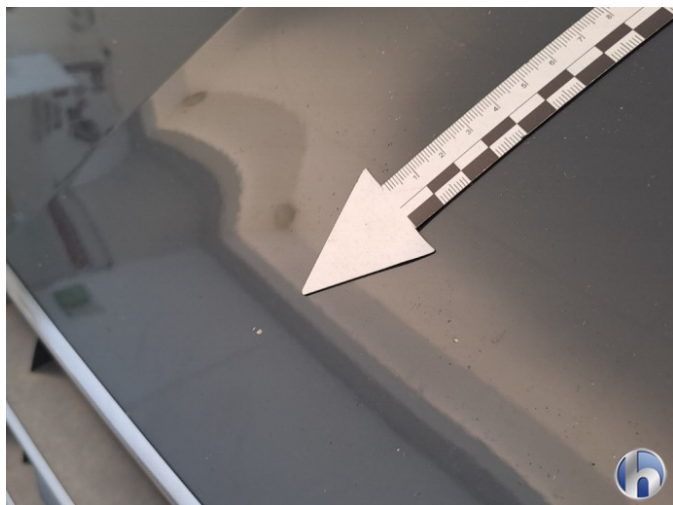

8. hood

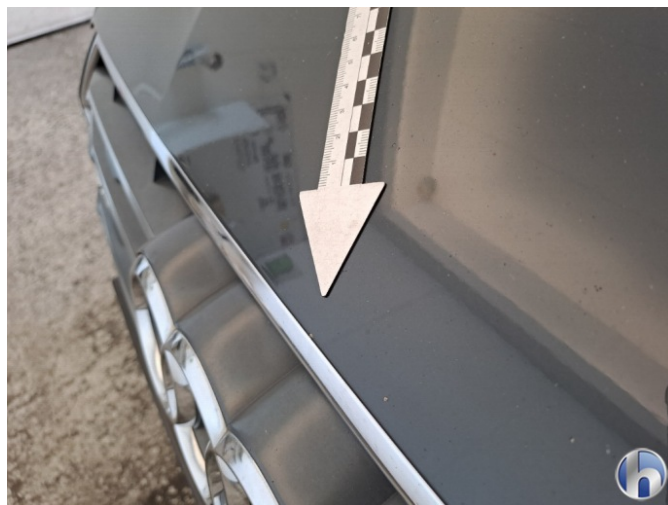

8. hood



9. Front bumper



9. Front bumper



9. Front bumper



9. Front bumper



9. Front bumper



10. Windshield



10. Windshield