



Expertise

Protocol number: 41579437
Order No. / Reference: 25145359
Inspection date: 15 Sept 2025

Manufacturer: Audi
VIN: WAUZZZFY2L2099022

Model: Q5 55 TFSI e quattro S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q5 55 TFSI e quattro S tronic	
Vehicle Identification number	WAUZZZFY2L2099022
Mileage (Read)	128,486 km
First registration	1 Sept 2020
Number of holders	2
Power / Engine displacement	185 kw / 1,984 ccm
Fuel type / Cylinder	Hybr.B/E ext. edition / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Brillantschwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	10,800 km
Last maintenance on / at	03/2025 at 120,175 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FU607079
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BRG 00051		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,620 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103V	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	235/60 R18 103W	Summer tyres on Light alloy	Hankook	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R19 101H	Winter tyres on Light alloy	Continental	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Airbag for driver and front passenger • All-wheel drive "quattro" with ultra technology • Traction control (ASR) • Audi drive select • Audi pre sense city • Hill descent assistant • roof edge spoiler • Roof rails with roof rack detection, anodized • tachometer • Electromechanical parking brake • Electronic Stabilization Control (ESC) • Chassis: Dynamic chassis • Velour floor mats front and rear • Transmission: S tronic (7-speed) • Rear window wiper • Manual parental control • Comfort automatic climate control 3 zones • Comfort key (without safe lock) • Front headrests • Charging cable Mode 3 for public charging 11 kW • Light/rain sensor • Armrest - centre, rear • Mains charging cable • Gloss Package • Wheel: 18" cast aluminum wheels (4 pieces) in 5-arm turbine design • Radio: MMI Radio plus • Radio accessories: Electrical interface for external use, AUX-IN and USB • Seat belts • Seats: Lumbar support for the front seats, electric (4-way) • Seats: Folding rear seat backrest • Start-stop system • Phone: Bluetooth interface • Bandage material with warning triangle • Thermal insulation glazing | <ul style="list-style-type: none"> • Airbag: Front side airbags and head airbag system • Anti-lock braking system (ABS) • Audi connect emergency call & service including vehicle control • Exterior mirror housings in body color • Fabric headliner • Roof cross bars • Micrometallic silver decorative inlays • Door sills with aluminum insert • Electronic differential lock (EDS) • Driver information system with color display • Electric windows front and rear • Speed limiter, adjustable • Heated rear window • Interior lighting • ISOFIX and Top Tether child seat attachment for the outer rear seats • Headrests (3) rear • Paint finish: Uni • Steering column mechanically adjustable in height and distance • Front center armrest • Gasoline particulate filter • Package S line exterior package • Wheel: Tire pressure monitoring indicator • Wheel: Tire repair kit • Radio accessories: Digital radio reception (DAB) • Windscreen wiper interval control with light sensor • Power steering, electromechanical • Seat covers in fabric Imprint • Seats: Rear seat bench plus • Seats: Sports seats front • Daytime running light • Separation net • Electronic immobilizer |
|---|---|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Rear airbag (side airbags) (Rear side airbags provide additional protection for rear seat passengers.) • Electrically adjustable, heated, and electrically folding exterior mirrors (with integrated LED indicators, convex, flat, or aspherical mirror glass, including heated windshield washer nozzles; the automatic curbside function folds the passenger mirror down when reverse gear is engaged, giving the driver a better view of the curb) | <ul style="list-style-type: none"> • Start-off assistant (holds the vehicle indefinitely after stopping on typical road gradients. The system is activated at the touch of a button and allows the driver to start off comfortably.) • Elimination of model name and performance/technology lettering |
|--|---|



- Convenience key (without Safelock) in conjunction with the Technology Selection package (TFSle, SQ5) (provides control for access and engine start authorization without the need to actively operate the vehicle key. With the electronic access and drive-away authorization system, you can open your vehicle via wireless communication between the key and the vehicle, using the doors and the trunk lid, and lock it via the sensors on the door handles. The convenience key must be carried for this. The engine is started and stopped using the engine start/stop button.)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus including steering wheel heating (with 14 multifunction buttons for convenient operation of the existing infotainment features such as audio skip, telephony, NAV button or steering wheel heating - adjustable in height and reach - with full-size airbag - shift paddles for manual gear changes)
- City Assistance Package (includes a selection of assistance systems specifically for city traffic - Parking aid plus - Rear view camera - Audi side assist, - Audi pre sense basic - Audi pre sense rear - Exit warning - Rear cross traffic assist)
- Technology selection package (comfort key - Audi virtual cockpit - MMI navigation plus with MMI touch - Audi smartphone interface)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Auxiliary climate control comfort (cools or warms the interior to a desired temperature before starting a journey, ensuring comfortable climate as soon as you enter the vehicle. Additionally, seat heating and ventilation, steering wheel heating, and glass surface heating can also be activated before starting a journey if these optional features have been selected. Can be programmed or activated with the MMI or via the smartphone app, regardless of whether the vehicle is charging at the time.)
- Glazing: Dark tinted glass in the rear (green tinted heat-insulating glass in the front)
- Luggage compartment lid, electrically opening and closing (The luggage compartment lid can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the luggage compartment lid handle. Closing the luggage compartment lid is just as easy and convenient as opening it: simply press the button on the inside of the luggage compartment lid, the button in the driver's door, or the button on the vehicle key. A closing aid makes manual closing easier when necessary.)
- Audi Matrix LED headlights with dynamic indicators front and rear (daytime running lights, dipped beam, position lights, indicators, cornering lights (supplementing side illumination on tight bends and when turning), all-weather lights (to reduce glare in poor visibility conditions), maneuvering lights (illuminating the swivel area when reversing), motorway lights (extended light range from a speed of 110 km/h), automatic dynamic headlight range control, dynamic cornering lights, headlight cleaning system)
- Tour Assistance Package (adaptive cruise control including Stop&Go function - traffic jam assist - predictive efficiency assistant - Audi pre sense front including evasive action assistant and turning assistant - Audi active lane assist - high beam assistant - camera-based traffic sign recognition - Audi pre sense city)
- Radio accessories: Adapter for media players with micro USB socket for the Audi music interface
- Front seat heating (heats seat and backrest center panel, with leather upholstery and sports seats; also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via direct selection button on the climate control panel)
- Phone: Audi Phone Box (same features as Bluetooth interface; additional functions: - inductive charging function (Qi standard) with 5 watts including forget-phone warning and charging status display in the MMI - telephone holder measuring 170 × 87 mm in the front center armrest - hands-free calling with up to two connected mobile phones possible, including in-vehicle coupling antenna for connecting the mobile phone to the external antenna, thus reducing radiation in the vehicle interior and significantly improving reception quality; with LTE support)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors



No.	Component group	Description
1	Rear bumper	Rear bumper (ist bereits im Unfallschaden berücksichtigt) - Scratch(es) - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
4	Rear bumper	Reflector - left side - Scratch(es) - Replace
5	Bonnet	Bonnet (Verätzungen) - Paint defect - Paint

Wear and tear

No.	Component group	Description
1	Door - front right side	Door - Dent / paintcoat damage - No deduction
2	2nd wheel set	3 alloy rims - Scratched - No deduction
3	Seat - rear	Backrest cover - Scratch(es) - No deduction
4	Door - rear left side	Door edge - Scratch(es) - No deduction
5	Door - front left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 3 Feb 2021	2.568,09 €

Accident damages

No.	Accident
1	Side right
2	Side - left

Repainting

No.	Repainting
1	Side panel - rear right side, Door - rear right side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	220 µm	Door - rear right side	250 µm
Door - front right side	194 µm		

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs

- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden

- Minderwerte höher als HEK



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

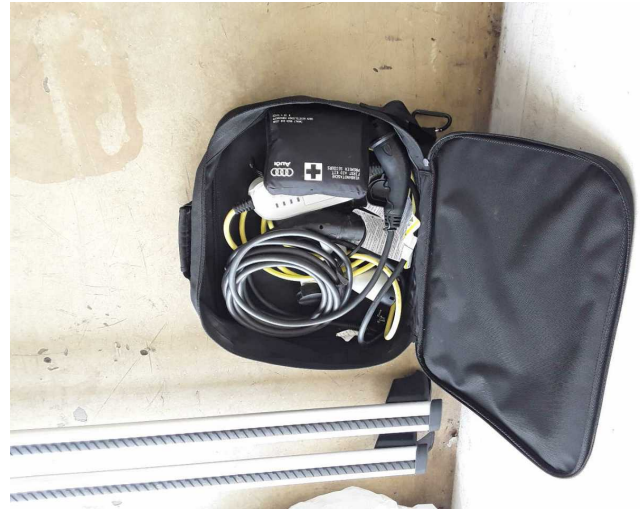


Figure 20: Misc.

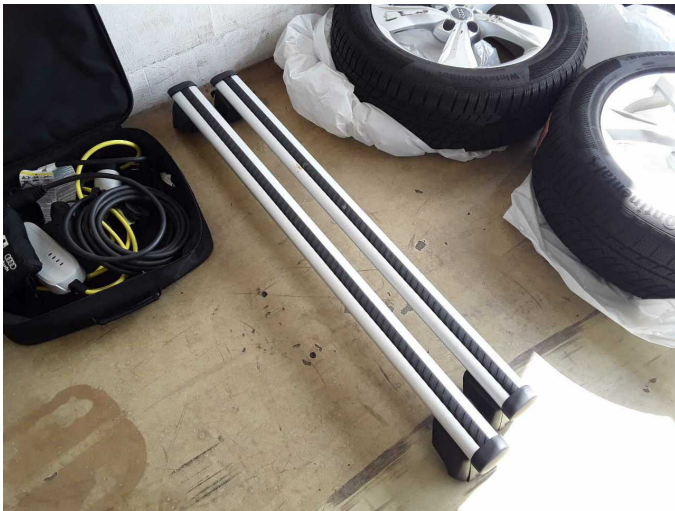



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

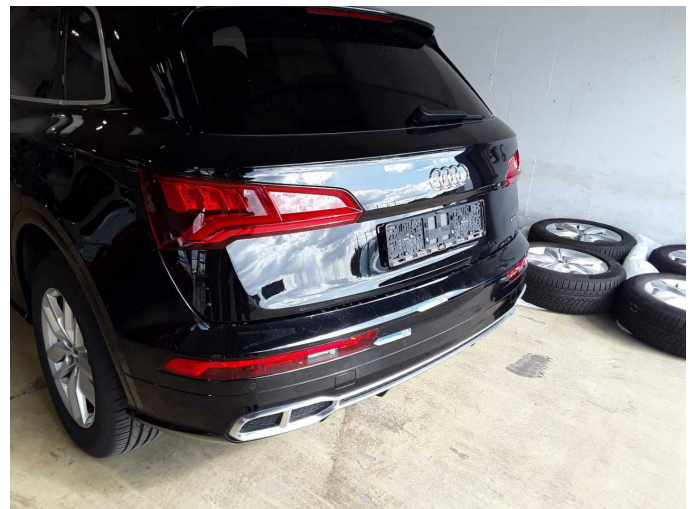

Damage 1: Rear bumper: Rear bumper (ist bereits im Unfallschaden berücksichtigt) - Scratch(es) - No deduction



Damage 1: Rear bumper: Rear bumper (ist bereits im Unfallschaden berücksichtigt) - Scratch(es) - No deduction



Damage 1: Rear bumper: Rear bumper (ist bereits im Unfallschaden berücksichtigt) - Scratch(es) - No deduction




Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

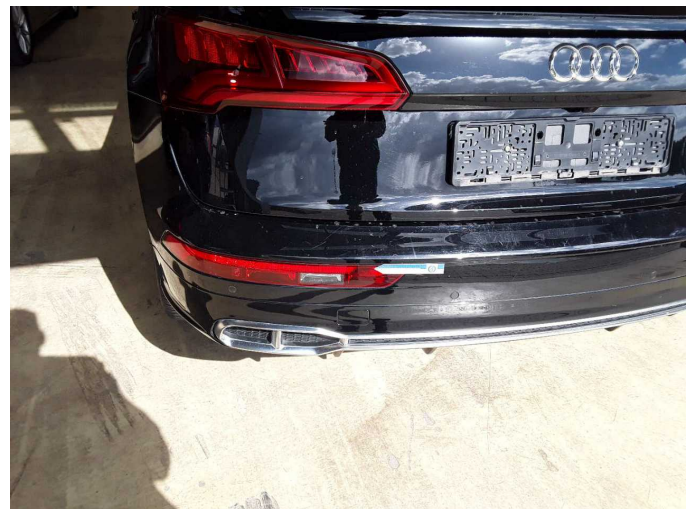

Damage 4: Rear bumper: Reflector - left side - Scratch(es) - Replace




Damage 4: Rear bumper: Reflector - left side - Scratch(es) - Replace




Damage 5: Bonnet: Bonnet (Verätzungen) - Paint defect - Paint




Damage 5: Bonnet: Bonnet (Verätzungen) - Paint defect - Paint

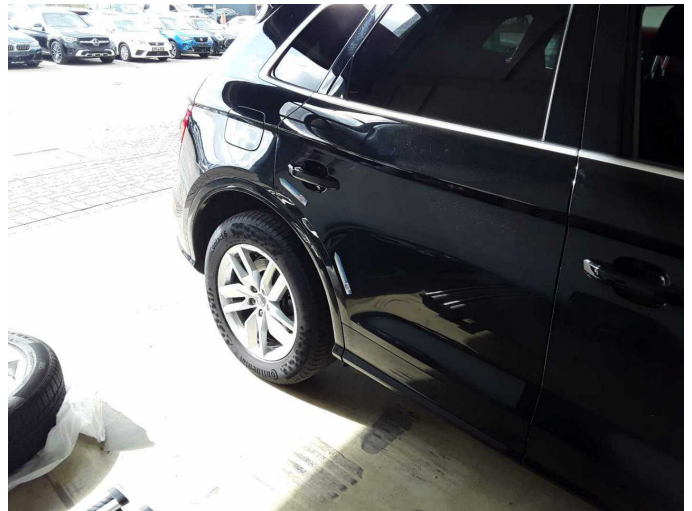

Accident 1: Side right

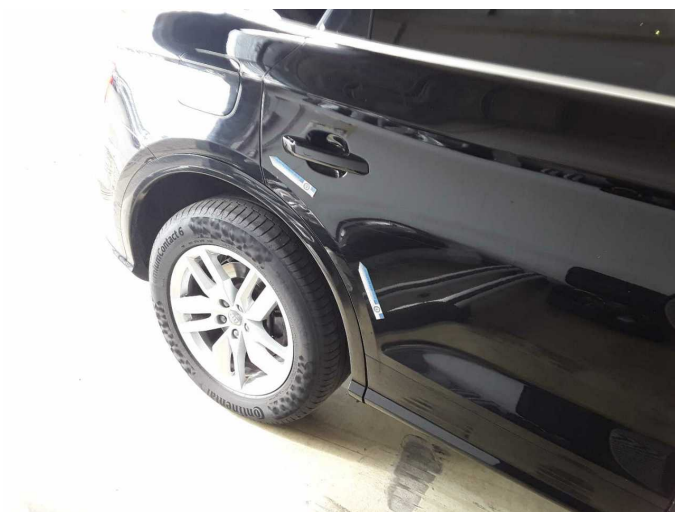


Accident 1: Side right

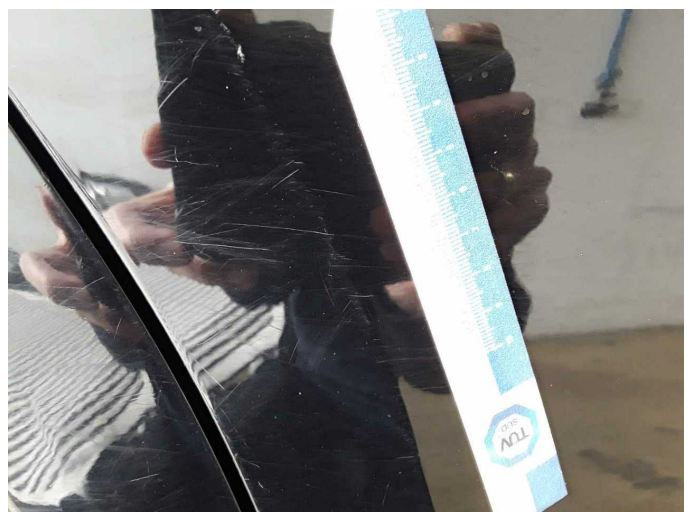


Accident 1: Side right



Accident 1: Side right

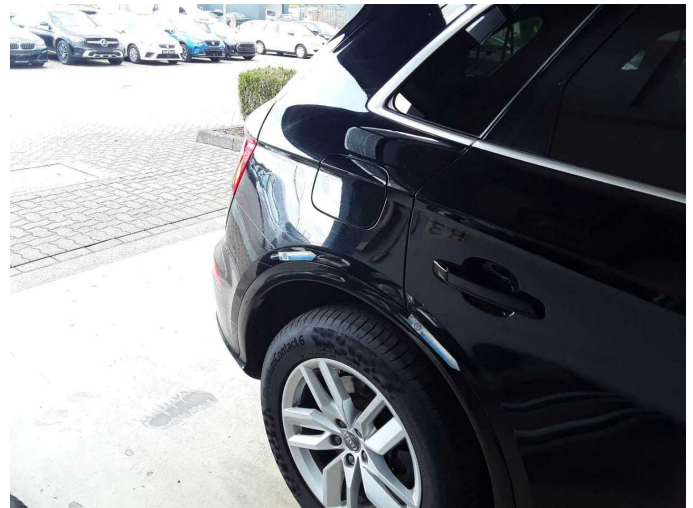


Accident 1: Side right

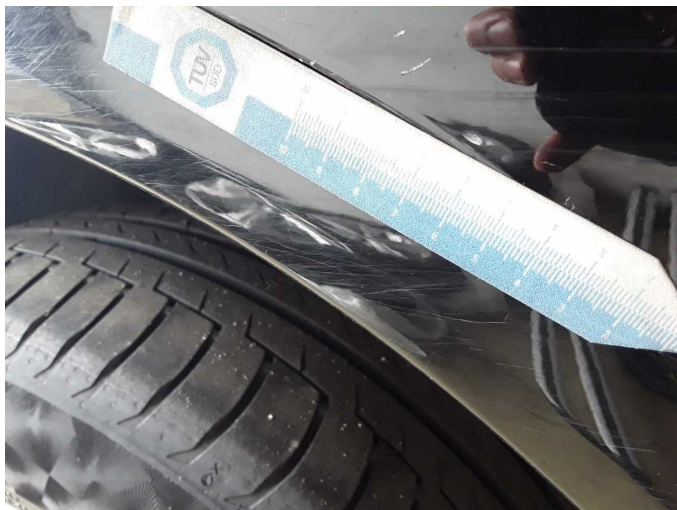

Accident 1: Side right




Accident 1: Side right

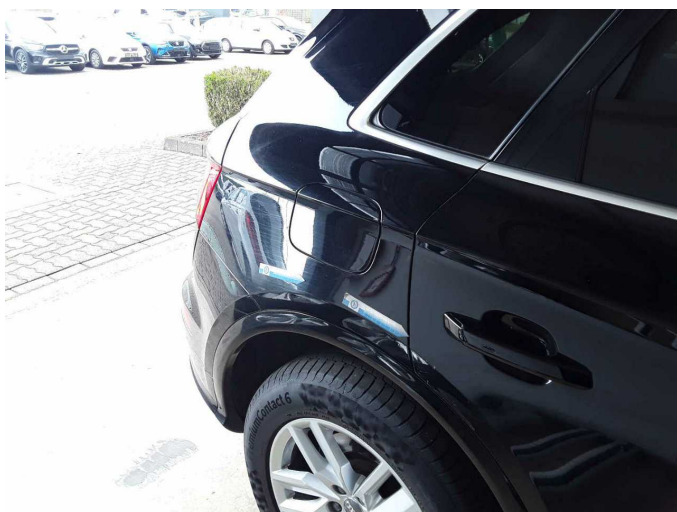

Accident 1: Side right



Accident 1: Side right

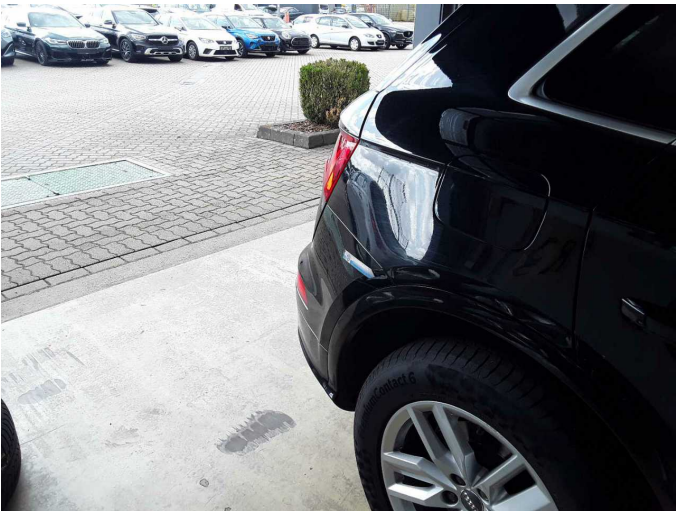

Accident 1: Side right



Accident 1: Side right



Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left




Accident 2: Side - left



Accident 2: Side - left



Accident 2: Side - left

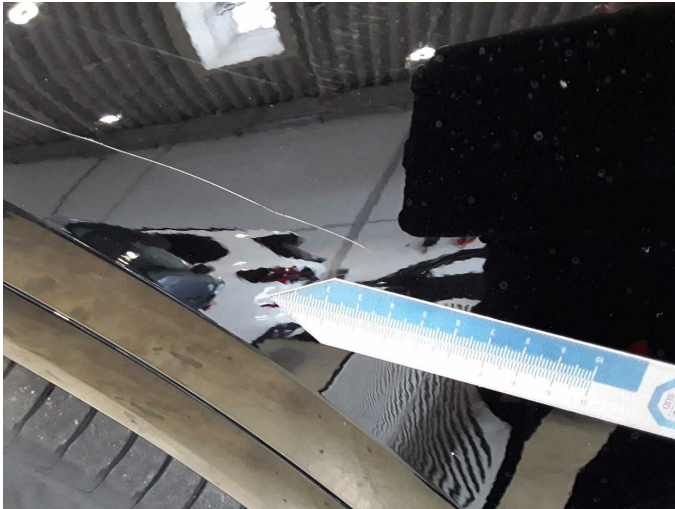

Accident 2: Side - left



Accident 2: Side - left




Accident 2: Side - left



Repainting 1: Side panel - rear right side, Door - rear right side, Door - front right side




Repainting 1: Side panel - rear right side, Door - rear right side, Door - front right side

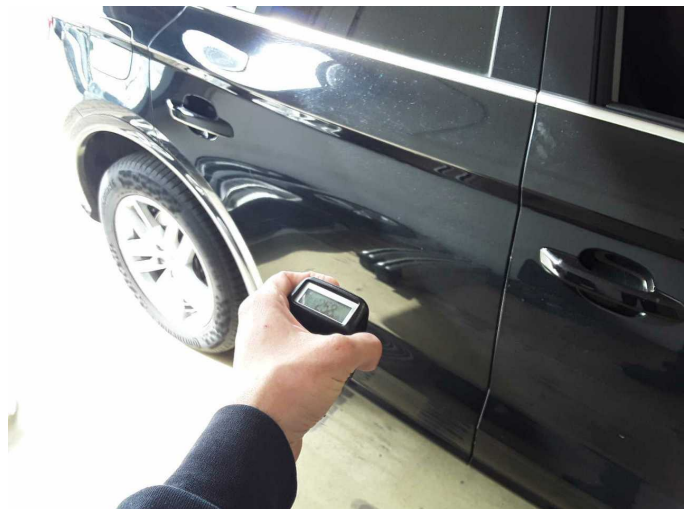


Repainting 1: Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Side panel - rear right side, Door - rear right side, Door - front right side

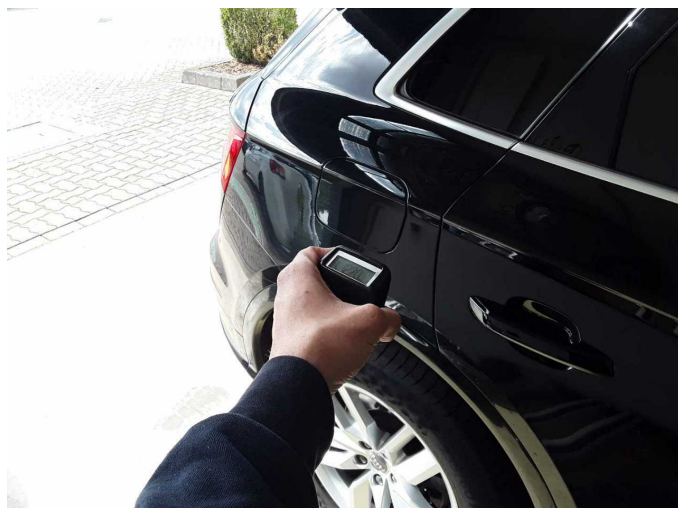

Repainting 1: Side panel - rear right side, Door - rear right side, Door - front right side

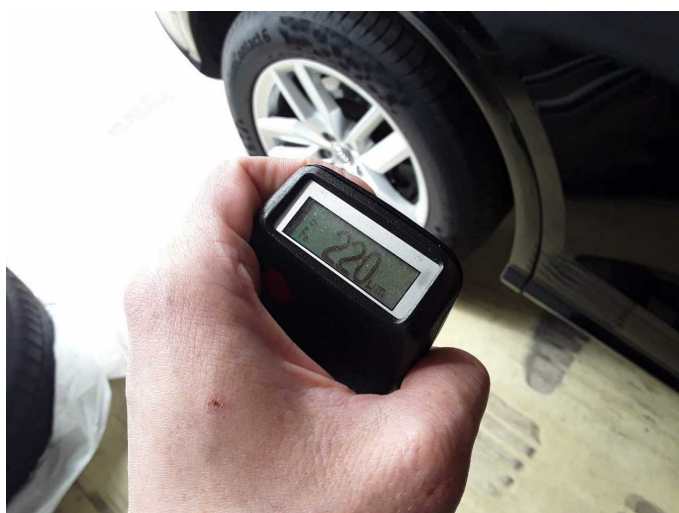

Repainting 1: Side panel - rear right side, Door - rear right side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF2L2099022
Hersteller / Modell: AUDI AUDI Q5 55 TFSI e quattro S tronic

Datum	KM-Stand	Beschreibung
22.08.2025	128.378	Getriebeöl ern/prüfen; Reparatur Sonstiges
18.03.2025	120.175	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
10.12.2024	114.607	Regelwartungsdienst; Zündkerzen ern
16.09.2024	106.668	Bremsflüssigkeit; Bremsflüssigkeit ern
08.11.2023	90.616	AU
11.07.2023	84.428	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges
20.02.2023	68.726	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
14.09.2022	53.568	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Zündkerzen ern
11.07.2022	48.074	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.10.2021	29.759	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.05.2021	15.711	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges