



AUDI Q5
Q5 40 TDI quattro S tronic

VIN NO WAUZZZF7M2110727

Registration Number Y7M2110727



MOT Date

2026-07-01

Last Service

2025-07-02

Number of Owners

1

Last Service Mileage

112263

Number of Keys

2

First Registration Date

2021-07-30

Odometer Reading

115678 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250908084904
Inspection Date / Place	2025-09-08 / BCA Neuss	Cosmetic Grade	4

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Diesel	Road Worthy	Yes
Colour	Black	Engine Size (cc)	1968
Engine Size	2.0	No of Doors	5
Body Type	SUV	Drive Train	All-Wheel-Drive permanent
Seat Colour		No of Seats	5
Seat Covering Name	anthrazit	Seat Covering	Cloth/Leather
Charging Cables		NEDC CO2 Rating (q/km)	142
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





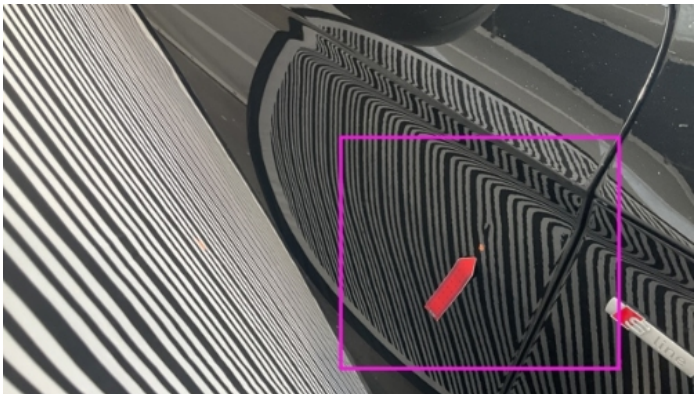

Equipment

Tinted Glass	Airbag Status	Ambientlighting	Bluetooth telephone interface
Diesel particulate filter	Digitaldashboard	Heated wing mirrors	Remote central locking
Roof rails	Stability control	Electrictailgate	LED Headlamps
Rear parking sensors	USB Socket	Alloys wheels	Anti-lock braking
Cruise control	Digital Radio	Front parking sensors	Remote adjusting wing mirrors
Reversing Camera	Satellite navigation	Electrically folding wing mirrors	Leather steering wheel
Radio			


Equipment Details

Air Conditioning	Three Zone Climate Control	Alloy Wheel Size	20
Seat Heating	Front		


Wheels & Tyres

Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	6	Extra Wheel - 4 Tyre Depth	6
Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5

11 Schäden

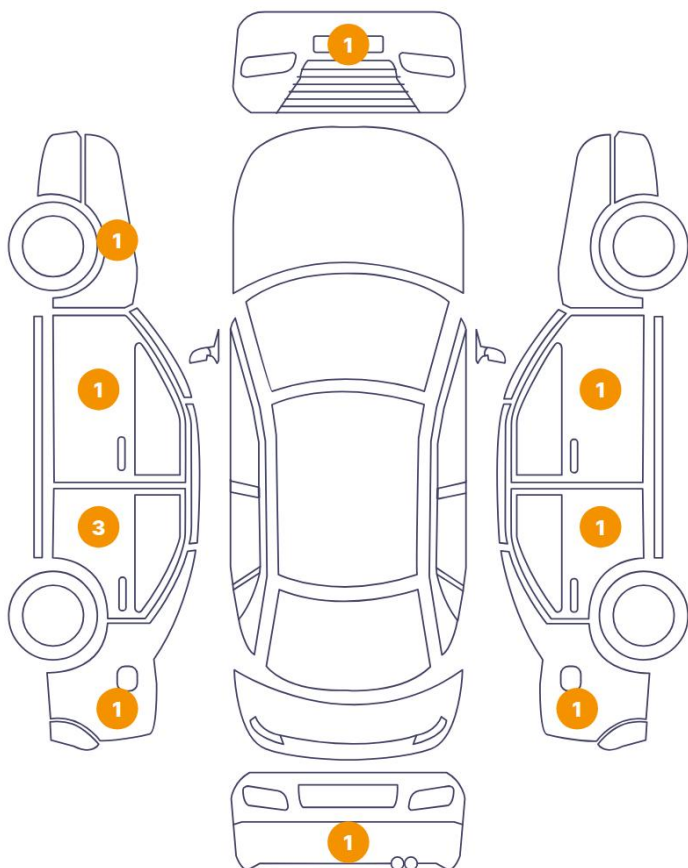

3 Schäden

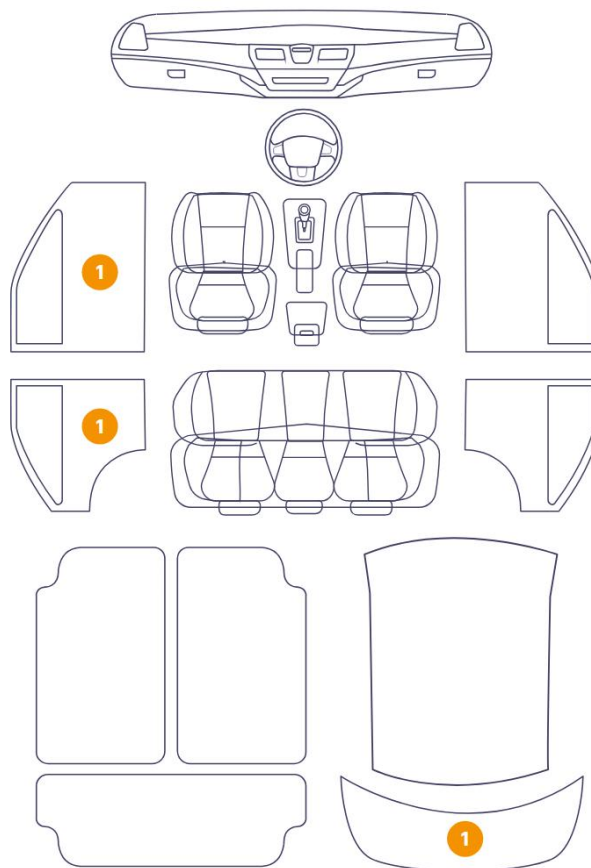6/12 - Report Number P20250908084904

13	Door / Back Right	Paint / Stone Chip
14	Door / Front Right	Bodywork / Dent / Dent




1. Wing Expander / Front Left
Paint / Poor Previous Repair -



2. Door / Back Left
Paint / Poor Previous Repair -




3. Bumper / Front
Paint / Scratch / Scuff -

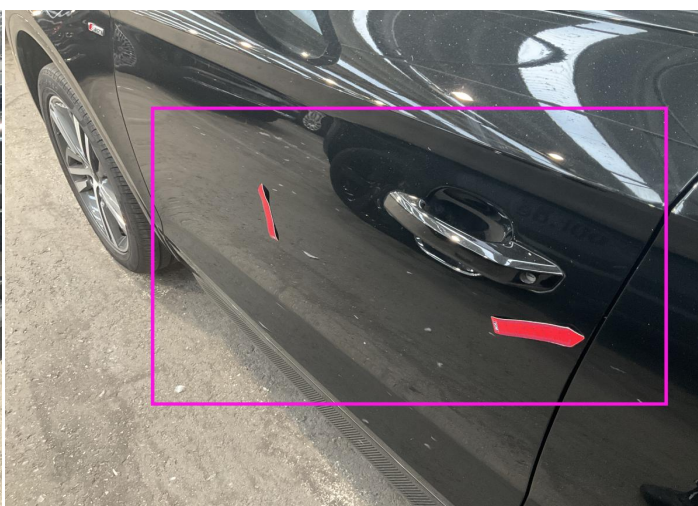

4. Door / Front Left
Paint / Scratch / Scuff -



5. Panel Filling / Front Left
Interior / Scratched -

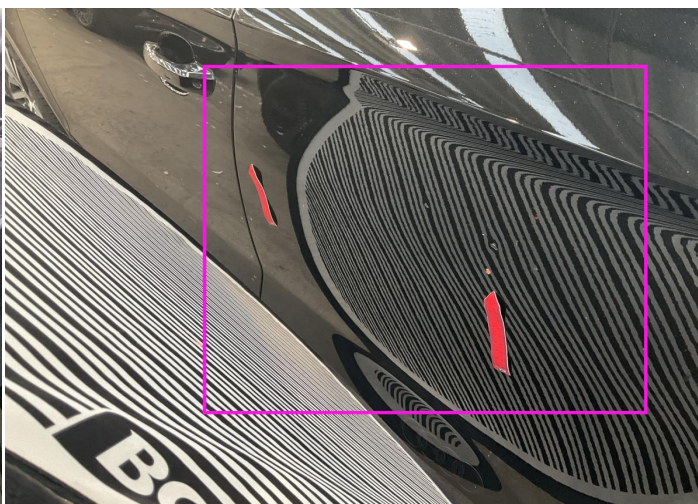


6. Door / Back Left
Bodywork / Dent / Dent -



7. Door / Back Left
Paint / Scratch / Scuff -



8. Panel Filling / Back Left
Interior / Scratched -

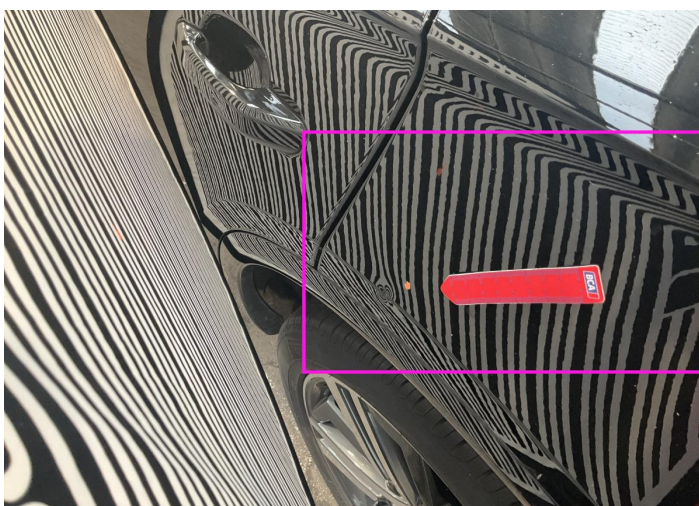


9. Side Panel / Back Left
Bodywork / Dent / Dent -



10. Bumper / Back
Paint / Scratch / Scuff -




11. Tailgate Upholstery / Back
Interior / Scratched -

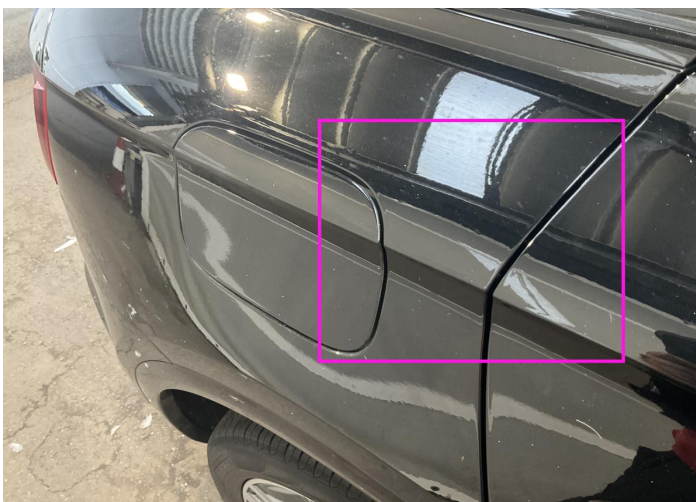

12. Side Panel / Back Right
Paint / Scratch / Scuff -



13. Door / Back Right
Paint / Stone Chip -

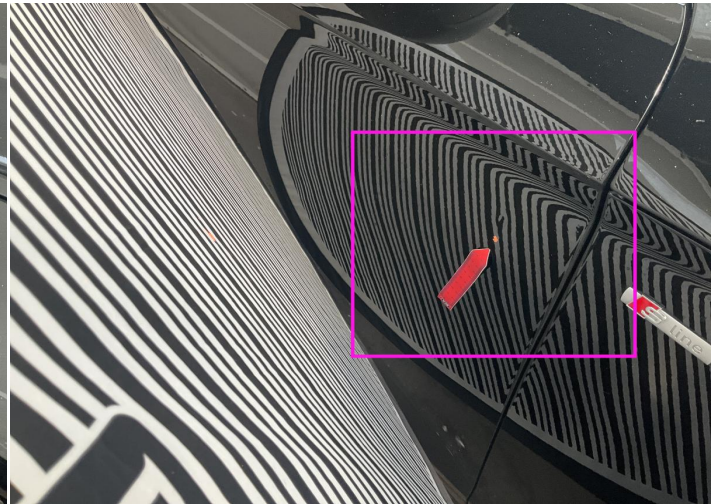

14. Door / Front Right
Bodywork / Dent / Dent -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Diesel Particulate Filter Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
All - wheel Drive	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Navigation System	✓
Audio Equipment	✓	Parking Sensors / Cameras Functioning	✓
AC / Heating System	✓	Other Equipments	✓

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Engine			
Engine Noise	✓	Fume Quantity	✓
Power Loss	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Brake			
Brake System Anomaly	✓		
Steering Wheel			
Steering Noise / Anomaly	✓		
General			
Test Driven Status	✓		
✓ <i>No troubles detected, good condition or correct tests, according to vehicle age and mileage</i>			
! <i>Damages or malfunction detected that requires repairs by the buyer</i>			
NA <i>Not applicable</i>			
☐ <i>Not tested</i>			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)