



Audi A3 (UKL): 1YAK073

Vinnumber:	WAUZZZGY2MA005694	Versionname:	A3 Sportback 35 1.5TFSi 150pk/cv 5p
First Registrationdate:	30/06/2020	Fiscalpower:	
Expertise Mileage:	126361	Power Kw:	110
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:			
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	205/55/16/91 W			
Summer tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm
Tyre profile depth FL				6.0
Tyre profile depth FR				6.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				205/55 R 16 91 W
Tyre size FR				205/55 R 16 91 W
Tyre size RL				205/55 R 16 91 W
Tyre size RR				205/55 R 16 91 W
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				255
Tyre make FR				255
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Backrest cover FR, Stain, Cleaning



Seat cover FR, Stain, Cleaning



Bumper F, Scratch(es), Acceptable



Windscreen, Stone chip(s), Windscreen repair



Door FL, Dent(s) and scratch(es), Acceptable




Alloy rim RL, Scratch(es), Acceptable



Rubber seal for boot lid, Deformed / Strained, Replace



Boot lid covering R, Scratch(es), Acceptable

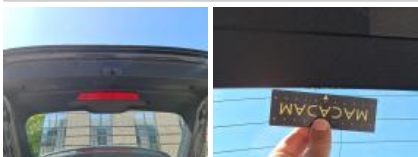

Bumper R, Scratch(es), Acceptable



Wing RR, Bad repair, Repair and paint (complete)



Door RR, Bad repair, Repair and paint (complete)



Door FR, Bad repair, Repair and paint (complete)



Alloy rim FR, Scratch(es), Repair and paint (complete)



Roof, Dent(s), Repair and paint (complete)

