

AUDI A3 A3 35 TFSI Sportback S tronic



VIN NO WAUZZZGY5NA003357 Registration Number Y5NA003357

MOT Date

★ 2026-12-01

Last Service

=-

Number of Owners

23: 1

Last Service Mileage

A.

Number of Keys

P2

First Registration Date

2021-09-06

Odometer Reading

2 37848 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250821093147
Inspection Date / Place	2025-08-21 / BCA Oberndorf	Cosmetic Grade	4

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Petrol	Road Worthy	Yes
Colour	Grey	Engine Size (cc)	1498
Engine Size	1.5	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz/grau	Seat Covering	Cloth
Charging Cables		WLTP CO2 Emissions	
Gearbox Type Automatic	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			
































Equipment

Tinted Glass	Airbag Status	Ambientlighting	Anti-lock braking
Bluetooth telephone interface	e Digital Radio	Fatiguewarningsystem	Heated wing mirrors
Remote central locking	Satellite navigation	Stability control	Distancewarningsystem
Electrictailgate	Laneassist	LED Headlamps	Rear parking sensors
USB Socket	Alloys wheels	AndroidAuto	AppleCarPlay
Cruise control	Digitaldashboard	Front parking sensors	Remote adjusting wing mirrors
Reversing Camera	Split folding rear seats	Central locking	Electrically folding wing mirrors
Emergencybrakeassist	Leather steering wheel	Radio	
Equipment Details			
Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	17
Extra Wheel / Tyre Set	Winter Tyres - Steel	Seat Heating	Front
Wheels & Tyres			
Right Front Tyre Depth	6	Left Front Tyre Depth	6
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5
Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	7	Extra Wheel - 4 Tyre Depth	7

Cosmetic Damage

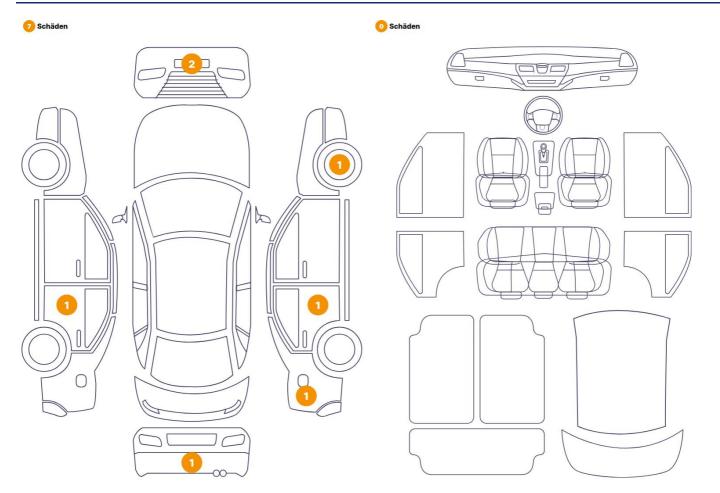

	Component	Damage	Comments
1	Corner Bumper / Front Left	Paint / Scratch / Scuff	
2	Door / Back Left	Bodywork / Dent / Dent	
3	Bumper / Front	Bodywork / Dent / Dent	
4	Bumper / Back	Bodywork / Dent / Dent	
5	Side Panel / Back Right	Bodywork / Dent / Dent	
6	Door / Back Right	Bodywork / Dent / Dent	
7	Rim / Front Right	Paint / Stone Chip	




1. Corner Bumper / Front Left Paint / Scratch / Scuff -

2. Door / Back Left Bodywork / Dent / Dent -



3. Bumper / Front Bodywork / Dent / Dent -

4. Bumper / Back Bodywork / Dent / Dent -

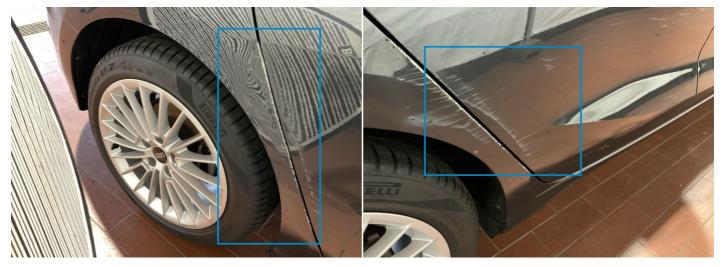

5. Side Panel / Back Right Bodywork / Dent / Dent -

6. Door / Back Right Bodywork / Dent / Dent -



7. Rim / Front Right Paint / Stone Chip -

Mechanical Condition

Control Lights			
Display Defect	•	Service Light	•
ABS Warning Light	•	ESP Fault/Traction Control Malfunction Light	•
Airbag Warning Light	•	Oil Pressure Warning Light	②
Brake Warning Light	•	Power Steering Warning Light	•
Alternator / Battery	•	No Dashboard Lights	•
Tire Pressure Monitoring System	•		
Equipments Test			
Central Locking	•	Main & Spare Keys Functioning	⊘
Electric Windows	•	Navigation System	⊘
Audio Equipment	•	Parking Sensors / Cameras Functioning	⊘
AC / Heating System	•	Other Equipments	•
Engine			
Engine Status / EML	⊘	Engine Leak Visible	⊘
Engine Starts	•		
Gearbox			
Gear Box	•		
Levels			
Brakes Fluid	•	Coolant Fluid	②

Test Drive Inspection

