



BMW 3er 320d Touring Aut.

VIN NO WBA11DZ010FN01274
Registration Number 010FN01274



MOT Date

2027-05-01

Last Service

2025-05-12

Number of Owners

1

Last Service Mileage

168239

Number of Keys

2

First Registration Date

2022-06-02

Odometer Reading

172542 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250815133110
Inspection Date / Place	2025-08-15 / BCA Heidenheim	Cosmetic Grade	3

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Diesel	Road Worthy	Yes
Colour	Grey	Engine Size (cc)	1995
Engine Size	2.0	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Rear
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Cloth/Synthetic Leather
Charging Cables		WLTP CO2 Emissions	
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warranty			









Equipment

Tinted Glass	USB Socket	Alloys wheels	AndroidAuto
AppleCarPlay	Cruise control	Digital Radio	Front fog lamps
Parking Assistance	Remote central locking	Roof rails	Split folding rear seats
Electrically folding wing mirrors	Leather steering wheel	Radio	Tow ball
Airbag Status	Ambientlighting	Anti-lock braking	Bluetooth telephone interface
Diesel particulate filter	Digitaldashboard	Front parking sensors	Remote adjusting wing mirrors
Reversing Camera	Satellite navigation	Stability control	Electrictailgate
LED Headlamps	Rear parking sensors		

Equipment Details


Tow Ball Type	Electronic	Air Conditioning	Three Zone Climate Control
Alloy Wheel Size	18	Extra Wheel / Tyre Set	Winter Tyres - Alloy
Seat Heating	Front		

Wheels & Tyres


Right Front Tyre Depth	6	Left Front Tyre Depth	6
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5
Extra Wheel - 1 Tyre Depth	2	Extra Wheel - 2 Tyre Depth	2
Extra Wheel - 3 Tyre Depth	5	Extra Wheel - 4 Tyre Depth	4

Cosmetic Damage

6 Schäden

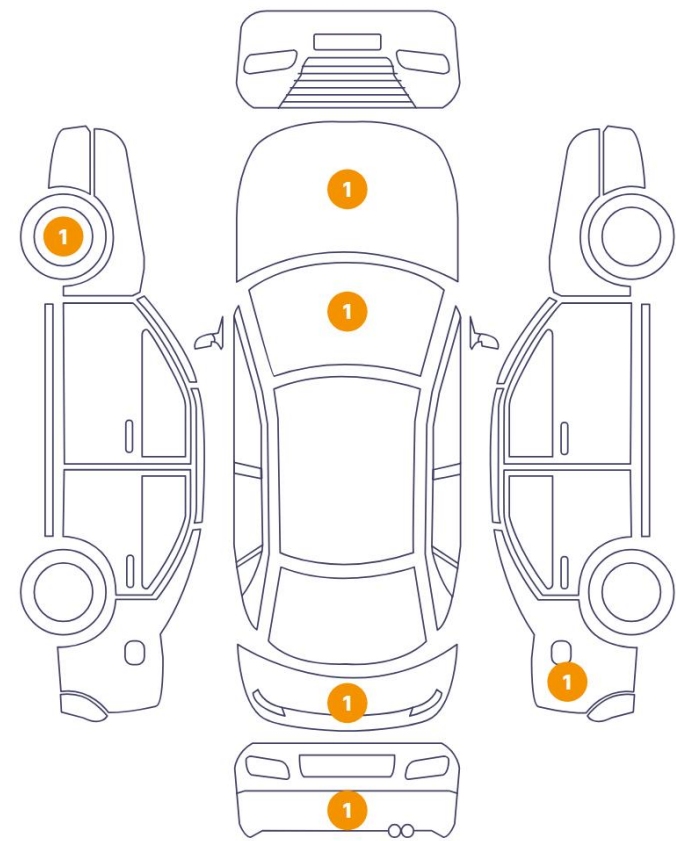

5 Schäden

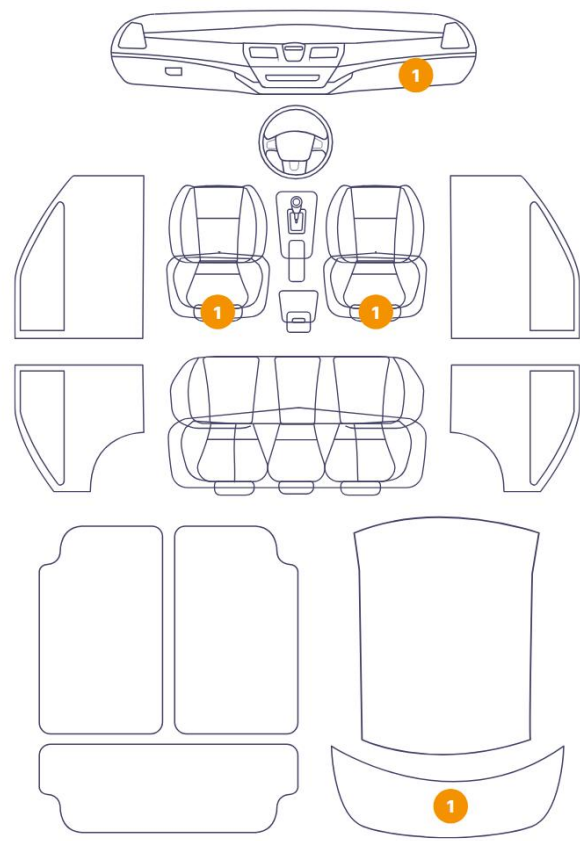


Component		Damage	Comments
1	Ignition Key	Interior / Worn - out	
2	Center Console	Interior / Scraped	
3	Backrest Cover / Front Left	Interior / Scratched	
4	Trunk Upholstery / Back	Interior / Scraped	
5	Windshield / Front	Glass Break / Impact	
6	Side Panel / Back Right	Paint / Poor Previous Repair	
7	Tailgate	Paint / Poor Previous Repair	
8	Rim / Front Left	Out of Bodywork / Scratch	
9	Hood	Paint / Stone Chip	
10	Bumper / Back	Paint / Scratch / Scuff	
11	Backrest Cover / Front Right	Interior / Scratched	



1. Ignition Key
Interior / Worn - out -



2. Center Console
Interior / Scraped -

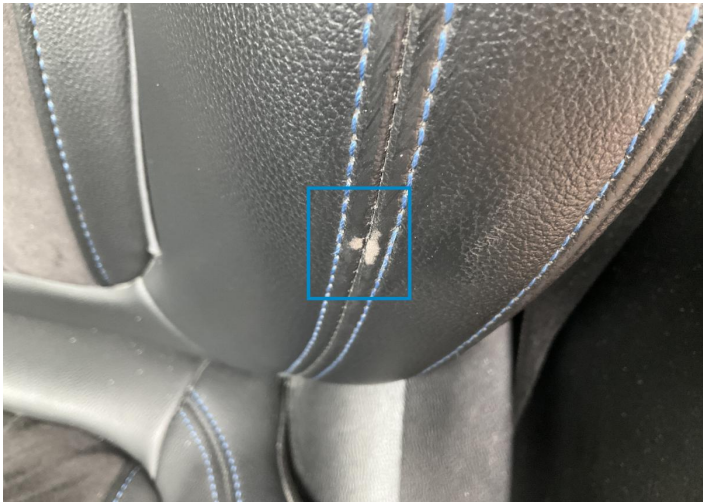

3. Backrest Cover / Front Left
Interior / Scratched -



4. Trunk Upholstery / Back
Interior / Scraped -



5. Windshield / Front
Glass Break / Impact -




6. Side Panel / Back Right
Paint / Poor Previous Repair -



7. Tailgate
Paint / Poor Previous Repair -



8. Rim / Front Left
Out of Bodywork / Scratch -

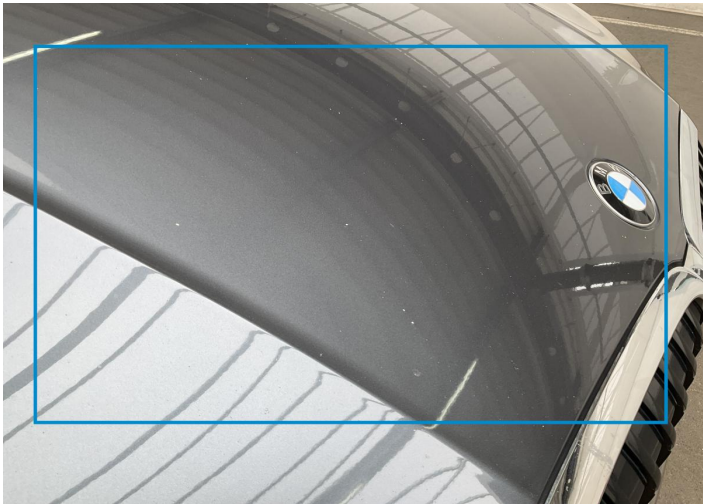

9. Hood
Paint / Stone Chip -



10. Bumper / Back
Paint / Scratch / Scuff -



11. Backrest Cover / Front Right
Interior / Scratched -

Mechanical Condition

Control Lights

Display Defect	✓	Service Light	✓
ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Diesel Particulate Filter Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	!	Alternator / Battery	✓
No Dashboard Lights	✓		

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	!
Electric Windows	✓	Navigation System	✓
Audio Equipment	✓	Parking Sensors / Cameras Functioning	✓
AC / Heating System	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	NA
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Test Drive Inspection

Steering Wheel

Steering Noise / Anomaly	✓
----------------------------	---

Engine

Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓

General

Test Driven Status	✓
--------------------	---

- ✔ *No troubles detected, good condition or correct tests, according to vehicle age and mileage*
- ❗ *Damages or malfunction detected that requires repairs by the buyer*
- NA *Not applicable*
- ☐ *Not tested*

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)