



BMW X1: 1XHB938			
Vinnumber:	WBA31AC0405P93637	Versionname:	X1 sDrive16dA (85 kW) 85kW/116pk 5D/P Auto-7
First Registrationdate:	3/01/2020	Fiscalpower:	
Expertise Mileage:	104947	Power Kw:	85
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	4 Wheel-drive	Parking lot	c613
Fueltype:	Diesel		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options			
Number of keys total	2	Radio	
Number keys remote	2	Lining leather	
Windows electric F		Sun Roof electric	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional			
Seats F heated			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection			
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Degree of wear			
225/55/17/97 H			
Winter tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.
	Re.L.	Goodyear: 5 mm	Re.R.
Tyre profile depth FL			4.0
Tyre profile depth FR			4.0
Tyre profile depth RL			5.0
Tyre profile depth RR			5.0
Tyre size FL		225/55 R 17 97 H	
Tyre size FR		225/55 R 17 97 H	
Tyre size RL		225/55 R 17 97 H	
Tyre size RR		225/55 R 17 97 H	
Tyre type FL		Winter	
Tyre type FR		Winter	
Tyre type RL		Winter	
Tyre type RR		Winter	
Tyre make FL		259	
Tyre make FR		259	
Tyre make RL		259	
Tyre make RR		259	

Assistance equipment			
Repair kit	No	Compressor	No
Number of charging cables (normal)	0		

Backrest cover FL, Scratch(es), Smart repair



Backrest cover FR, Scratch(es), Smart repair



Door panel RL, Tear, Replace



Bumper F, Scratch(es), Repair and paint (complete)



Bumper F, Bad repair, Check



Windscreen, Stone chip(s), Acceptable



Door RL, Dent(s) and scratch(es), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Spot repair



Wing trim FL, Deformed / Strained, Replace




Composite repair kit, max. 1 m², Missing, Replace



Compressor, Missing, Replace



Boot lid covering R, Scratch(es), Smart repair

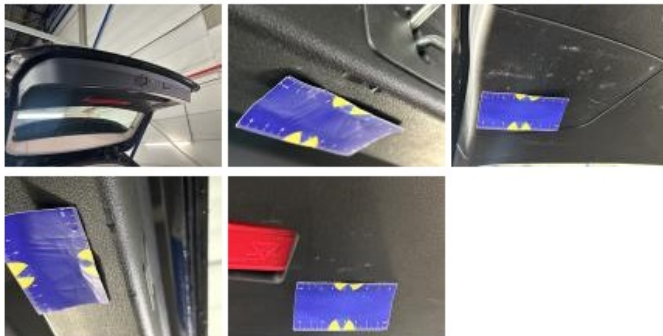

Tailgate / Boot, Scratch(es), Polish



Door FR, Scratch(es), Polish



Door RR, Scratch(es), Polish



Wing RR, Scratch(es), Polish

