



BMW X1 (UKL): 1XGX962

Vinnumber:	WBA31AC0705P79540	Versionname:	X1 (F48) Business Edition 16d sDrive 1.5d 116pk/cv 5p Aut.
First Registrationdate:	2/01/2020	Fiscalpower:	
Expertise Mileage:	131513	Power Kw:	85
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:			
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Battery functioning	Yes		
Registration Certificate Car (BE)	Yes		
Maintenance	OK		

Options

Type of Maintenance book	Digital maintenance	Luggage cover	
Type of GPS storage	HD	Type of Tow bar	No Tow bar
GPS			
Number of keys total	2		

Tyres

Tyre size RL	225/55 R 17 101 W
Tyre type FL	Summer
Tyre type RL	Summer
Tyre profile depth FR	3.0
Tyre profile depth RR	3.0
Tyre size FR	225/55 R 17 101 W
Tyre make FR	258

225/55/17/101 W

Summer tyres:	Fr.L.	Firestone: 3 mm	Fr.R.	Firestone: 3 mm
	Re.L.	Firestone: 3 mm	Re.R.	Firestone: 3 mm

Tyre size RR	225/55 R 17 101 W
Tyre make RR	258
Tyre profile depth FL	3.0
Tyre size FL	225/55 R 17 101 W
Tyre make FL	258
Tyre profile depth RL	3.0
Tyre type FR	Summer
Tyre type RR	Summer
Tyre make RL	258

Assistance equipment

Number of charging cables (normal)	0	Runflat	No
Emergency spare wheel	No		
Spare wheel	No		
Number of charging cables (rapid charge)	0		

Interior, Not original part, Replace



Backrest cover FR, Scratch(es), Acceptable



Backrest cover FL, Scratch(es), Acceptable



Bonnet, Stone chip(s), Acceptable



Bumper moulding F, Scratch(es), Acceptable



Alloy rim FL, Scratch(es), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Acceptable



Door trim FL, Scratch(es), Acceptable



Door RL, Dent(s) and scratch(es), Acceptable





Wing RL, Scratch(es), Acceptable



Step L, Scratch(es), Acceptable



Spare wheel, Missing, Check



Boot lid covering R, Scratch(es), Replace



Rear bulkhead lining, Scratch(es), Acceptable




Bumper moulding R, Deformed / Strained, Replace and paint



Bumper moulding R, Not original part, Replace



Bumper R, Scratch(es), Acceptable

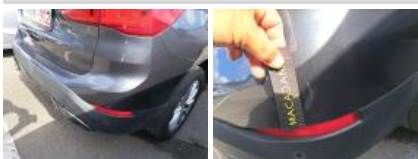

Wing RR, Scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Repair and paint (complete)



Door FR, Scratch(es), Repair and paint (complete)



Outside rear-view mirror R, complete, Scratch(es), Acceptable



Mirror side repeater R, Scratch(es), Acceptable



Wing FR, Scratch(es), Repair and paint (complete)



Outer door handle FR, Scratch(es), Repair and paint (complete)



Sill trim R, Scratch(es), Replace



Step R, Scratch(es), Acceptable






Bodywork, Paint measurement, Acceptable



Roof, Dent(s), Paintless dent repair

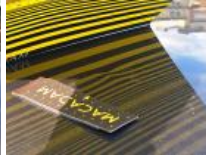

Bodywork, Damaged, Forfeit

