

## Vehicle details

|                   |                    |              |                         |                           |               |
|-------------------|--------------------|--------------|-------------------------|---------------------------|---------------|
| VIN               | WBA6N3105 0FK28677 | Brand        | BMW                     | Maintenance date          | -             |
| Licence Plate     | J2-78-ZG           | Model        | 3 Serie Touring 330e 5d | Maintenance mileage       | -             |
| Registration date | 09/11/2020         | Year         | 2020                    | Exterior Color            | Grey Metallic |
| Odometer          | 189 333 km         | Engine size  | 1998                    | interior Color            | Black         |
| Fuel              | Hybrid petrol      | Body Type    | -                       | Next technical inspection | -             |
| Seats             | -                  | Transmission | Automatic               | CO2                       | -             |
| Doors             | 5                  | Gears        | -                       |                           |               |

## Inspection Details

|                 |            |                 |              |
|-----------------|------------|-----------------|--------------|
| Inspection date | 08/09/2025 | Inspection loc. | Dekra Ayvens |
|-----------------|------------|-----------------|--------------|



## Generic equipment

|                            |   |
|----------------------------|---|
| Automated air-conditioning | ✓ |
| Cruise control             | ✓ |
| Leather                    | ✓ |
| GPS system                 | ✓ |
| Alloy wheel rims           | ✓ |
| Automatic Gearbox          | ✓ |
| Heating seats              | ✓ |
| Electric seats             | ✓ |
| Metallic paint             | ✓ |
| Central locking            | ✓ |
| Electric windows           | ✓ |
| Side rails                 | ✓ |
| Park Distance Control      | ✓ |
| Audio System               | ✓ |
| Led lighting               | ✓ |

## Removable element


|                  |   |
|------------------|---|
| Load cover       | ✓ |
| Vehicle charger  | ✓ |
| Wireless charger | ✓ |

## Technical Document

|                         |   |
|-------------------------|---|
| User manual             | ✓ |
| Spare key               | ✓ |
| Remote key              | ✓ |
| Sat Nav CD ROM Software | ✓ |

## Tyres

Pirelli 255/40/18 Summer 6.0 mm

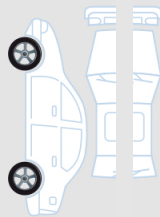

Pirelli 255/40/18 Summer 6.0 mm



Pirelli 255/40/18 Summer 4.0 mm

Pirelli 255/40/18 Summer 3.5 mm

## Exterior

1



|             |                  |
|-------------|------------------|
| Part        | Bumper           |
| Position    | Front            |
| Damages     | Scratched        |
| Severity    | Length (cm) > 10 |
| Repair mode | Repair           |

● ●

2



|             |                 |
|-------------|-----------------|
| Part        | Alloy wheel 18" |
| Position    | Front right     |
| Damages     | Scratched       |
| Severity    | -               |
| Repair mode | Lumpsum repair  |

● ●

3



|             |                    |
|-------------|--------------------|
| Part        | Wing               |
| Position    | Back right         |
| Damages     | Dent & Chips       |
| Severity    | Diameter (mm) > 20 |
| Repair mode | Repair             |

● ● ●

4



|             |                 |
|-------------|-----------------|
| Part        | Alloy wheel 18" |
| Position    | Back right      |
| Damages     | Scratched       |
| Severity    | -               |
| Repair mode | Lumpsum repair  |

● ●

5



|             |                 |
|-------------|-----------------|
| Part        | Alloy wheel 18" |
| Position    | Back left       |
| Damages     | Scratched       |
| Severity    | -               |
| Repair mode | Lumpsum repair  |

● ●

6



|             |                 |
|-------------|-----------------|
| Part        | Alloy wheel 18" |
| Position    | Front left      |
| Damages     | Scratched       |
| Severity    | -               |
| Repair mode | Lumpsum repair  |

● ●

7



|             |                      |
|-------------|----------------------|
| Part        | Tailgate / Boot door |
| Position    | -                    |
| Damages     | Dented               |
| Severity    | Diameter (mm) > 20   |
| Repair mode | Smart Repair         |

● ●