



BMW X1: 2BDU259			
Vinnnumber:	WBA71AB0205U33107	Versionname:	X1 xDrive25e (162 kW) (PHEV) 162kW/220pk 5D/P
First Registrationdate:	14/10/2021	Fiscalpower:	Auto-6
Expertise Mileage:	105184	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	4 Wheel-drive	Parking lot	d337
Fueltype:	Hybrid Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options			
Number of keys total	2	Radio	
Number keys remote	2	Lining leather	
GPS storage		Front parking sensors	
GPS storage	HD	Rear parking sensors	
Windows electric F		Fog lights (front)	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Navigation with screen			
Airco electronic			
Rims alloy			

Limited Technical Inspection			
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Degree of wear			
Winter tyres:	225/55/17/97 H		
	Fr.L.	Continental: 4 mm	Fr.R.
			Continental: 5 mm
	Re.L.	Continental: 6 mm	Re.R.
			Continental: 7 mm
Tyre profile depth FL			4.0
Tyre profile depth FR			5.0
Tyre profile depth RL			6.0
Tyre profile depth RR			7.0
Tyre size FL			225/55 R 17 97 H
Tyre size FR			225/55 R 17 97 H
Tyre size RL			225/55 R 17 97 H
Tyre size RR			225/55 R 17 97 H
Tyre type FL			Winter
Tyre type FR			Winter
Tyre type RL			Winter
Tyre type RR			Winter
Tyre make FL			256
Tyre make FR			256
Tyre make RL			256
Tyre make RR			256


Assistance equipment			
Number of electronic keys (remote)	2	Car alarm	

Number of charging cables (normal)
Number of charging cables (rapid charge)

2 Compressor
1

No

Bumper F, Bad repair, Spot repair

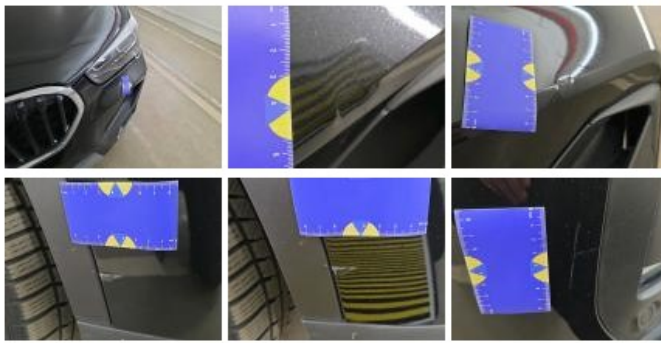

Bumper spoiler F, Scratch(es), Acceptable



Door RL, Dent(s) and scratch(es), Acceptable



Door FL, Scratch(es), Acceptable



Outside rear-view mirror housing L, Scratch(es), Polish



Wing FL, Dent(s), Acceptable



Alloy rim FL, Scratch(es), Acceptable



Compressor, Missing, Replace



Boot lid covering R, Scratch(es), Smart repair



Rear window, Scratch(es), Polish



Bumper R, Scratch(es), Acceptable




Alloy rim FR, Scratch(es), Repair and paint (complete)



Wing trim FR, Scratch(es), Acceptable




Outside rear-view mirror housing R, Scratch(es), Acceptable

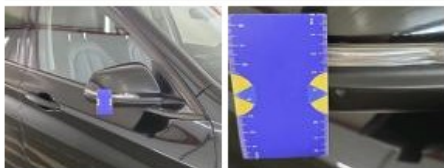

Door RR, Scratch(es), Acceptable



Door FR, Dent(s), Acceptable

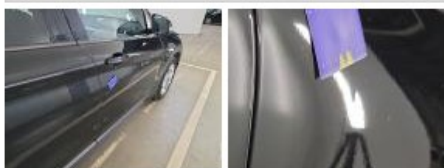

Alloy rim RR, Scratch(es), Acceptable

