



BMW 5er 525d Touring Aut.

VIN NO WBAPX51080C144817
Registration Number 080C144817



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2026-01-01	2	2	184600 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-01-09	176269	2009-07-02	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250922124228
Inspection Date / Place	2025-09-22 / BCA Heidenheim	Cosmetic Grade	5

Vehicle Summary



Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Road Worthy	Yes
Colour	Grey	Engine Size (cc)	2993
Engine Size	3.0	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Rear
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth/Synthetic Leather
Charging Cables		NEDC CO2 Rating (q/km)	176
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





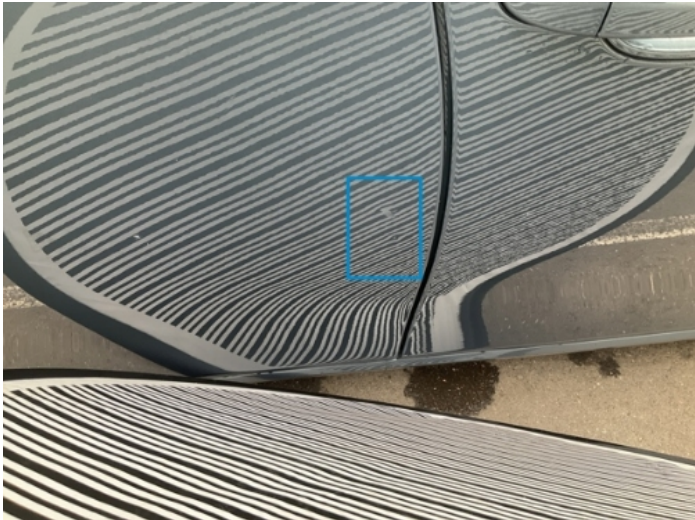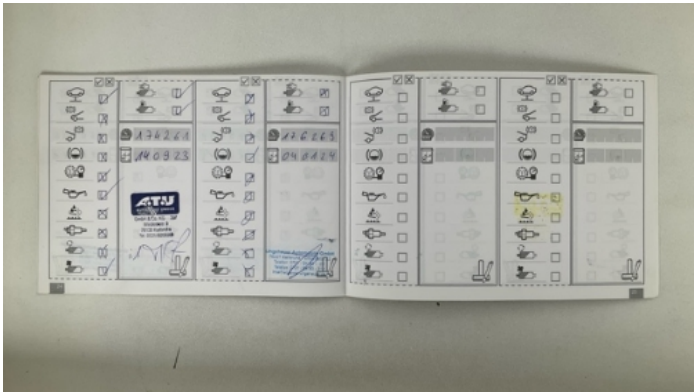

Equipment

Airbag Status	Anti-lock braking	Diesel particulate filter	Front parking sensors
Headlamp wash/wipe	Remote central locking	Satellite navigation	Xenon headlamps
Electrically adjustable seats	Leather steering wheel	Rear parking sensors	Alloys wheels
Cruise control	Front fog lamps	Head up Display	Remote adjusting wing mirrors
Roof rails	Stability control	CD Player	Electrictailgate

Radio

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	17
Extra Wheel / Tyre Set	Summer Tyres - Alloy	Seat Heating	Front

Wheels & Tyres

Extra Wheel - 1 Tyre Depth	5	Extra Wheel - 2 Tyre Depth	5
Extra Wheel - 3 Tyre Depth	4	Extra Wheel - 4 Tyre Depth	4
Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	6	Left Rear Tyre Depth	6

Cosmetic Damage

19 Schäden

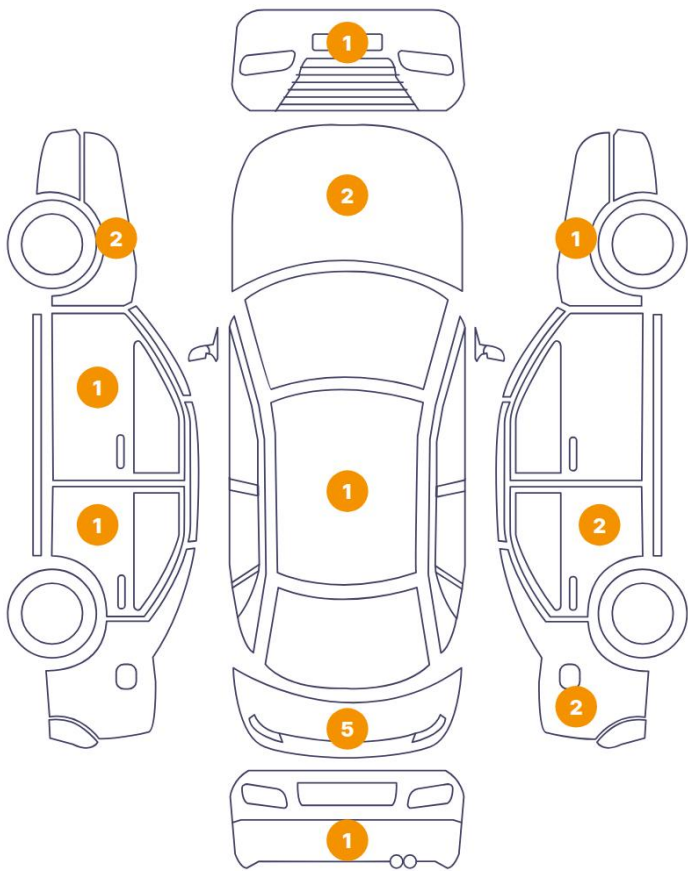


0 Schäden




Component		Damage	Comments
1	Fender / Front Left	Paint / Poor Previous Repair	
2	Hood	Paint / Poor Previous Repair	
3	Door / Back Left	Paint / Poor Previous Repair	
4	Fender / Front Left	Paint / Scratch / Scuff	
5	Bumper / Front	Paint / Scratch / Scuff	
6	Hood	Paint / Scratch / Scuff	
7	Fender / Front Right	Paint / Scratch / Scuff	
8	Door / Back Right	Bodywork / Dent / Dent	
9	Side Panel / Back Right	Bodywork / Dent / Dent	
10	Door / Back Right	Paint / Scratch / Scuff	
11	Bumper / Back	Paint / Scratch / Scuff	
12	Tailgate	Bodywork / Dent / Dent	

13	Tailgate	Paint / Scratch / Scuff
14	Tailgate	Paint / Scratch / Scuff
15	Tailgate	Paint / Scratch / Scuff
16	Roof	Bodywork / Dent / Dent
17	Mirror Shell / Front Left	Paint / Scratch / Scuff
18	Tailgate	Paint / Corrosion
19	Side Panel / Back Right	Paint / Scratch / Scuff

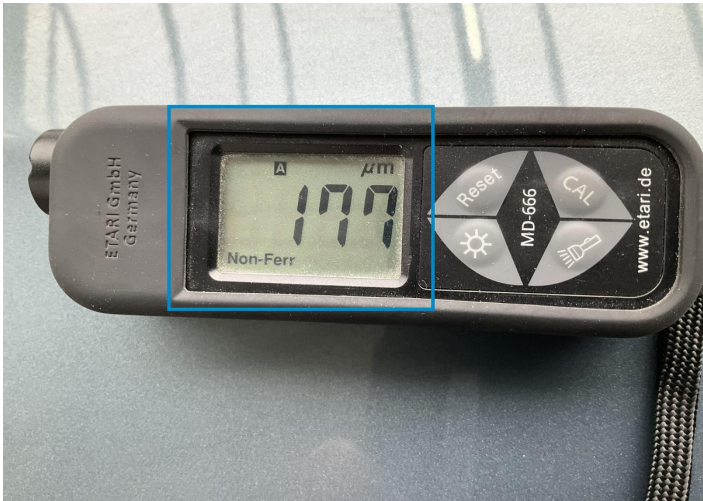

1. Fender / Front Left
Paint / Poor Previous Repair -

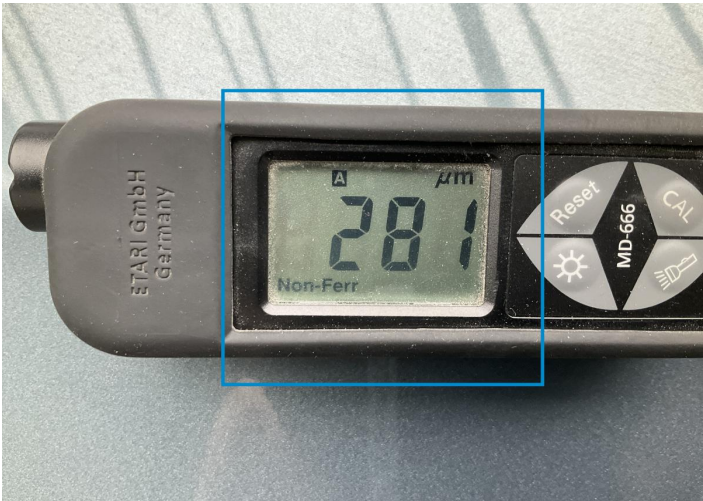

2. Hood
Paint / Poor Previous Repair -




3. Door / Back Left
Paint / Poor Previous Repair -



4. Fender / Front Left
Paint / Scratch / Scuff -




5. Bumper / Front
Paint / Scratch / Scuff -

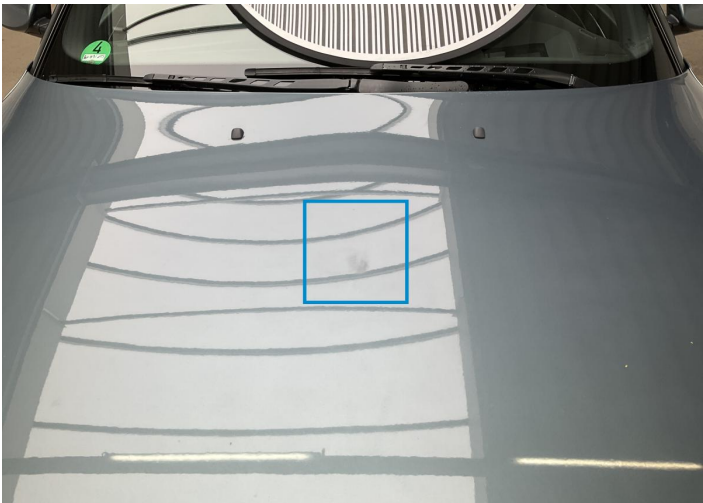


6. Hood
Paint / Scratch / Scuff -



7. Fender / Front Right
Paint / Scratch / Scuff -

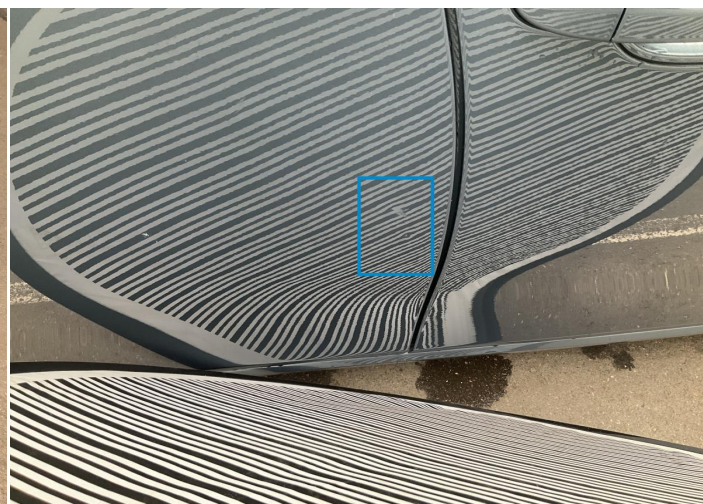

8. Door / Back Right
Bodywork / Dent / Dent -

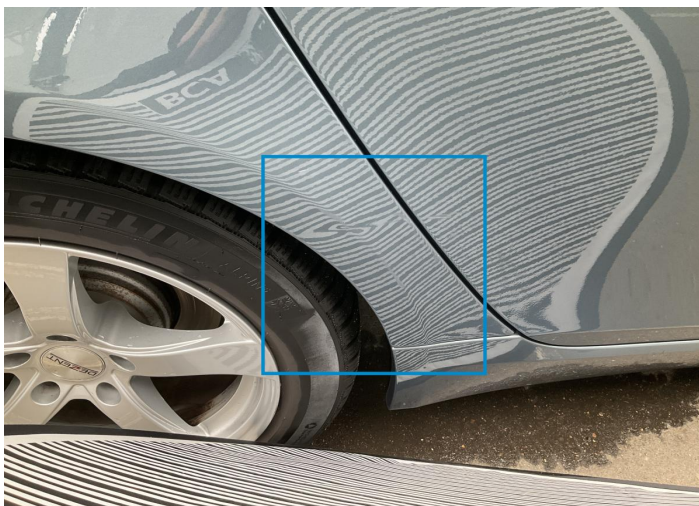


9. Side Panel / Back Right
Bodywork / Dent / Dent -



10. Door / Back Right
Paint / Scratch / Scuff -




11. Bumper / Back
Paint / Scratch / Scuff -

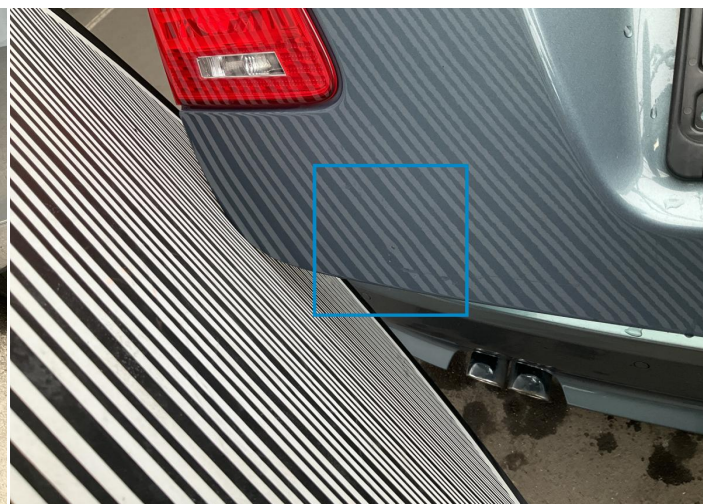

12. Tailgate
Bodywork / Dent / Dent -




13. Tailgate
Paint / Scratch / Scuff -

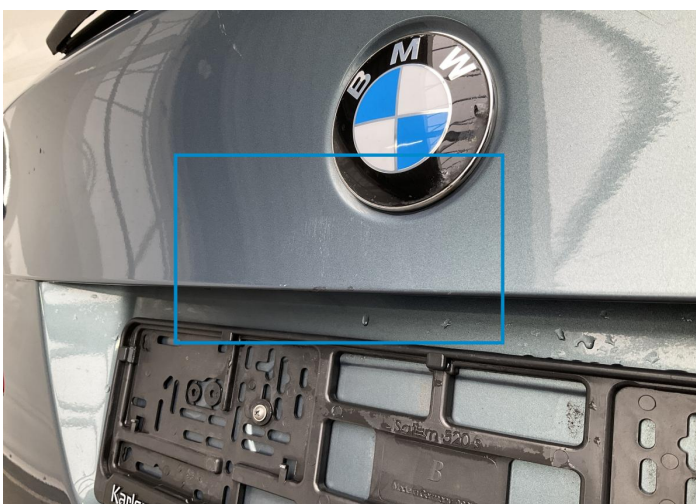

14. Tailgate
Paint / Scratch / Scuff -



15. Tailgate
Paint / Scratch / Scuff -

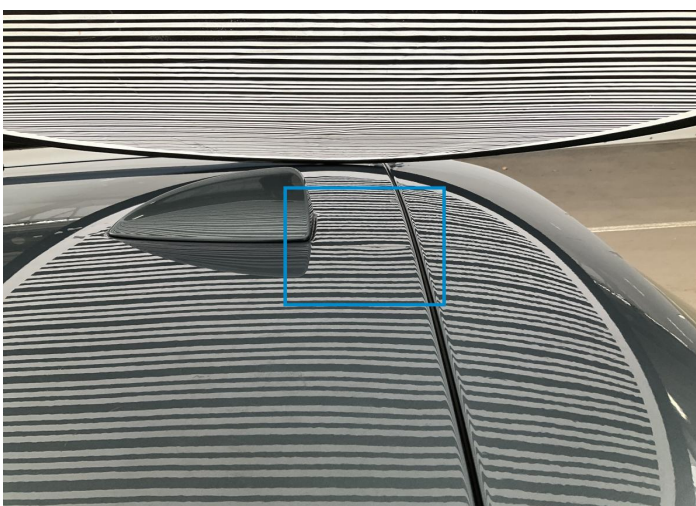


16. Roof
Bodywork / Dent / Dent -



17. Mirror Shell / Front Left
Paint / Scratch / Scuff -



18. Tailgate
Paint / Corrosion -

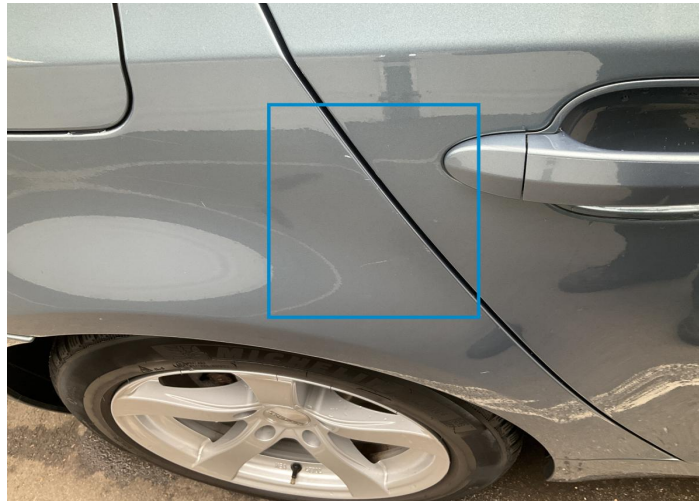

19. Side Panel / Back Right
Paint / Scratch / Scuff -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Diesel Particulate Filter Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
No Dashboard Lights	✓	Display Defect	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	NA
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Navigation System	✓
Audio Equipment	✓	Parking Sensors / Cameras Functioning	✓
AC / Heating System	✓	Other Equipments	✓

Test Drive Inspection

Engine			
Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓
Brake			
Brake System Anomaly	✓		
Steering Wheel			
Steering Noise / Anomaly	✓		
General			
Test Driven Status	✓		
✓ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
☐ Not tested			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)