



MERCEDES-BENZ A-Klasse

A 140

VIN NO WDB1680311J973962
Registration Number 311J973962



MOT Date

2025-03-01

Last Service



Number of Owners

4

Last Service Mileage



Number of Keys

1

First Registration Date

2003-08-04

Odometer Reading

128029 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250911075520
Inspection Date / Place	2025-09-11 / BCA Neuss	Cosmetic Grade	9

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Gearbox Type	Manual
Colour	Silver	Engine Size (cc)	1397
Engine Size	1.4	No of Doors	5
Body Type	Sedan	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	166

Vehicle History & Documents

Service Book Available	Incomplete	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			







Equipment

Tow ball	Anti-lock braking	Remote central locking	Radio
Airbag Status	Remote adjusting wing mirrors	CD Player	

Equipment Details


Tow Ball Type	Static	Air Conditioning	Yes
---------------	--------	------------------	-----

Wheels & Tyres


Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	6	Left Rear Tyre Depth	6

Cosmetic Damage

31 Schäden

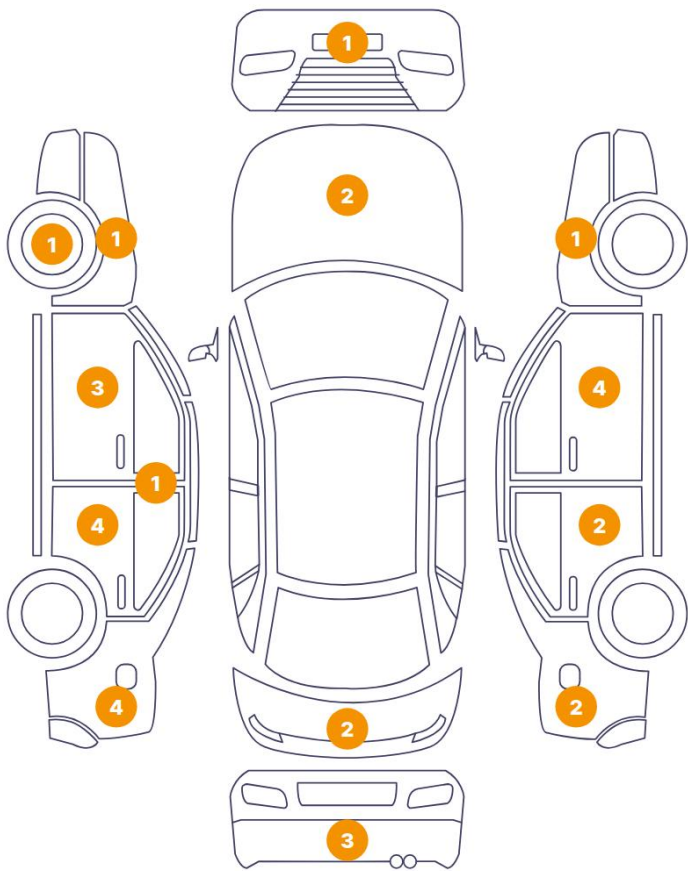

9 Schäden

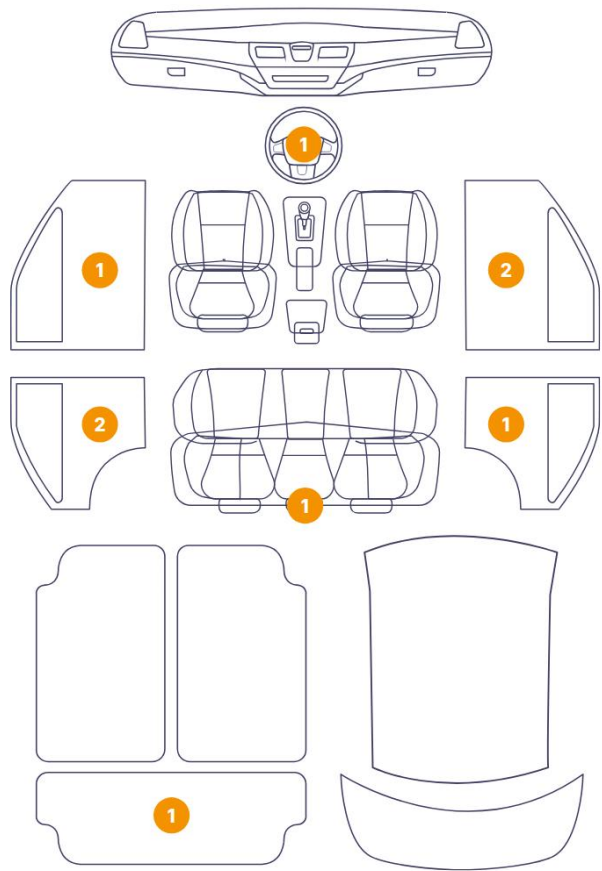

Component		Damage	Comments
1	Luggage Space Cover / Back	Interior / Missing	
2	Seat / Back Center	Interior / Loose	
3	Steering Wheel / Front	Interior / Worn - out	
4	B Pillar / Center Left	Bodywork / Dent / Dent	
5	Window Switch / Back Left	Interior / Broken	
6	Panel Filling / Front Right	Interior / Holed	
7	Panel Filling / Front Right	Interior / Scratched	
8	Panel Filling / Back Right	Interior / Scratched	
9	Panel Filling / Back Left	Interior / Scratched	
10	Panel Filling / Front Left	Interior / Scratched	
11	Hood	Bodywork / Dent / Dent	
12	Hood	Bodywork / Dent / Dent	

13	Bumper / Front	Bodywork / Breakage
14	Fender / Front Left	Paint / Scratch / Scuff
15	Door / Front Left	Bodywork / Dent / Dent
16	Door / Front Left	Bodywork / Dent / Dent
17	Door / Front Left	Paint / Corrosion
18	Door / Back Left	Bodywork / Dent / Dent
19	Door / Back Left	Bodywork / Dent / Dent
20	Door / Back Left	Paint / Scratch / Scuff
21	Door / Back Left	Paint / Scratch / Scuff
22	Hubcap / Front Left	Missing element hubcap
23	Side Panel / Back Left	Bodywork / Dent / Dent
24	Side Panel / Back Left	Bodywork / Dent / Dent
25	Fender / Back Left	Paint / Scratch / Scuff
26	Fender / Back Left	Paint / Scratch / Scuff
27	Corner Bumper / Back Left	Paint / Scratch / Scuff
28	Trunk Tailgate Handle / Back	Bodywork / Breakage
29	Tailgate	Paint / Scratch / Scuff
30	Corner Bumper / Back Right	Paint / Scratch / Scuff
31	Corner Bumper / Back Right	Bodywork / Breakage
32	Fender / Back Right	Bodywork / Dent / Dent
33	Side Panel / Back Right	Paint / Corrosion
34	Door / Back Right	Bodywork / Dent / Dent
35	Door / Back Right	Paint / Corrosion
36	Door / Front Right	Bodywork / Dent / Dent
37	Door / Front Right	Paint / Corrosion
38	Door / Front Right	Bodywork / Dent / Dent
39	Mirror Shell / Front Right	Bodywork / Breakage
40	Fender / Front Right	Paint / Scratch / Scuff



1. Luggage Space Cover / Back Interior / Missing -




2. Seat / Back Center Interior / Loose -



3. Steering Wheel / Front Interior / Worn - out -



4. B Pillar / Center Left Bodywork / Dent / Dent -

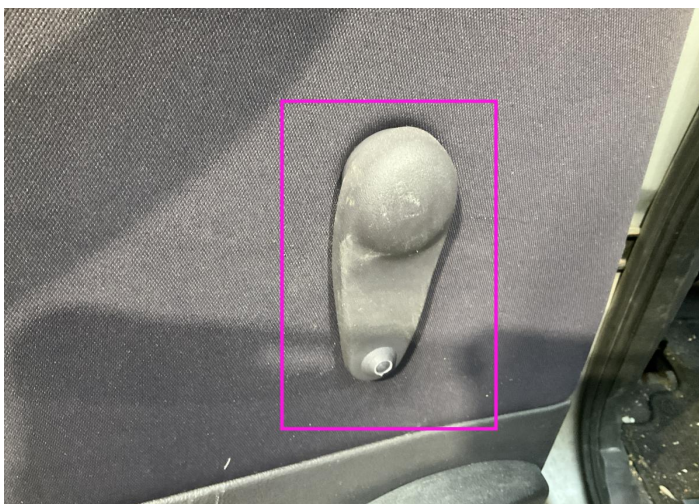

5. Window Switch / Back Left Interior / Broken -



6. Panel Filling / Front Right Interior / Holed -



7. Panel Filling / Front Right Interior / Scratched -




8. Panel Filling / Back Right Interior / Scratched -




9. Panel Filling / Back Left Interior / Scratched -



10. Panel Filling / Front Left Interior / Scratched -

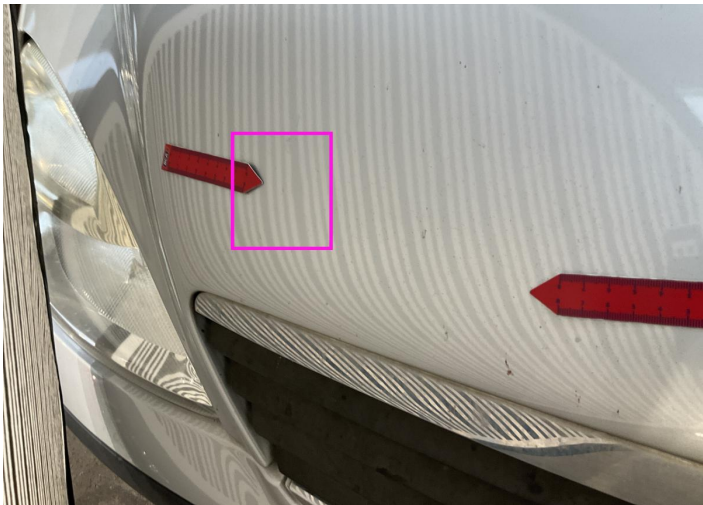

11. Hood Bodywork / Dent / Dent -

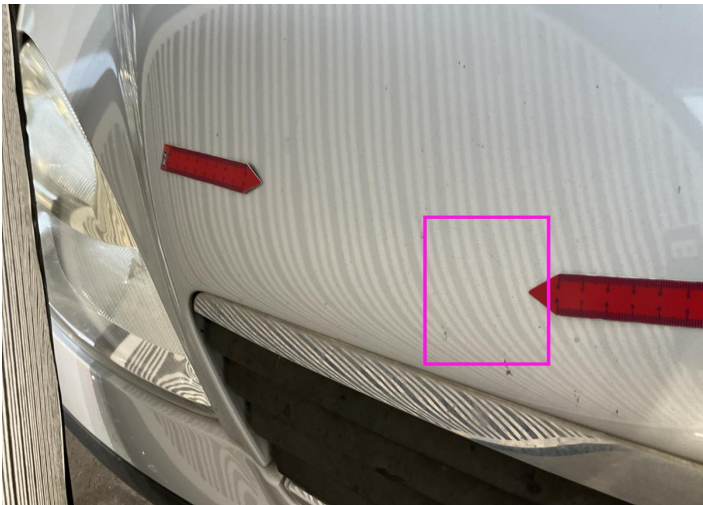


12. Hood Bodywork / Dent / Dent -




13. Bumper / Front
Bodywork / Breakage -



14. Fender / Front Left
Paint / Scratch / Scuff -

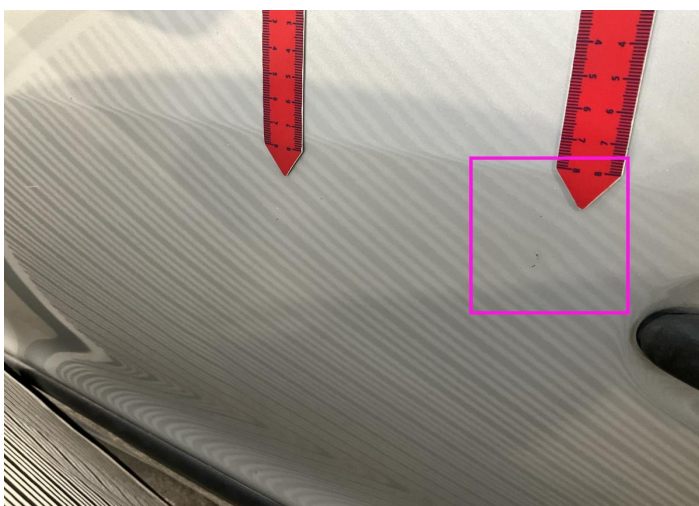


15. Door / Front Left
Bodywork / Dent / Dent -

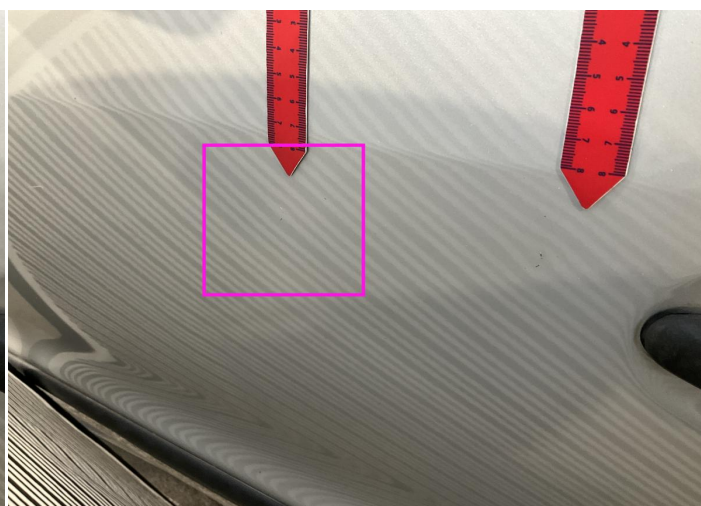


16. Door / Front Left
Bodywork / Dent / Dent -



17. Door / Front Left
Paint / Corrosion -

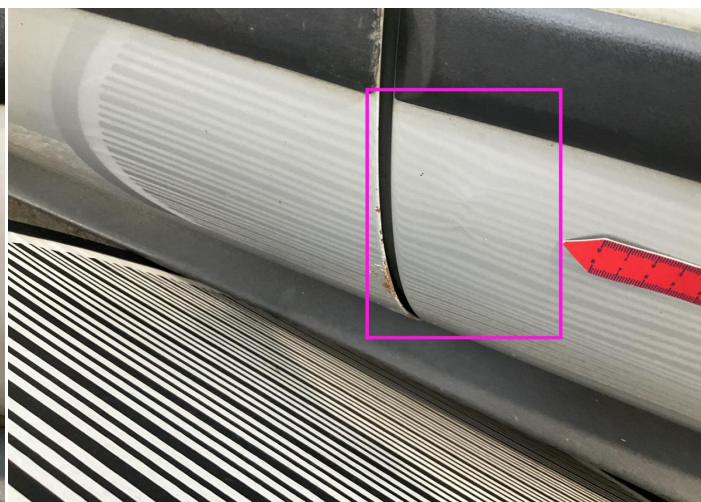

18. Door / Back Left
Bodywork / Dent / Dent -

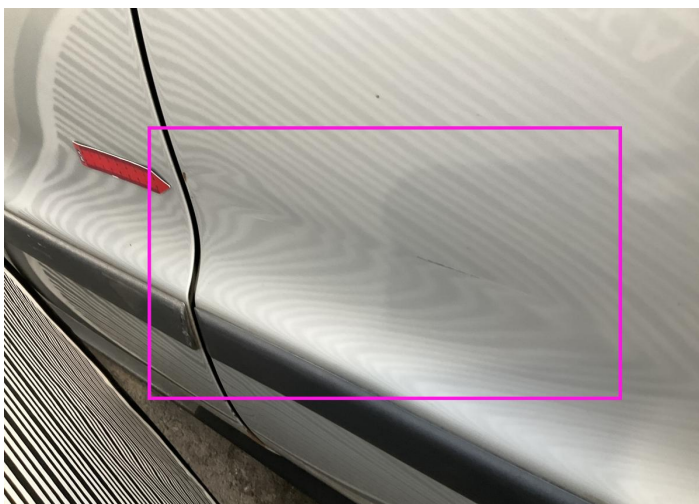

19. Door / Back Left
Bodywork / Dent / Dent -




20. Door / Back Left
Paint / Scratch / Scuff -



21. Door / Back Left
Paint / Scratch / Scuff -




22. Hubcap / Front Left
Missing element hubcap -

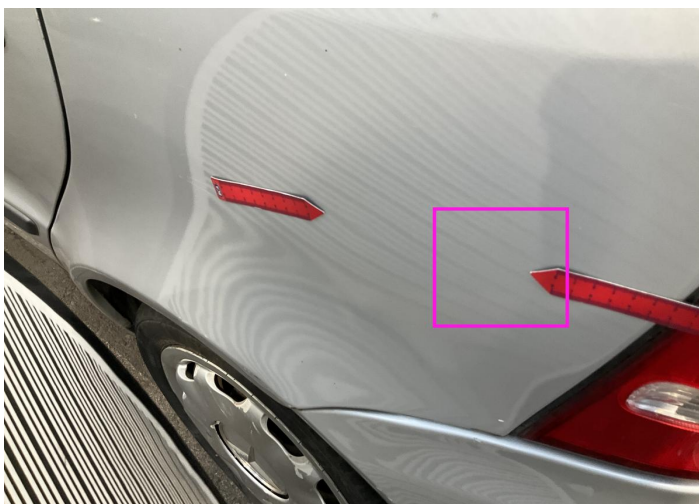

23. Side Panel / Back Left
Bodywork / Dent / Dent -



24. Side Panel / Back Left
Bodywork / Dent / Dent -

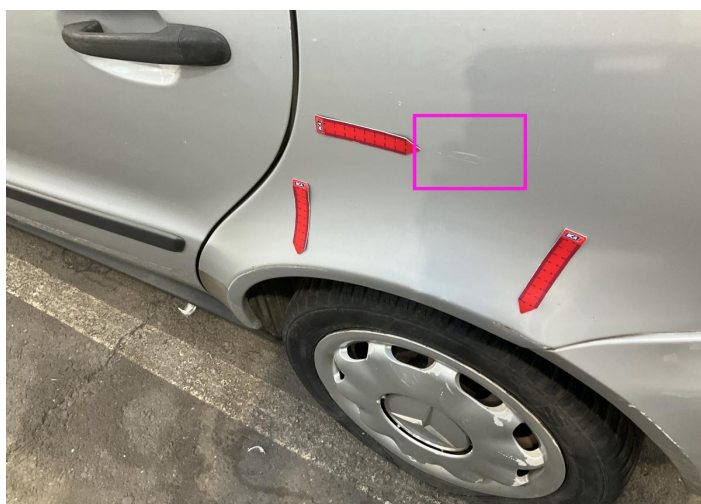

25. Fender / Back Left
Paint / Scratch / Scuff -



26. Fender / Back Left
Paint / Scratch / Scuff -



27. Corner Bumper / Back Left
Paint / Scratch / Scuff -



28. Trunk Tailgate Handle / Back
Bodywork / Breakage -



29. Tailgate
Paint / Scratch / Scuff -



30. Corner Bumper / Back Right
Paint / Scratch / Scuff -



31. Corner Bumper / Back Right
Bodywork / Breakage -



32. Fender / Back Right
Bodywork / Dent / Dent -




33. Side Panel / Back Right
Paint / Corrosion -



34. Door / Back Right
Bodywork / Dent / Dent -




35. Door / Back Right
Paint / Corrosion -

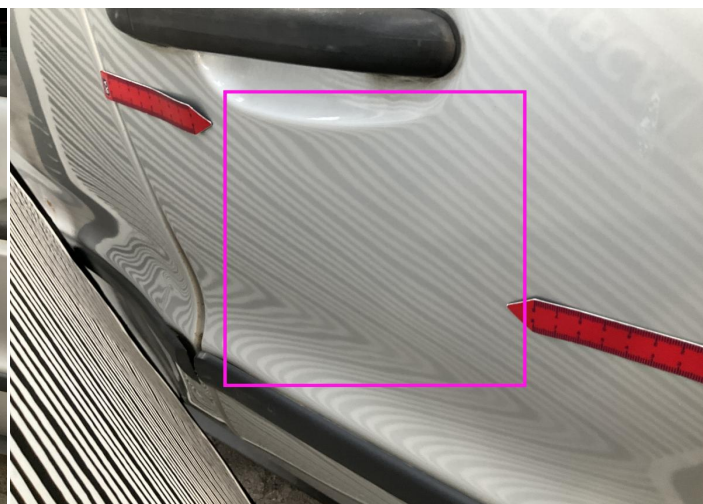

36. Door / Front Right
Bodywork / Dent / Dent -



37. Door / Front Right
Paint / Corrosion -

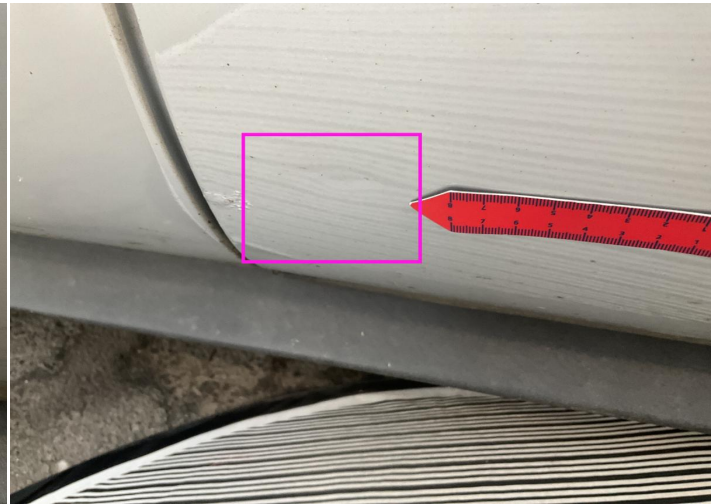

38. Door / Front Right
Bodywork / Dent / Dent -



39. Mirror Shell / Front Right
Bodywork / Breakage -



40. Fender / Front Right
Paint / Scratch / Scuff -

Mechanical Condition

Control Lights

Display Defect	✓	ABS Warning Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓
Tire Pressure Monitoring System	✓		

Equipments Test

Main & Spare Keys Functioning	✓	Electric Windows	!
AC / Heating System	✓		

Engine

Engine Status / EML	!	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel			
Steering Noise / Anomaly		✔	
Engine			
Engine Noise	✔	The Gears Scratch / Skip / Abnormal Operation	✔
Fume Quantity	✔	Power Loss	✔
Clutch			
Clutch Functioning		✔	
Brake			
Brake System Anomaly		✔	
General			
Test Driven Status		✔	
✔ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
= Not tested			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)