



MERCEDES Classe A-176 Diesel
A 180 cdi Sport (BlueEff) auto

VIN NO WDD1760001J170066
Registration Number ES555PK



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2024-10-14	-	-	198890 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
-	-	2013-10-01	Italy

Inspection Report Summary

Customer	BCA Lodi	Report Number	P20250915105556
Inspection Date / Place	2025-09-15 / BCA Lodi	Cosmetic Grade	4

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Gearbox Type	Automatic
Colour	Red	Engine Size (cc)	1796
Engine Size	1.8	No of Doors	5
Body Type	Sedan	Drive Train	Front
Seat Colour	Black	No of Seats	5
Seat Covering Name		Seat Covering	Cloth/Leather
Charging Cables		WLTP CO2 Emissions	

Vehicle History & Documents

Service Book Available	-	Next Service Mileage	km
Previous Usage	Normal Use	Imported	No
Manufacturer Warrenty			







Equipment

Central locking	Rear parking sensors	Digital Radio	Satellite navigation
Parcel Shef	Remote central locking	Stability control	Power assisted steering
Alloys wheels	Electrically folding wing mirrors	Volante multifuncion	Remote adjusting wing mirrors

Trip Computer


Wheels & Tyres

Mounted Tires


Tyre / Wheel Type	Summer
	225/45//R17 - 94W / 2 mm
	225/45//R17 - 94W / 2 mm
	225/45//R17 - 94W / 3 mm
	225/45//R17 - 94W / 3 mm

Cosmetic Damage

24 Danni

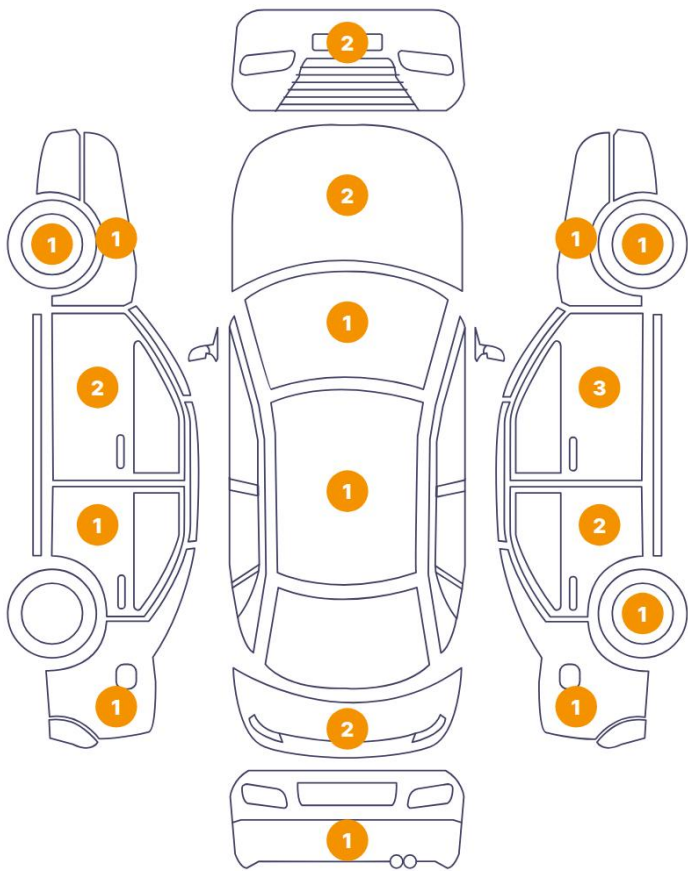


5 Danni

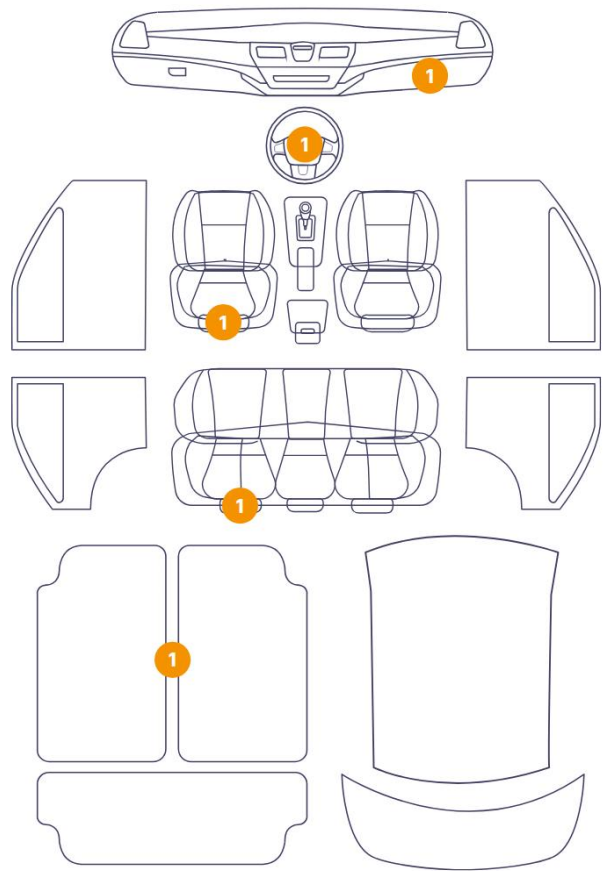

Component		Damage	Comments
1	TV DVD Screen / Front	Interior / Broken	
2	Steering Wheel / Front	Interior / Worn - out	
3	Seat / Front Left	Interior / Broken	
4	Floor Carpet	Interior / Burn	
5	Windshield / Front	Glass Break / Impact	
6	Hood	Bodywork / Dent	
7	Hood	Paint / Chipping	
8	Bumper / Front	Bodywork / Dent	
9	Bumper / Front	Bodywork / Poor Previous Repair	
10	Rim / Front Left	Out of Bodywork / Scratch	
11	Fender / Front Left	Paint / Chipping	
12	Door / Front Left	Bodywork / Dent	


13	Door / Back Left	Paint / Scratch / Line
14	Fender / Back Left	Paint / Scratch / Line
15	Seat Cushion / Back Left	Interior / Broken
16	Pillar / Front Left	Bodywork / Poor Previous Repair
17	Bumper / Back	Bodywork / Dent
18	Tailgate	Bodywork / Dent
19	Spoiler / Back	Bodywork / Poor Previous Repair
20	Fender / Back Right	Paint / Chipping
21	Rim / Back Right	Out of Bodywork / Scratch
22	Door / Back Right	Paint / Scratch / Line
23	Door / Back Right	Paint / Chipping
24	Door / Front Right	Bodywork / Dent
25	Mirror Shell / Front Right	Paint / Scratch / Line
26	Fender / Front Right	Bodywork / Poor Previous Repair
27	Rim / Front Right	Out of Bodywork / Scratch
28	Pillar / Front Right	Bodywork / Poor Previous Repair
29	Roof	Bodywork / Dent / Hail Area

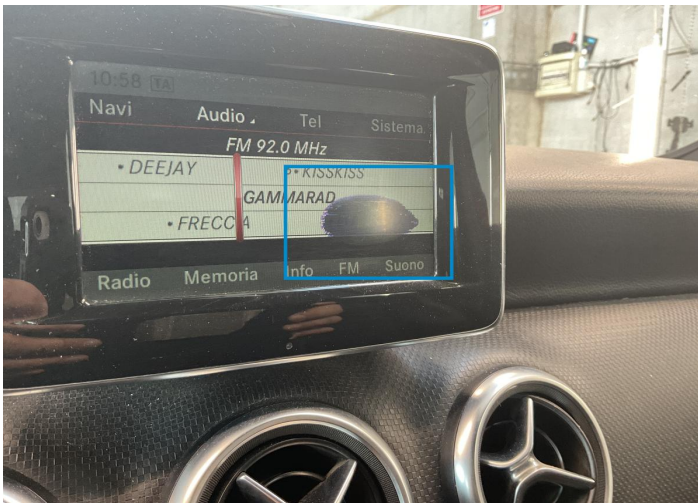


1. TV DVD Screen / Front
Interior / Broken -




2. Steering Wheel / Front
Interior / Worn - out -

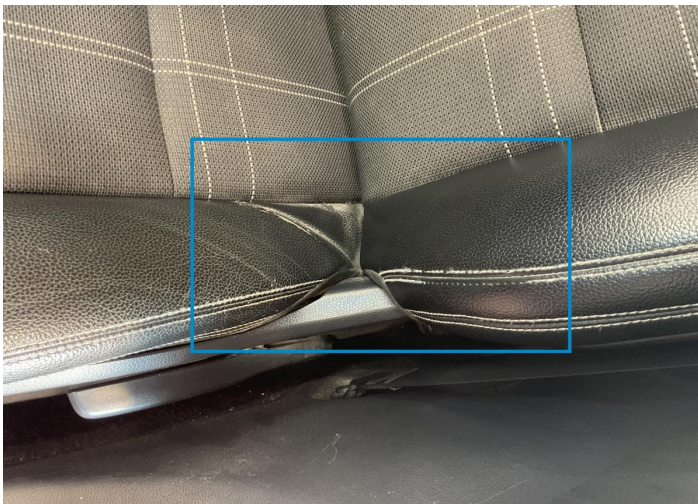


3. Seat / Front Left
Interior / Broken -

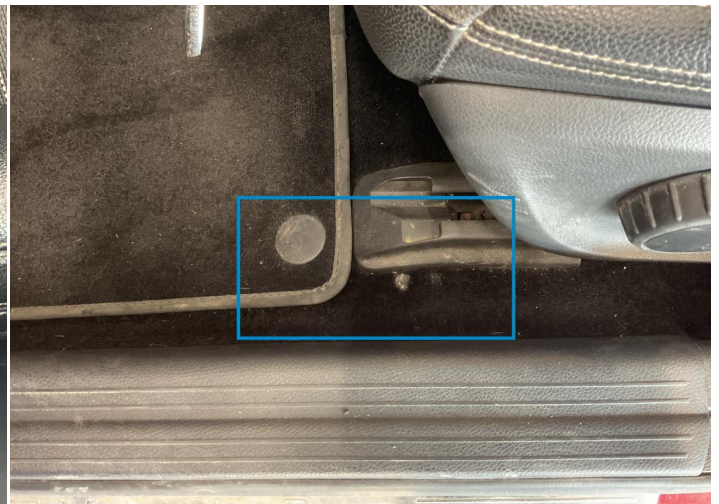


4. Floor Carpet
Interior / Burn -

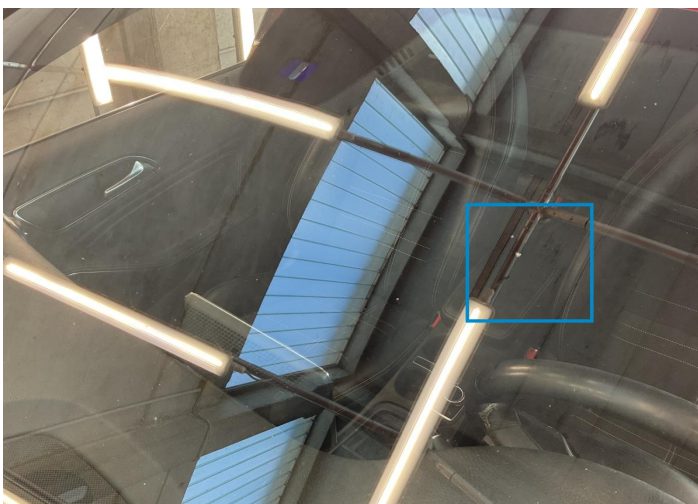

5. Windshield / Front
Glass Break / Impact -

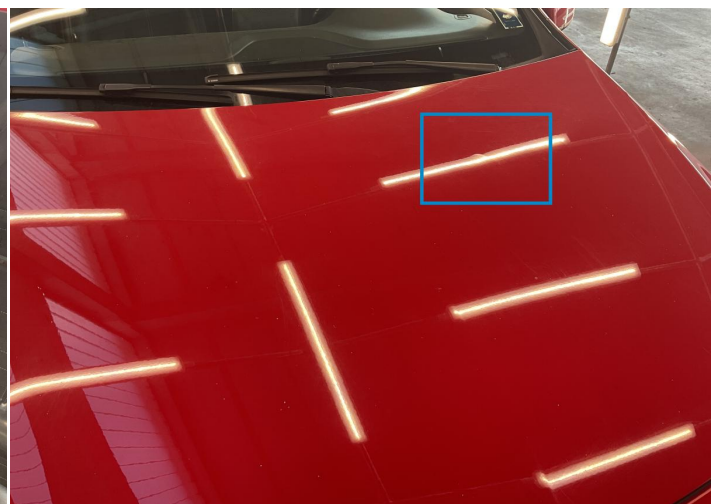


6. Hood
Bodywork / Dent -

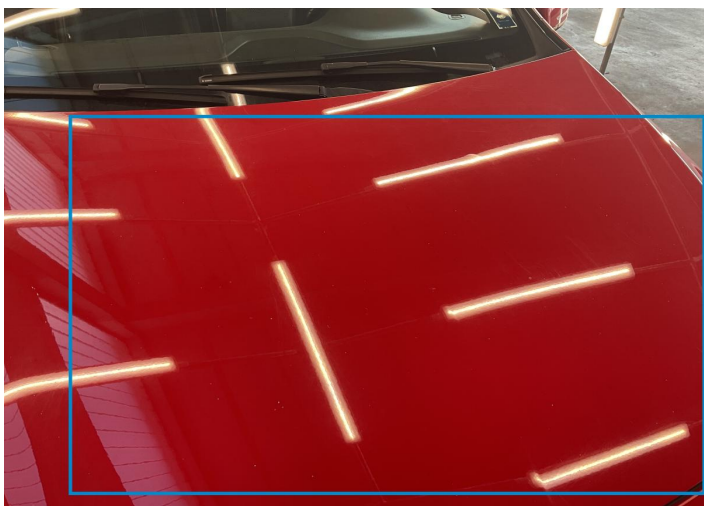

7. Hood
Paint / Chipping -



8. Bumper / Front
Bodywork / Dent -

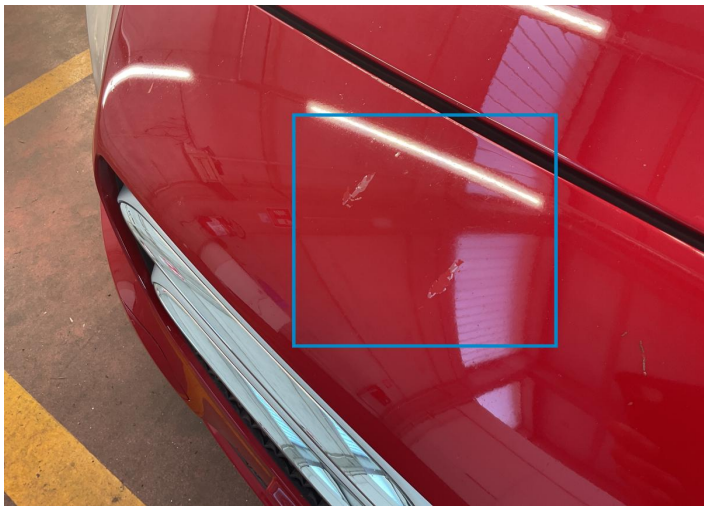


9. Bumper / Front
Bodywork / Poor Previous Repair -



10. Rim / Front Left
Out of Bodywork / Scratch -




11. Fender / Front Left
Paint / Chipping -

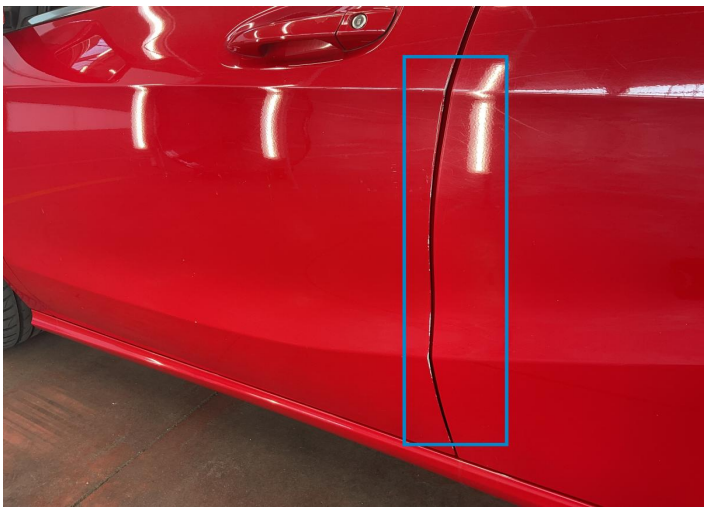

12. Door / Front Left
Bodywork / Dent -



13. Door / Back Left
Paint / Scratch / Line -

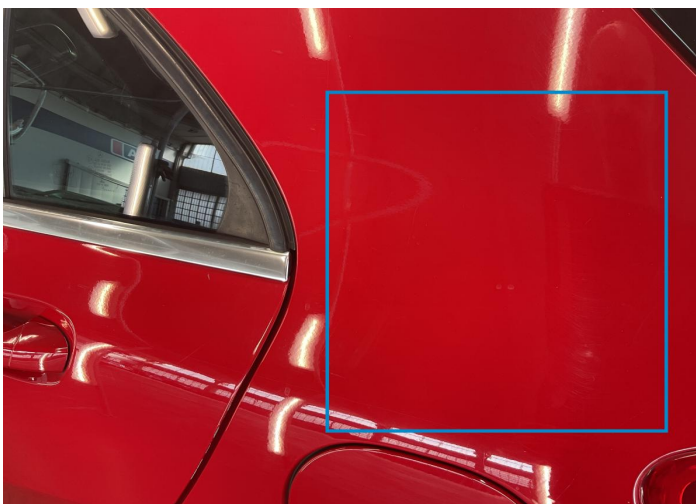


14. Fender / Back Left
Paint / Scratch / Line -



15. Seat Cushion / Back Left
Interior / Broken -



16. Pillar / Front Left
Bodywork / Poor Previous Repair -

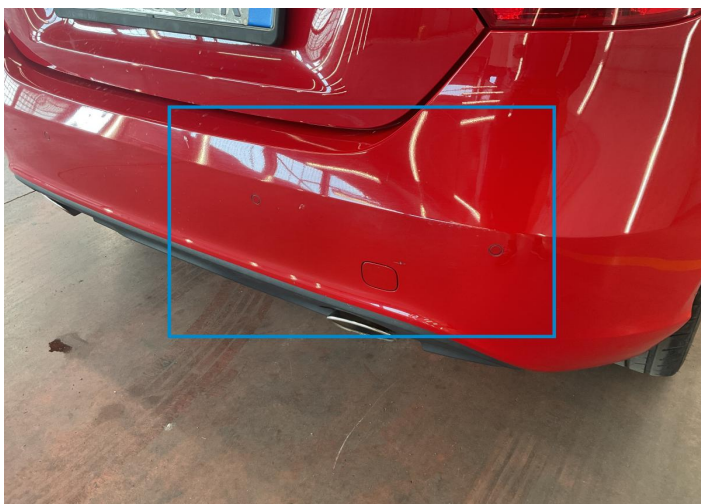


17. Bumper / Back
Bodywork / Dent -



18. Tailgate
Bodywork / Dent -




19. Spoiler / Back
Bodywork / Poor Previous Repair -

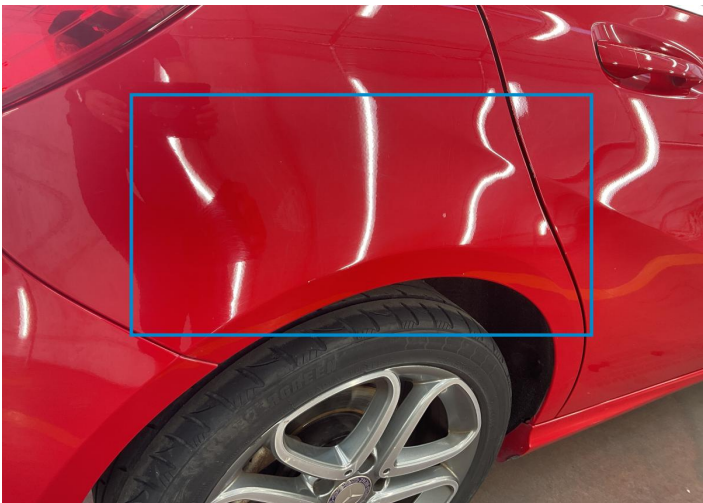

20. Fender / Back Right
Paint / Chipping -




21. Rim / Back Right
Out of Bodywork / Scratch -

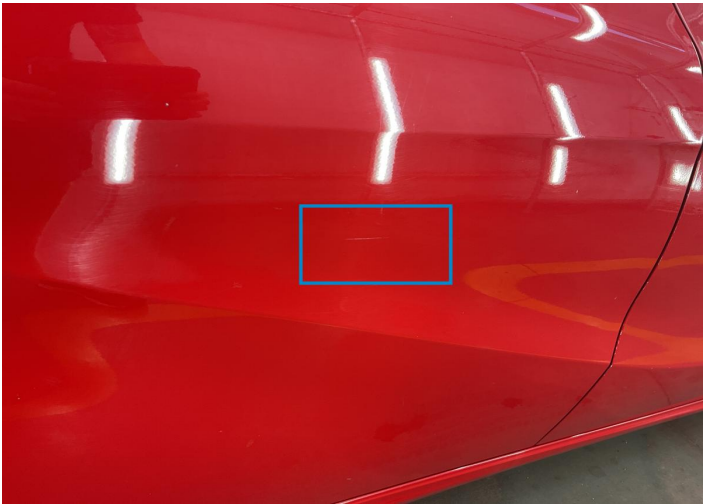

22. Door / Back Right
Paint / Scratch / Line -



23. Door / Back Right
Paint / Chipping -

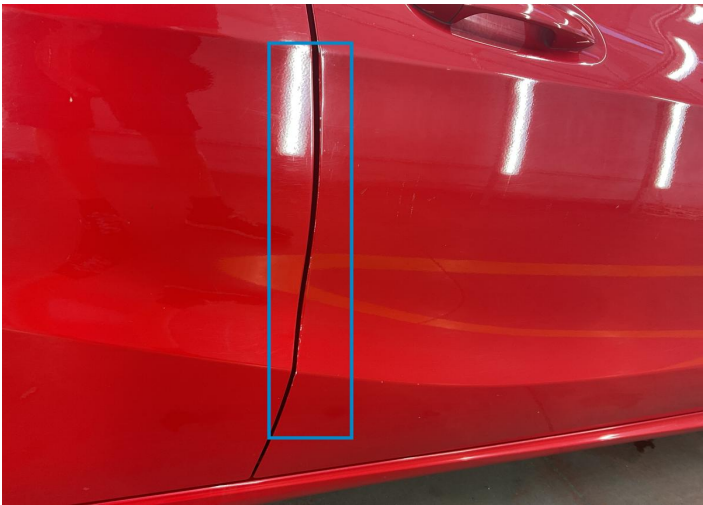


24. Door / Front Right
Bodywork / Dent -



25. Mirror Shell / Front Right
Paint / Scratch / Line -




26. Fender / Front Right
Bodywork / Poor Previous Repair -

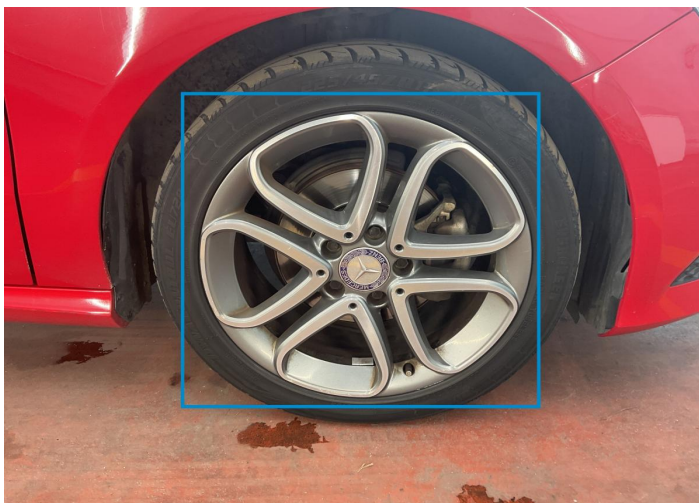

27. Rim / Front Right
Out of Bodywork / Scratch -



28. Pillar / Front Right
Bodywork / Poor Previous Repair -

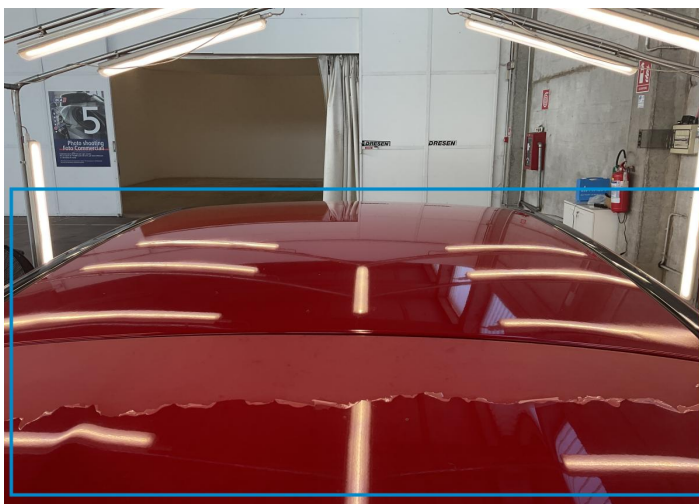

29. Roof
Bodywork / Dent / Hail Area -

Mechanical Condition

Engine			
Vehicle Start - up	✓	Engine Starts	✓
Engine Leak Visible	✓		
Clutch			
Clutch Functioning	✓		
Equipments Test			
Other Equipments	✓	AC / Heating System	✓
Levels			
Brakes Fluid	✓	Coolant Fluid	✓

Test Drive Inspection

Other Checks			
Steering	✓	Brakes	✓
Suspension	!		
Gearbox			
Manual Gearbox	✓		
General			
Test Driven Status	✓		
Equipments Test			
Steering Noise / Anomaly	✓		
Engine			
Power Loss	✓	Fume Quantity	✓
Engine Noise	!		
✓ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
☐ Not tested			