



Mercedes A-Klasse (UKL): 1WRP358

Vinnumber:	WDD1770031126671	Versionname:	A180d Launch Edition Edition 1 1.5d 116pk/cv 5p 7G-DCT
First Registrationdate:	23/08/2019	Fiscalpower:	
Expertise Mileage:	186190	Power Kw:	85
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:			
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	205/55/17/95 V			
Summer tyres:	Fr.L.	Firestone: 6 mm	Fr.R.	Firestone: 6 mm
	Re.L.	Firestone: 6 mm	Re.R.	Firestone: 6 mm
Tyre profile depth FL	6.0			
Tyre profile depth FR	6.0			
Tyre profile depth RL	6.0			
Tyre profile depth RR	6.0			
Tyre size FL	205/55 R 17 95 V			
Tyre size FR	205/55 R 17 95 V			
Tyre size RL	205/55 R 17 95 V			
Tyre size RR	205/55 R 17 95 V			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	258			
Tyre make FR	258			
Tyre make RL	258			
Tyre make RR	258			

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Door panel FL, Worn, Acceptable



Backrest cover FL, Scratch(es), Acceptable



Backrest cover FR, Scratch(es), Acceptable



Bonnet, Stone chip(s), Acceptable



Bumper F, Scratch(es), Repair and paint (complete)



Headlight L, Scratch(es), Replace



Step L, Dent(s) and scratch(es), Acceptable



Alloy rim FL, Scratch(es), Repair and paint (complete)



Wing FL, Scratch(es), Acceptable



Roof pillar L, Scratch(es), Acceptable



Door FL, Scratch(es), Acceptable



Door RL, Dent(s) and scratch(es), Acceptable



Wing RL, Dent(s) and scratch(es), Repair and paint (complete)



Alloy rim RL, Scratch(es), Repair and paint (complete)



Boot carpet, Stain, Acceptable



Bumper R, Deformed / Strained, Repair and paint (complete)





Rear window, Scratch(es), Check



Tailgate / Boot, Dent(s), Acceptable




Step R, Scratch(es), Acceptable



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Repair and paint (complete)

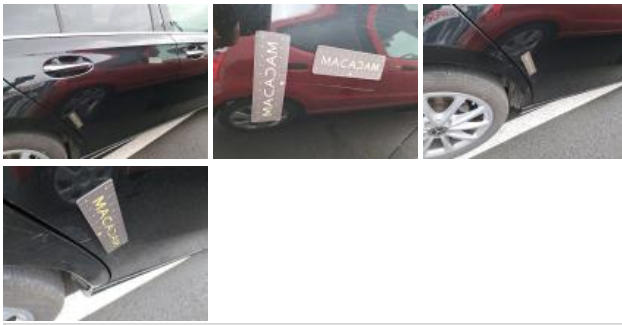

Alloy rim RR, Scratch(es), Acceptable



Door RR, Dent(s), Acceptable




Door FR, Scratch(es), Acceptable



Outside rear-view mirror R, complete, Scratch(es), Acceptable



Alloy rim FR, Scratch(es), Acceptable

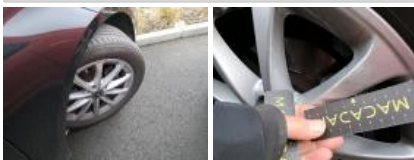

Wing FR, Scratch(es), Acceptable



Roof pillar R, Scratch(es), Acceptable



Roof pillar R, Dent(s), Paintless dent repair



Sill trim R, Scratch(es), Acceptable



Bodywork, Not original part, Acceptable

