

Vehicle details

VIN	WF0EXXTTR ENS71913	Brand	FORD	Maintenance date	-
Licence Plate	VR-J1-6J	Model	TRANSIT 350 170pk L4H3 Trend RWD	Maintenance mileage	-
Registration date	10/08/2022	Year	2022	Exterior Color	White Solid
Odometer	113 025 km	Engine size	1995	interior Color	Grey
Fuel	Diesel	Body Type	Panel van	Next technical inspection	-
Seats	3	Transmission	Automatic	CO2	-
Doors	4	Gears	-		

Inspection Details

Inspection date	29/10/2025	Inspection loc.	Dekra Ayvens
-----------------	------------	-----------------	--------------



Generic equipment

Manual air-conditioning	✓
Cruise control	✓
Automatic Gearbox	✓
Central locking	✓
Electric windows	✓
Park Distance Control	✓
Audio System	✓

Removable element

Spare wheel (wheel & tyre)	✓
----------------------------	---


Technical Document

User manual	✓
Warranty booklet	✓
Spare key	✓
Remote key	✓

Tyres

Winter kit

Michelin 255/65/16 Winter 3.5 mm

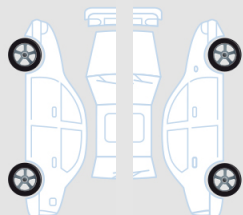

Michelin 255/65/16 Winter 3.5 mm



Michelin 255/65/16 Winter 4.5 mm

Michelin 255/65/16 Winter 4.5 mm

Exterior

1		Part Position Damages Severity Repair mode	Wing moulding Front left Missing - Replace
2		Part Position Damages Severity Repair mode	Wheelcap 16" Front left Missing - For info
3		Part Position Damages Severity Repair mode Richtingaanwijzer spiegel	Other bodywork Left Broken - Replace
6		Part Position Damages Severity Repair mode	Wing Left Dented Diameter (mm) > 20 Smart Repair
7		Part Position Damages Severity Repair mode	Wing Back left Dent & Chips - Repair
8		Part Position Damages Severity Repair mode	Door Back left Dented Diameter (mm) > 20 Repair
9		Part Position Damages Severity Repair mode	Door moulding Back left Scratched - Replace
10		Part Position Damages Severity Repair mode	Door Back right Broken - Replace
11		Part Position Damages Severity Repair mode	Door moulding Back right Scratched - Replace
12		Part Position Damages Severity Repair mode	Wing Back right Dent & Chips - Repair
13		Part Position Damages Severity Repair mode	Wing Right Dented Diameter (mm) > 20 Smart Repair
14		Part Position Damages Severity Repair mode Schuifdeur	Other bodywork Right Dented - Repair
15		Part Position Damages Severity Repair mode Sierstrip schuifdeur	Other bodywork Right Scratched - Repair
16		Part Position Damages Severity Repair mode	Door Front right Dented Diameter (mm) > 20 Smart Repair
17		Part Position Damages Severity Repair mode	Bumper Front Not conform - For info
18		Part Position Damages Severity Repair mode	Unpainted bumper Front Dented - Replace

19		Part Step plate Position Front left Damages Scratched Severity - Repair mode For info	20		Part Roof Position - Damages Dent & Chips Severity - Repair mode Repair
21		Part Roof post A/B/C Position Left Damages Dent & Chips Severity - Repair mode Repair	22		Part Roof post A/B/C Position Right Damages Dent & Chips Severity - Repair mode Repair
23		Part Wing moulding Position Back left Damages Scratched Severity - Repair mode Repair	24		Part Other bodywork Position - Damages Chemical deposit Severity - Repair mode For info Buitenzijde voertuig
25		Part Windscreen Position - Damages Stone impact Severity - Repair mode For info	26		Part Tipper body Position - Damages Not conform Severity - Repair mode For info

Interior damage

4



● ● ●

Part	Fabric seat
Position	Front left
Damages	Perforated
Severity	-
Repair mode	Replace

5



● ●

Part	Interior cleaning
Position	Front right
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning