



Expertise

Protocol number: 40712616
Order No. / Reference: 24903101
Inspection date: 23 Jul 2025

Manufacturer: Ford

Model: Kuga 2.0 EcoBlue 4x4 Aut. ST-LINE

VIN: WF0FXXWPMFMM02256



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Kuga 2.0 EcoBlue 4x4 Aut. ST-LINE

Vehicle Identification number	WF0FXXWPMFMM02256
Mileage (Read)	39,976 km
First registration	10 Jun 2021
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	

Power / Engine displacement	140 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV

Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite

Re/Import	no
Vehicle with smoke odor	no
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / incomplete	Next maintenance in	90 %
Last maintenance on / at	05/2025 at 39,483 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FZ495904
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	Sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	8566 / BTH 00088		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,245 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	225/60 R18 104V	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	165/70 R17 114M	Summer tyres on Steel	Maxxis	4 mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- All-wheel drive
- Anti-lock braking system
- Exterior mirrors electrically adjustable, heated and foldable (painted in body color - with integrated indicators and ambient lighting)
- Tires: Tire repair kit (max. 80 km/h permitted when used)
- Brake light, third
- Woven fabric headliner
- Roof console with glasses storage compartment
- Roof spoiler (painted in body color)
- 12.3-inch digital instrument panel
- tachometer
- Driving mode switch more selective (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Roads)
- Electric parking brake with Auto Hold function
- Ford Easy Fuel (Ford Easy Fuel convenience refueling system (Eliminates the need for a separate internal fuel cap and prevents misfueling by recognizing the size difference between petrol and diesel fuel nozzles. This ensures that the filler neck opens only when the correct fuel is used.)
- Luggage compartment cover, roller blind, removable
- Cruise control system
- Glove compartment, illuminated
- Rear window wiper
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Headrests front and rear (5) height adjustable
- LED taillights
- LED fog lights
- Steering wheel: ST-Line design, flattened at the bottom and with red decorative stitching, in Sensico synthetic leather
- MyKey key system (individually programmable second key)
- Emergency brake light, pulsating illumination of the brake lights during heavy braking
- Parking pilot system front and rear
- Pedals with aluminum support
- Upholstery: Cloth
- Post-Collision Assist
- Pre-Collision Assist (including Forward Alert (FA) with pedestrian and bicycle detection - active from approx. 5 km/h to 130 km/h, pedestrian and bicycle detection up to approx. 80 km/h.)
- Headlight dipped beam with switch-off delay
- Power steering (electro-mechanical, speed-dependent (EPAS - Electric Power Assisted Steering))
- Ambient lighting (front including front door storage, footwell and cup holder lighting with LED technology)
- Passenger airbag deactivation
- Tires: 7.5 J x 18 alloy wheels (4) in 5x2-spoke design in Rock Metallic (with tires 225/60 R 18)
- Body styling kit (front and rear bumpers, special design - upper grille in honeycomb look, with black border - side skirts and wheel house trim painted in body color)
- Roof rails, black
- diesel particulate filter
- Twin-pipe exhaust system
- Electronic Stability Program (ESP) (with hill start assist, traction control and safety brake assist)
- Lane Assistant including Lane Keeping Assist
- Electric windows front and rear (with quick-down switch including total closing function)
- Ford EcoCoach (shows the efficiency of current driving behavior)
- Ford Power Start & Ford Key Free System (keyless locking/unlocking)
- FordPass Connect (including eCall, live traffic information and Wi-Fi hotspot)
- Luggage compartment lighting
- Transmission: 8-speed automatic
- Heated rear window
- Inductive charging station for mobile devices
- Intelligent Safety System (IPS Intelligent Protection System) (front airbags for driver and front passenger - curtain airbags at the front and rear - side airbags for driver and front passenger - seatbelt pretensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seatbelts on all seats, height-adjustable at the front - warning system for unfastened driver and front passenger seatbelts)
- Steering wheel: paddle shifters on the steering wheel
- Steering column, adjustable in height and reach
- Front center console with integrated armrest (2 front cup holders (illuminated) - 12-volt connection)
- Navigation system: Ford navigation system including Ford SYNC 3 (AppLink, Android Auto, Apple CarPlay - 8" touchscreen (20.3 cm screen diagonal) - DAB/DAB+ (Digital Audio Broadcasting) radio reception - 6 speakers - Steering wheel remote control - Bluetooth® hands-free system and audio streaming - 2 USB ports - Voice control for audio and telephone - Text message reading function - European road map)
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor



- Seats: Map pocket on driver and passenger seat backrests
- Seats: Front sports seats with integrated headrest
- Sun visor on driver and passenger side
- Power socket: 12-volt connection in the luggage compartment
- Immobiliser

- Seats: Driver and passenger seats, 8-way manually adjustable (including adjustable lumbar support)
- Seats: Rear seat bench, sliding, with split folding backrest
- Seats: Front seats, individually and variably heated
- Start-stop system
- Carpet floor mats front and rear
- Side window borders in black
- Central locking with remote control and remote luggage compartment release

Extra equipment

- Tires: Spare tire (T165/70 R17 tires - instead of tire repair kit - max. 80 km/h permitted when used)
- Electric child safety door lock
- Cigarette lighter and ashtray in the center console
- Paintwork: Solid special color
- Package: Winter II (heated windscreen - heated leather steering wheel - heated outer rear seats)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smart repair
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value

Wear and tear

No.	Component group	Description
1	Roof	Roof - dent(s) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 2 May 2023	2.545,06 €
2	Roof, Front, Side right, Provided by user / customer, from 23 Jun 2021	10.838,65 €

Repainting



No. Repainting

1 Roof, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof 196 µm |

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area

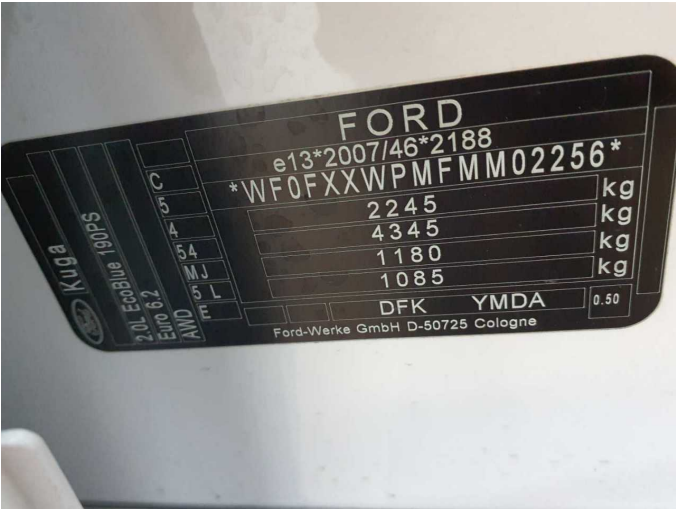


Figure 11: VIN



Figure 12: Mounted tyres

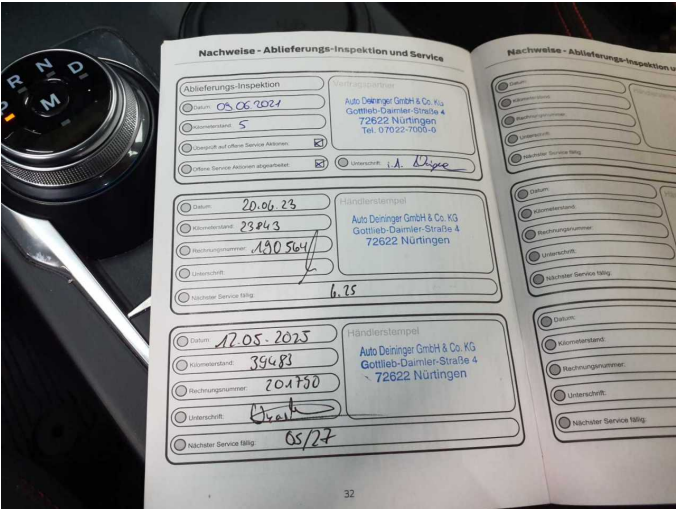


Figure 13: Documents

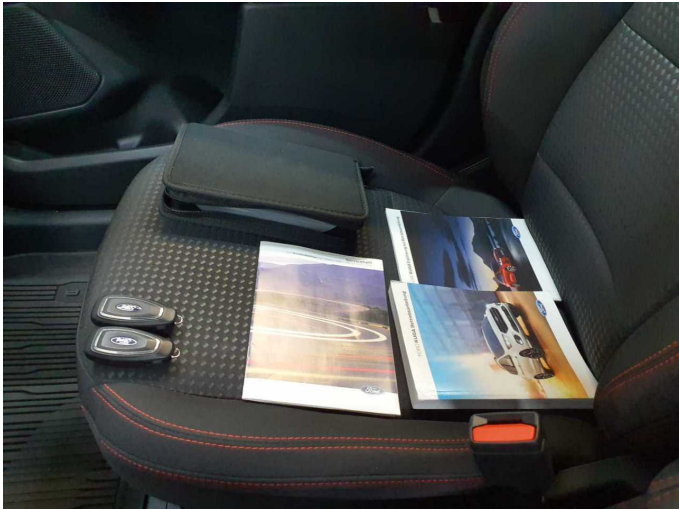


Figure 14: Documents

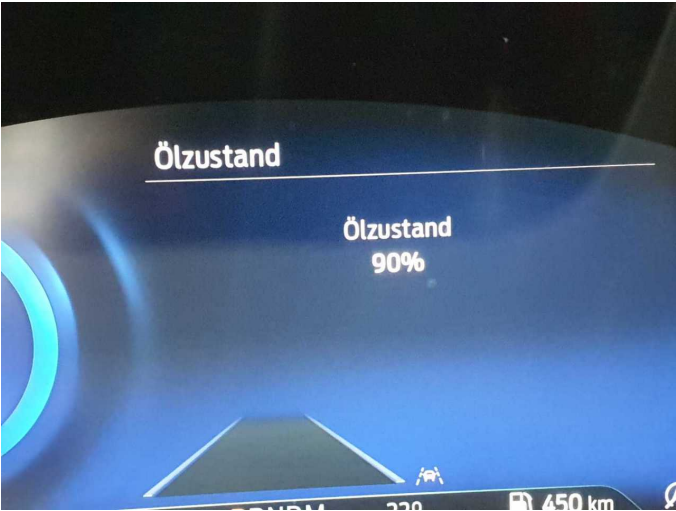


Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smart repair

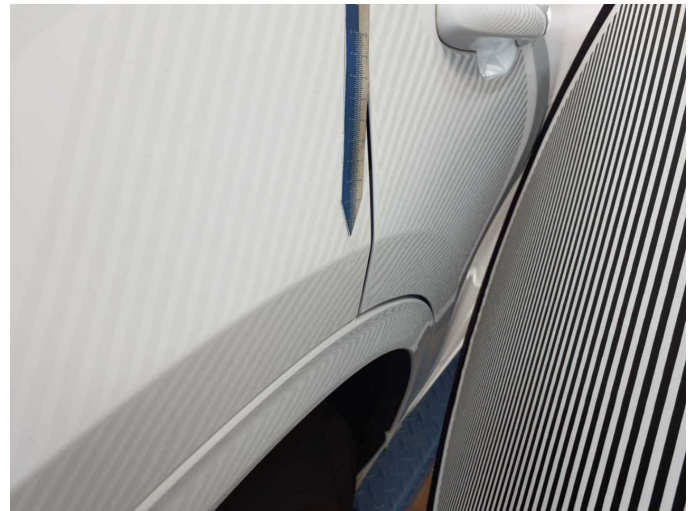

Damage 1: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Repainting 1: Roof



Repainting 1: Roof