



Expertise

Protocol number: 41153717  
Order No. / Reference: 25109274  
Inspection date: 18 Aug 2025

Manufacturer: Ford	Model: Kuga 1.5 EcoBlue Aut. TITANIUM X
VIN: WF0FXXWPMFNJ41370	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 1.5 EcoBlue Aut. TITANIUM X	
Vehicle Identification number	WF0FXXWPMFNJ41370
Mileage (Read)	102,455 km
First registration	15 Sept 2022
Number of holders	1
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-Black



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / complete	<b>Next maintenance in</b>	97 %
<b>Last maintenance on / at</b>	07/2025 at 101,942 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	GK822265
<b>Previous damage / Accident</b>	Detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	8566 / BTJ 00291		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	2,110 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102V	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	225/65 R17 102V	Summer tyres on Light alloy	Pirelli	4mm / 4mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102H	Winter tyres on Light alloy	Hankook	5mm / 5mm
2)	225/65 R17 102H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



## Equipment

### Standard equipment

- |  |   |
|--|---|
| <ul style="list-style-type: none"> <li>• Ambient lighting</li> <li>• Exterior mirrors electrically adjustable, heated and foldable</li> <li>• Tires: 7 J x 17 light alloy wheels (4) in 5x2-spoke design</li> <li>• Brake light, third</li> <li>• Roof rails, silver</li> <li>• diesel particulate filter</li> <li>• Twin-pipe exhaust system</li> <li>• Electronic Stability Program (ESP)</li> <li>• Lane Assistant including Lane Keeping Assist</li> <li>• Electric parking brake with Auto Hold function</li> <li>• Ford EcoCoach</li> <li>• FordPass Connect</li> <li>• Luggage compartment lighting</li> <li>• Transmission: 8-speed automatic</li> <li>• Electric tailgate, sensor-controlled (opening and closing by foot movement)</li> <li>• Interior mirror, automatically dimming</li> <li>• ISOFIX mounts including Top-Tether attachment points on the outer seats of the 2nd row</li> <li>• Headrests front and rear (5) height adjustable</li> <li>• Steering wheel: Steering wheel, 3-spoke design, in Sensico synthetic leather</li> <li>• Front center console with integrated armrest</li> <li>• Navigation system: Ford navigation system including Ford SYNC 3</li> <li>• Parking pilot system front and rear</li> <li>• Post-Collision Assist</li> <li>• Pre-Collision Assist</li> <li>• Tire pressure monitoring system (TPMS)</li> <li>• Windscreen wipers with rain sensor</li> <li>• Headlight assistant with day/night sensor</li> <li>• Power steering</li> <li>• Seats: Driver's seat electrically adjustable, 10-way including electrically adjustable lumbar support</li> <li>• Seats: Front sports seats with integrated headrest</li> <li>• Sun visor on driver and passenger side</li> <li>• Static LED headlights</li> <li>• Carpet floor mats front and rear, velour</li> <li>• Immobiliser</li> </ul> | <ul style="list-style-type: none"> <li>• Anti-lock braking system</li> <li>• Passenger airbag deactivation</li> <li>• Tires: Tire repair kit</li> <li>• Woven fabric headliner</li> <li>• Roof spoiler</li> <li>• 12.3-inch digital instrument panel</li> <li>• tachometer</li> <li>• Driving mode switch more selective</li> <li>• Electric windows front and rear</li> <li>• Ford Easy Fuel</li> <li>• Ford Power Start Function &amp; Ford Key Free System</li> <li>• Luggage compartment cover, roller blind, removable</li> <li>• Cruise control system</li> <li>• Glove compartment, illuminated</li> <li>• Heated rear window</li> <li>• Rear window wiper</li> <li>• Intelligent Security System (IPS Intelligent Protection System)</li> <li>• Air conditioning with automatic temperature control</li> <li>• LED taillights</li> <li>• Steering column, adjustable in height and reach</li> <li>• Rear center armrest with cup holder</li> <li>• MyKey key system</li> <li>• Emergency brake light, pulsating illumination of the brake lights during heavy braking</li> <li>• Upholstery: Premium upholstery Sensico in leather look/fabric</li> <li>• Radio accessories: B&amp;O Sound System</li> <li>• Rear view camera</li> <li>• Headlight dipped beam with switch-off delay</li> <li>• Side windows from 2nd row and rear window, dark tinted</li> <li>• Seats: Passenger seat, 8-way manually adjustable</li> <li>• Seats: Map pocket on driver and passenger seat backrests</li> <li>• Seats: Rear seat bench, sliding, with split folding backrest</li> <li>• Seats: Front seats, individually and variably heated</li> <li>• Start-stop system</li> <li>• Power socket: 12-volt connection in the luggage compartment</li> <li>• Central locking with remote control and remote luggage compartment release</li> </ul> |
|--|---|

### Extra equipment

- |  |  |
|--|--|
| <ul style="list-style-type: none"> <li>• reversible luggage compartment mat</li> <li>• Paintwork: Solid special color</li> </ul> | <ul style="list-style-type: none"> <li>• Inductive charging station for mobile devices (The inductive charging station allows you to charge your compatible smartphone while driving without the hassle of connecting it to a cable. The charging station is located in the vehicle's center console and is only activated when it comes into contact with a compatible device. If you place a wallet or other objects on the charging station, it remains inactive.)</li> </ul> |
|--|--|



- |  |   |
|--|---|
| <ul style="list-style-type: none"> <li>• Package: Driver Assistance Package (Automatic Transmission) (Intelligent Cruise Control, adaptive with traffic sign recognition system, Traffic Jam Assist with Stop&amp;Go function and Lane Keeping, Wrong-Way Driver Warning, Evasive Traffic Assist, Drowsy Warning, Pre-Collision Assist including Collision Warning with Cross-Traffic Detection, Blind Spot Assist with emergency braking and trailer detection, Active Parking Assist with parking and exit functions with semi-automatic vehicle guidance, Front camera with split view, Door edge protection, Intelligent Speed Limiter with speed limit display)</li> <li>• Panoramic sliding sunroof, electric including roof console with glasses storage compartment</li> <li>• WINTER COMPLETE WHEELS ON ALLOY RIMS</li> </ul> | <ul style="list-style-type: none"> <li>• Package: Technology (Adaptive LED headlights with glare-free high beam assistant and dynamic cornering lights, automatic headlight range control and LED fog lights - Head-up display)</li> <li>• Package: Winter II (heated windscreen - heated leather steering wheel - heated outer rear seats)</li> <li>• Safety net (including attachment points behind the first and second row of seats)</li> </ul> |
|--|---|

### Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

### Value reducing factors

No.	Component group	Description
1	Front bumper	Cap (Grill) - Missing - Replace
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Door - front left side	Door - dent(s) - Smart repair
4	Door - front left side	Window regulator - Broken / torn - Replace
5	Engine	Engine cover - top / cover (+maderschaden, Folgekosten sind möglich) - Damaged - Replace
6	Bonnet	Bonnet - Scratch(es) - Paint

### Wear and tear

No.	Component group	Description
1	Door - rear right side	Door - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

### Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 10 Mar 2024	1.507,32 €



## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
*(Functional tests of driver assistance systems are not included in the scope of services!)*
- a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.





**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

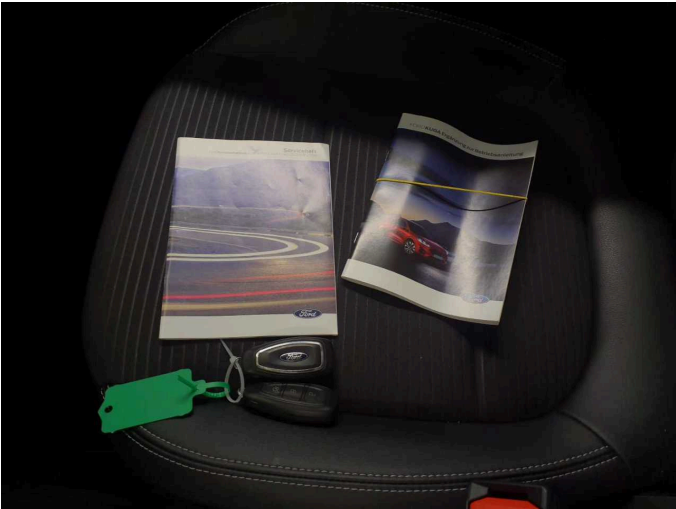


Figure 13: Documents

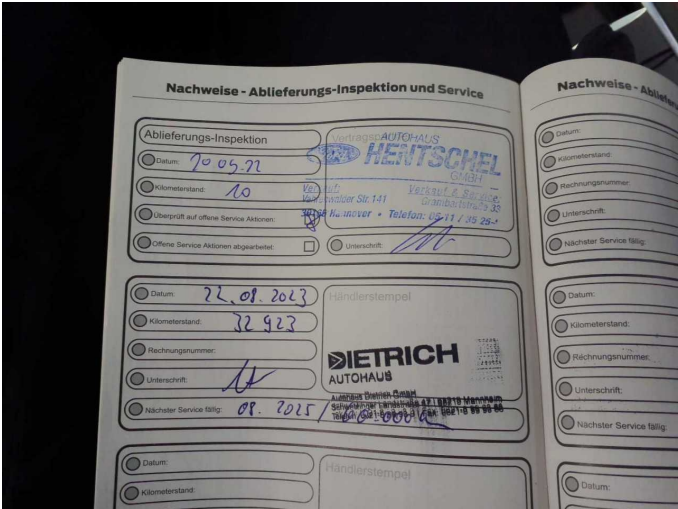


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

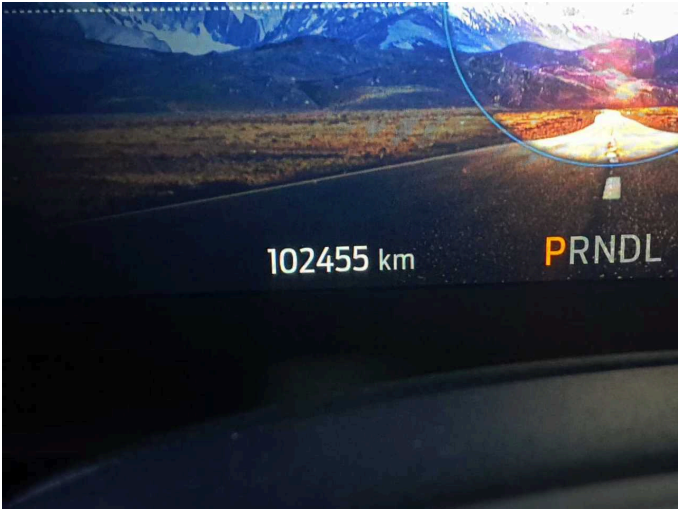


Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.

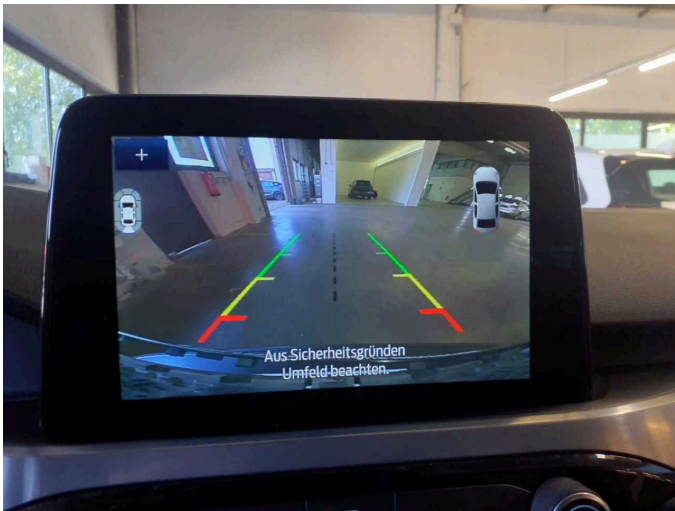


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

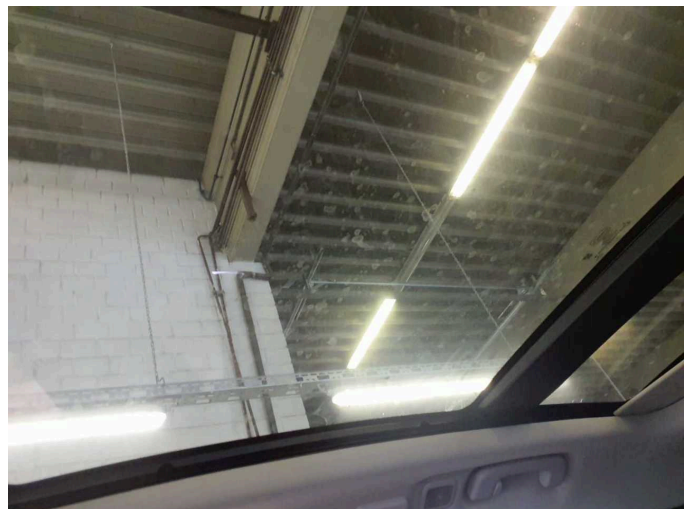


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.





Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

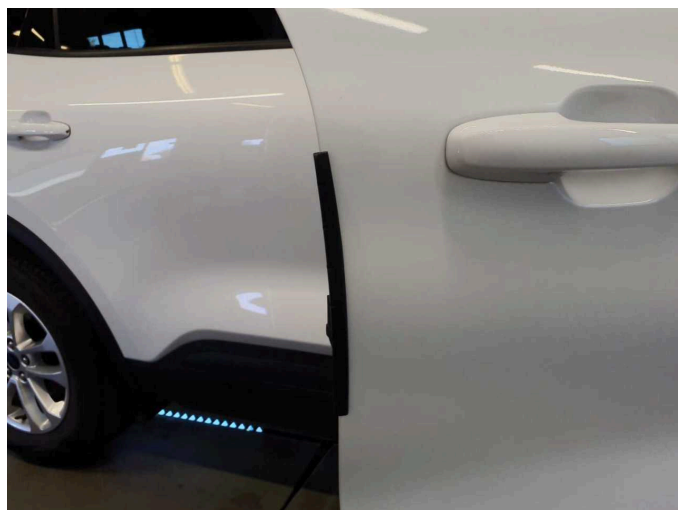


Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.





**Figure 37:** Misc.



**Figure 38:** Misc.



**Damage 1:** Front bumper: Cap (Grill) - Missing - Replace



**Damage 1:** Front bumper: Cap (Grill) - Missing - Replace



**Damage 2:** Wing mirror - right side: Cap - Scratch(es) - Smart repair



**Damage 2:** Wing mirror - right side: Cap - Scratch(es) - Smart repair






**Damage 3:** Door - front left side: Door - dent(s) - Smart repair




**Damage 3:** Door - front left side: Door - dent(s) - Smart repair

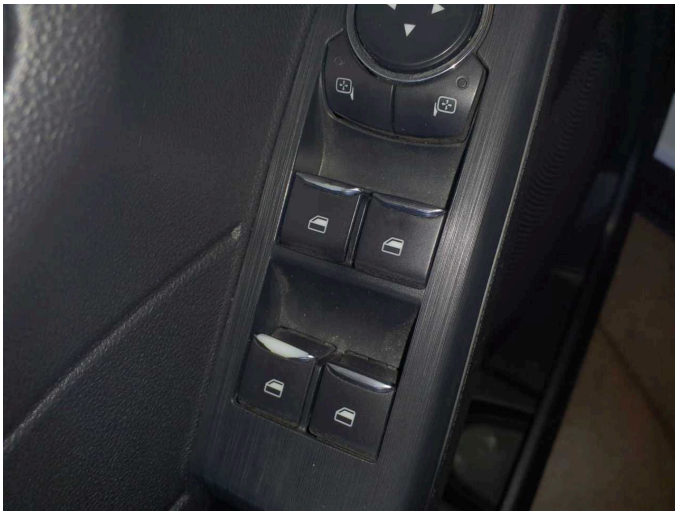


**Damage 4:** Door - front left side: Window regulator - Broken / torn - Replace




**Damage 4:** Door - front left side: Window regulator - Broken / torn - Replace

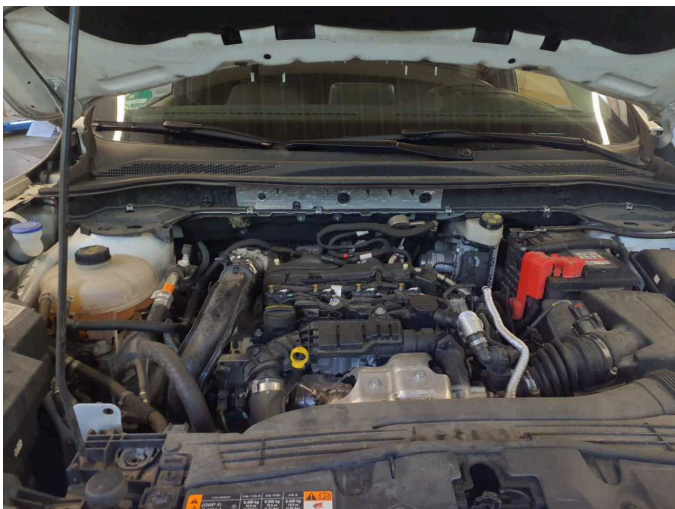

**Damage 5:** Engine: Engine cover - top / cover (+maderschaden, Folgekosten sind möglich) - Damaged - Replace

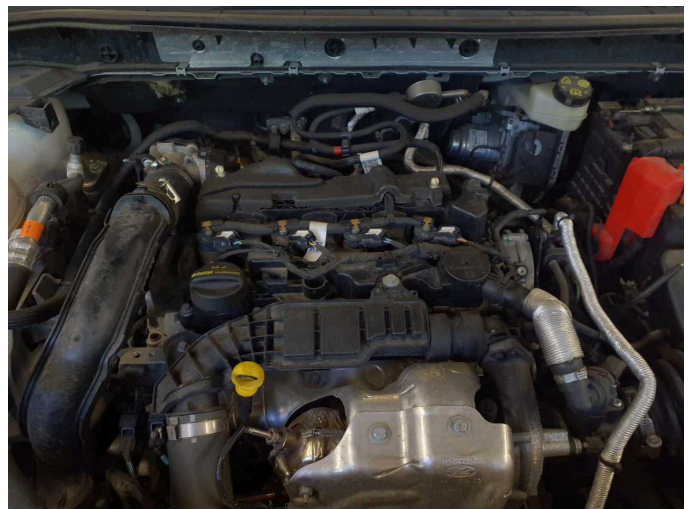

**Damage 5:** Engine: Engine cover - top / cover (+maderschaden, Folgekosten sind möglich) - Damaged - Replace

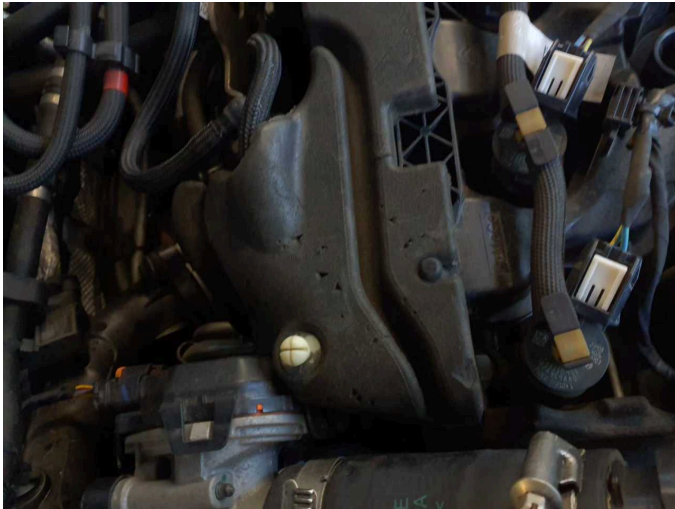

**Damage 5:** Engine: Engine cover - top / cover (+maderschaden, Folgekosten sind möglich) - Damaged - Replace




**Damage 5:** Engine: Engine cover - top / cover (+maderschaden, Folgekosten sind möglich) - Damaged - Replace



**Damage 5:** Engine: Engine cover - top / cover (+maderschaden, Folgekosten sind möglich) - Damaged - Replace



**Damage 6:** Bonnet: Bonnet - Scratch(es) - Paint

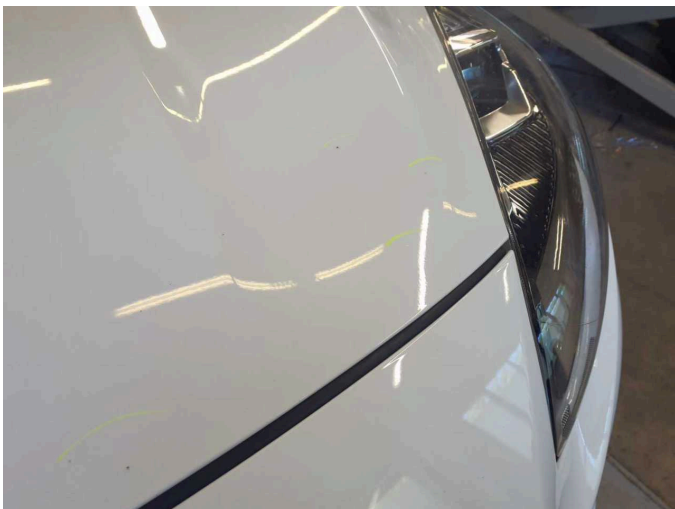

**Damage 6:** Bonnet: Bonnet - Scratch(es) - Paint



**Damage 6:** Bonnet: Bonnet - Scratch(es) - Paint





# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0FXXWPMFJ41370

Hersteller / Modell: FORD FORD Kuga 1.5 EcoBlue Aut. TITANIUM X

Datum	KM-Stand	Beschreibung
24.07.2025	101.942	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.09.2024	71.152	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst
22.08.2023	32.923	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges