



FORD Kuga

Kuga 2.5 Duratec PHEV

VIN NO WF0FXXWPMHLE30518
Registration Number PMHLE30518



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2026-06-01	1	2	75886 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-07-18	60437	2021-05-12	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250926120413
Inspection Date / Place	2025-09-26 / ARS Altmann AG Riedstadt	Cosmetic Grade	3

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Plug - in Hybrid Electric Vehicle Petrol	Road Worthy	Yes
Colour	Grey	Engine Size (cc)	2488
Engine Size	2.5	No of Doors	5
Body Type	SUV	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Synthetic Leather
Charging Cables	OUC + Type 2	WLTP CO2 Emissions	
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Computer Print Out Available	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





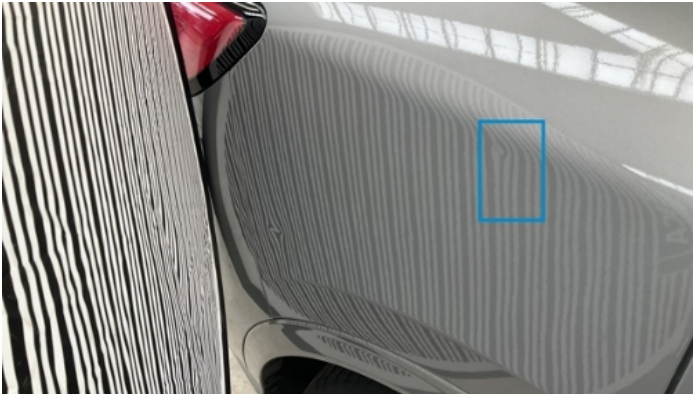

Equipment

Tinted Glass	USB Socket	Alloys wheels	Bluetooth telephone interface
Digitaldashboard	Head up Display	Remote central locking	Satellite navigation
Electrically folding wing mirrors	Leather steering wheel	Radio	Trip Computer
Airbag Status	Anti-lock braking	Cruise control	Front parking sensors
Remote adjusting wing mirrors	Reversing Camera	Stability control	Electrictailgate
LED Headlamps	Rear parking sensors		

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	18
Extra Wheel / Tyre Set	Winter Tyres - Alloy	Seat Heating	Front

Wheels & Tyres

Extra Wheel - 1 Tyre Depth	5	Extra Wheel - 2 Tyre Depth	5
Extra Wheel - 3 Tyre Depth	5	Extra Wheel - 4 Tyre Depth	5
Right Front Tyre Depth	4	Left Front Tyre Depth	4
Right Rear Tyre Depth	4	Left Rear Tyre Depth	4

Cosmetic Damage


7 Schäden

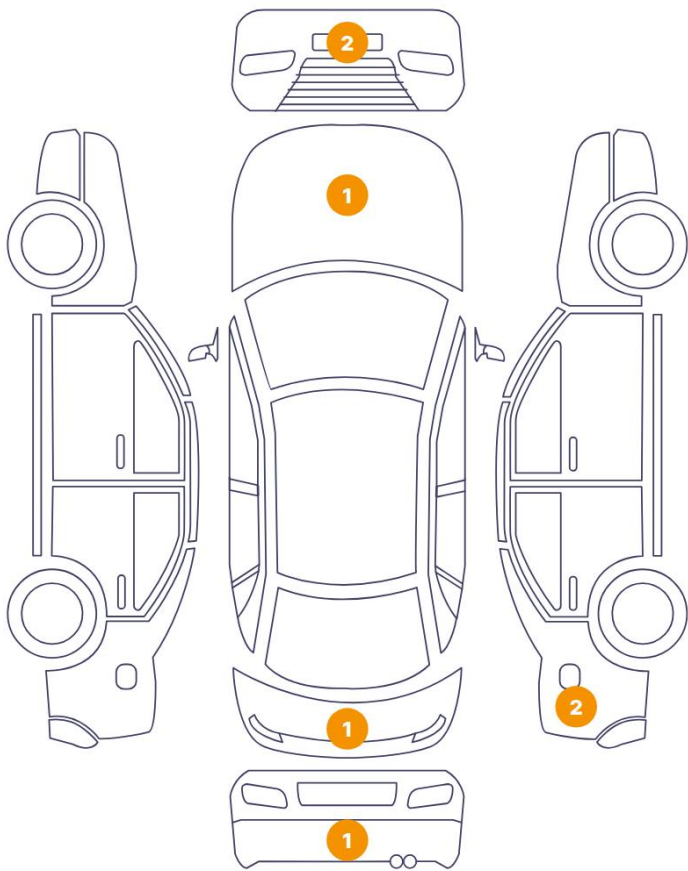

0 Schäden



Component	Damage	Comments
1 Hood	Paint / Stone Chip	
2 Bumper / Front	Paint / Scratch / Scuff	
3 Bumper / Front	Paint / Scratch / Scuff	
4 Bumper / Back	Paint / Scratch / Scuff	
5 Rear Window / Back	Glass Break / Scratch / Scratch	
6 Fender / Back Right	Bodywork / Dent / Dent	
7 Fender / Back Right	Bodywork / Dent / Dent	

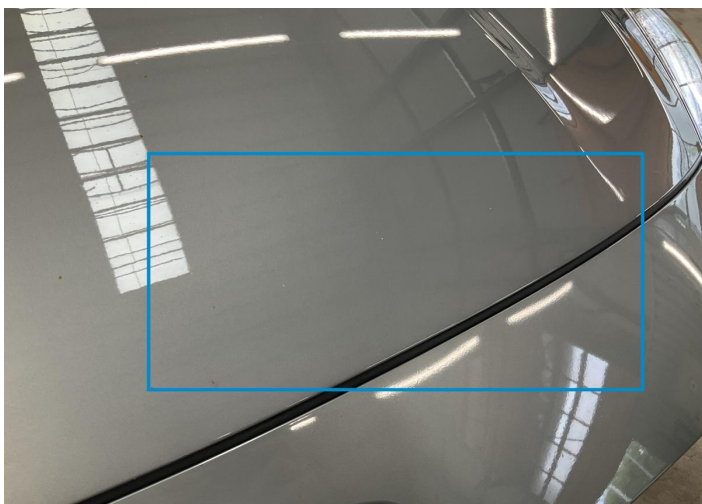

1. Hood
Paint / Stone Chip -




2. Bumper / Front
Paint / Scratch / Scuff -




3. Bumper / Front
Paint / Scratch / Scuff -




4. Bumper / Back
Paint / Scratch / Scuff -

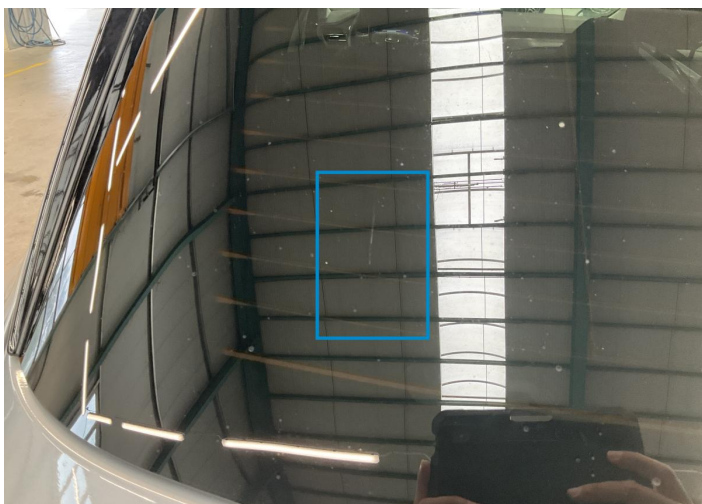

5. Rear Window / Back
Glass Break / Scratch / Scratch -

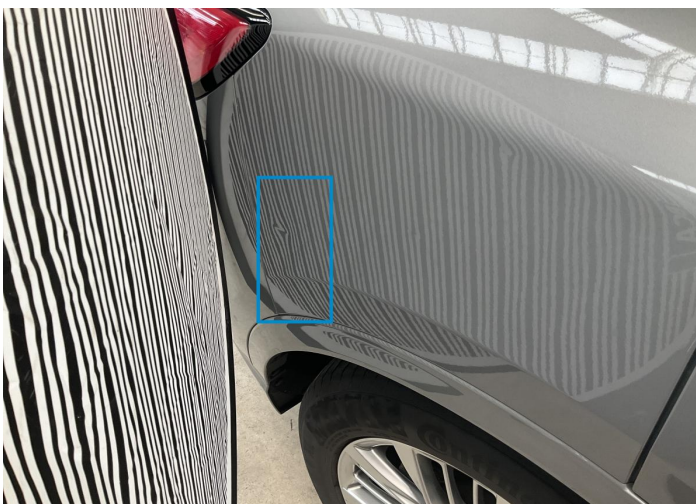

6. Fender / Back Right
Bodywork / Dent / Dent -

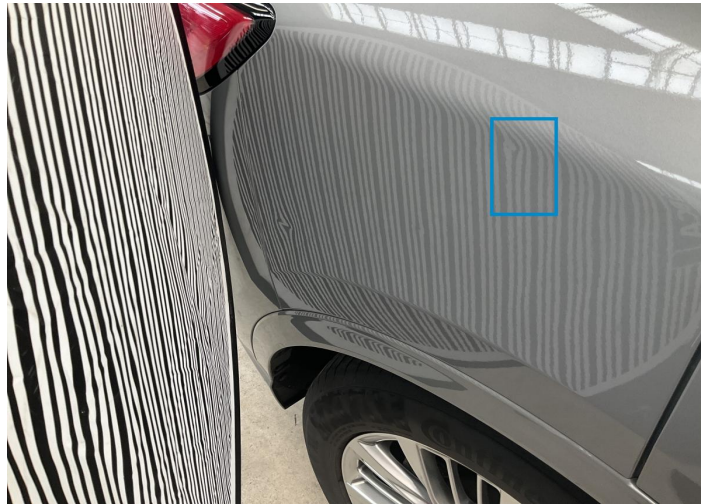

7. Fender / Back Right
Bodywork / Dent / Dent -

Mechanical Condition

Engine

Engine Starts	✓	Engine Status / EML	✓
Engine Leak Visible	✓		

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	✓
Tire Pressure Monitoring System	✓		

Gearbox

Gear Box	✓
----------	---

Hybrid/EV

Hybrid System Fault	✓
---------------------	---

Equipments Test

Other Equipments	✓	Central Locking	✓
Main & Spare Keys Functioning	✓	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	AC / Heating System	✓

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Engine			
Engine Noise	✓	Fume Quantity	✓
Power Loss	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Brake			
Brake System Anomaly	✓		
Steering Wheel			
Steering Noise / Anomaly	✓		
General			
Test Driven Status	✓		
✓ <i>No troubles detected, good condition or correct tests, according to vehicle age and mileage</i>			
! <i>Damages or malfunction detected that requires repairs by the buyer</i>			
NA <i>Not applicable</i>			
☐ <i>Not tested</i>			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)