



FORD Mondeo

Mondeo Turnier 2.2 TDCi Aut.

VIN NO WF0GXXGBBGBT55217

Registration Number BBGBT55217



MOT Date

2026-08-01

Last Service



Number of Owners

3

Last Service Mileage



Number of Keys

2

First Registration Date

2011-09-27

Odometer Reading

302471 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250925111656
Inspection Date / Place	2025-09-30 / HARTMANN Compound-Professionals GmbH Dorfmark	Cosmetic Grade	3

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Road Worthy	Yes
Colour	Black	Engine Size (cc)	2179
Engine Size	2.2	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth/Synthetic Leather
Charging Cables		NEDC CO2 Rating (q/km)	173
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Missing	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





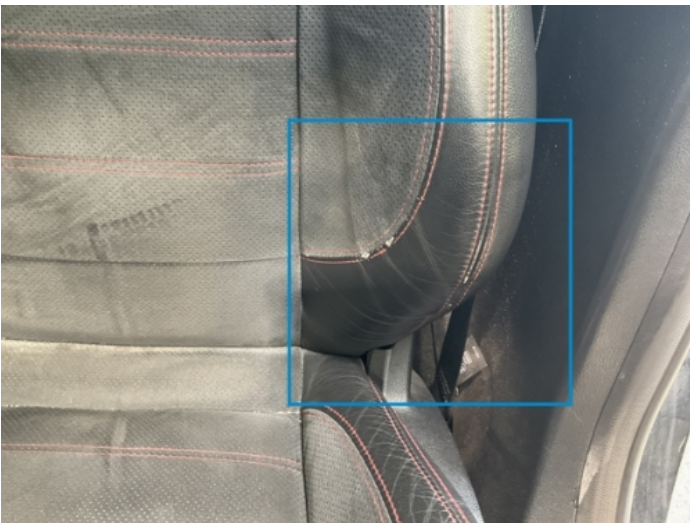

Equipment

Tinted Glass	Trip Computer	Alloys wheels	Bluetooth telephone interface
Front fog lamps	Headlamp wash/wipe	Remote adjusting wing mirrors	Roof rails
Stability control	CD Player	Electrically adjustable seats	Leather steering wheel
Rear parking sensors	Tow ball	Airbag Status	Anti-lock braking
Cruise control	Front parking sensors	Heated windscreen	Remote central locking
Satellite navigation	Xenon headlamps	Central locking	Electrically folding wing mirrors
Radio			

Equipment Details


Tow Ball Type	Static	Air Conditioning	Dual Zone Climate Control
Alloy Wheel Size	18	Extra Wheel / Tyre Set	Winter Tyres - Alloy
Seat Heating	Front		

Wheels & Tyres


Extra Wheel - 1 Tyre Depth	7	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	5	Extra Wheel - 4 Tyre Depth	4
Right Front Tyre Depth	2	Left Front Tyre Depth	2
Right Rear Tyre Depth	4	Left Rear Tyre Depth	4

Cosmetic Damage

19 Damages

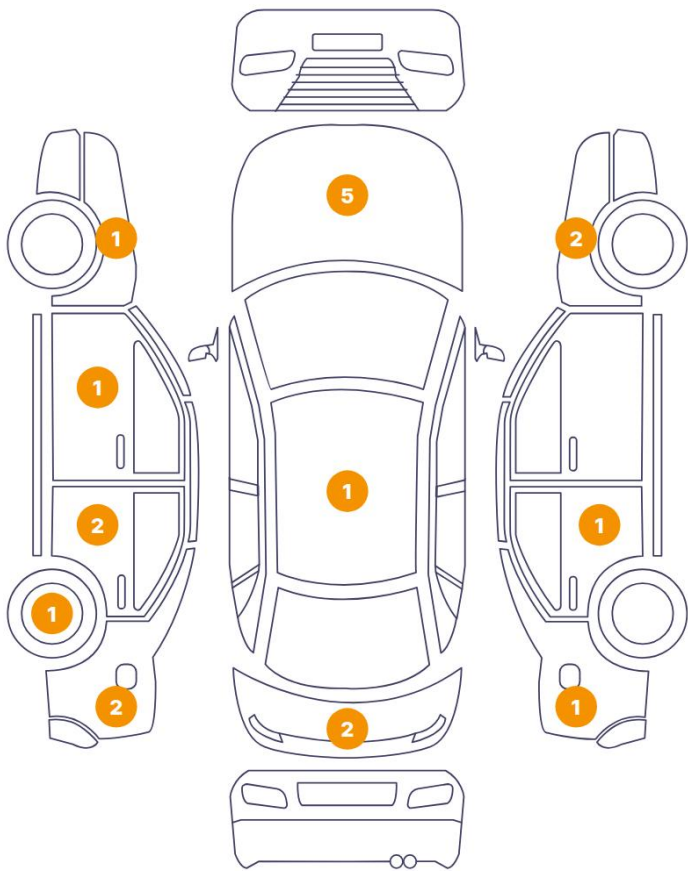

2 Damages

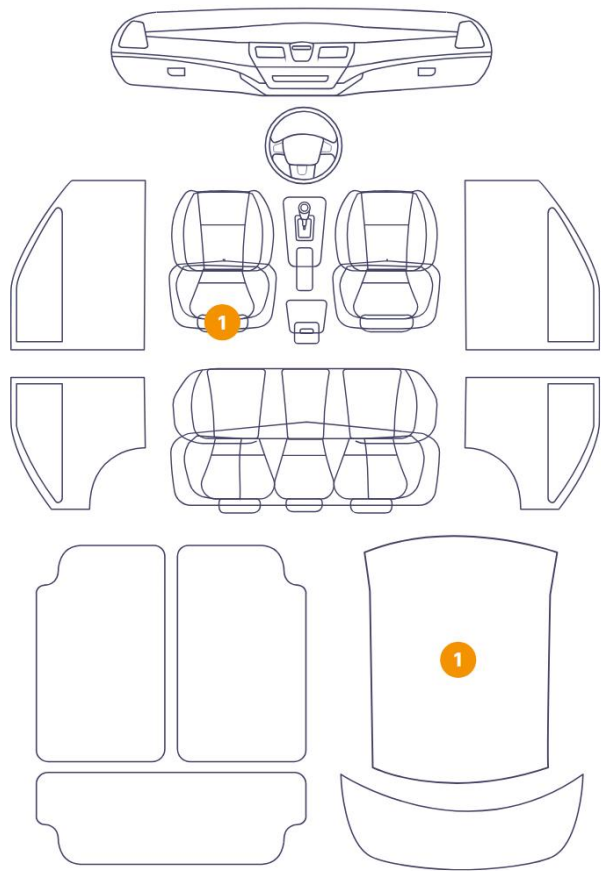

Component		Damage	Comments
1	Hood Scoop	Bodywork / Breakage / Crack	
2	Hood	Bodywork / Dent / Dent	
3	Hood	Paint / Chipping	
4	Hood	Paint / Chipping	
5	Hood	Bodywork / Dent / Dent	
6	Fender / Front Right	Bodywork / Dent / Dent	
7	Fender / Front Right	Paint / Scratch / Scuff	
8	Door / Back Right	Paint / Scratch / Scuff	
9	Fender / Back Right	Bodywork / Dent / Dent	
10	Monogram/Emblem / Back Center	Missing Part	
11	Tailgate	Paint / Scratch / Scuff	
12	Side Panel / Back Left	Bodywork / Dent / Dent	

13	Fender / Back Left	Paint / Scratch / Scuff
14	Rim / Back Left	Out of Bodywork / Scratch
15	Door / Back Left	Paint / Chipping
16	Door / Back Left	Paint / Scratch / Scuff
17	Door / Front Left	Paint / Scratch / Scuff
18	Fender / Front Left	Bodywork / Dent / Dent
19	Roof	Bodywork / Dent / Deformation
20	Roof Upholstery	Interior / Broken
21	Seat / Front Left	Interior / Stained



1. Hood Scoop
Bodywork / Breakage / Crack -




2. Hood
Bodywork / Dent / Dent -




3. Hood
Paint / Chipping -



4. Hood
Paint / Chipping -

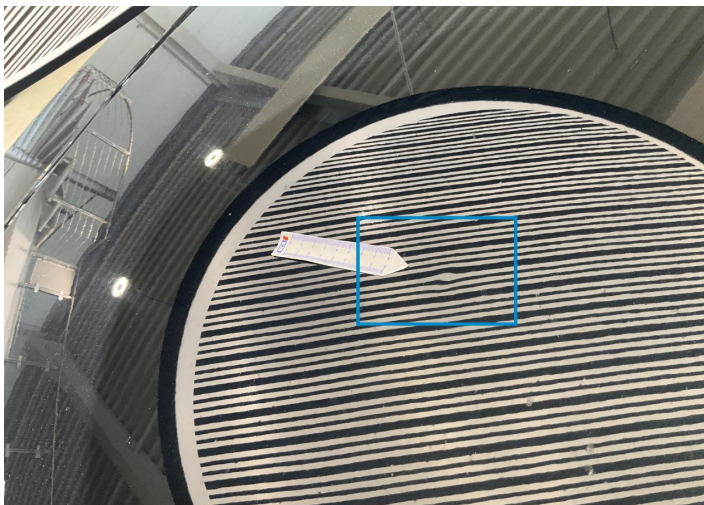

5. Hood
Bodywork / Dent / Dent -

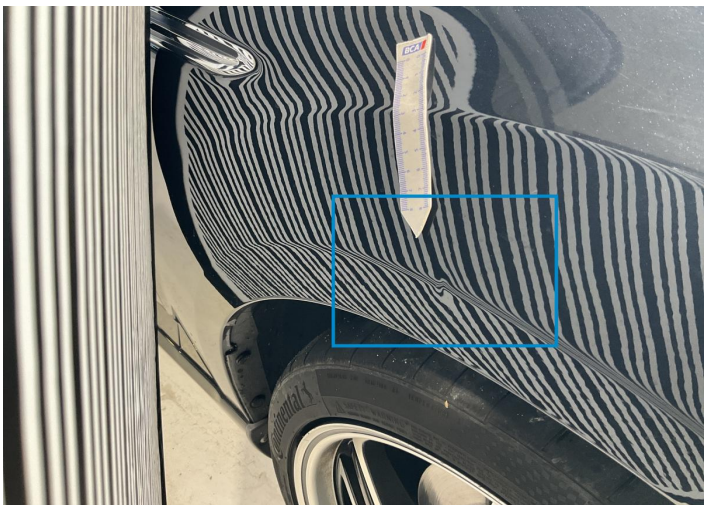


6. Fender / Front Right
Bodywork / Dent / Dent -



7. Fender / Front Right
Paint / Scratch / Scuff -



8. Door / Back Right
Paint / Scratch / Scuff -

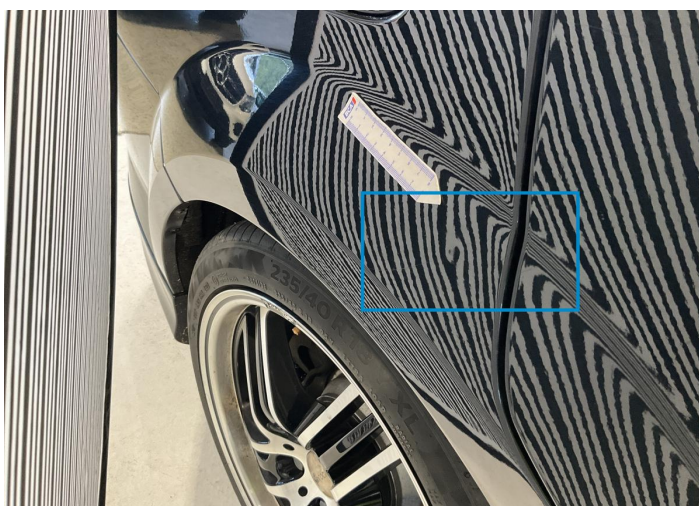


9. Fender / Back Right
Bodywork / Dent / Dent -



10. Monogram/Emblem / Back Center
Missing Part -



11. Tailgate
Paint / Scratch / Scuff -

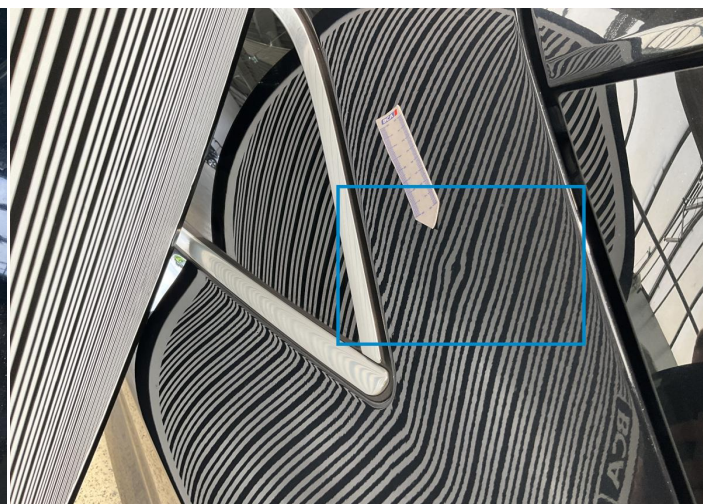

12. Side Panel / Back Left
Bodywork / Dent / Dent -



13. Fender / Back Left
Paint / Scratch / Scuff -



14. Rim / Back Left
Out of Bodywork / Scratch -




15. Door / Back Left
Paint / Chipping -




16. Door / Back Left
Paint / Scratch / Scuff -



17. Door / Front Left
Paint / Scratch / Scuff -

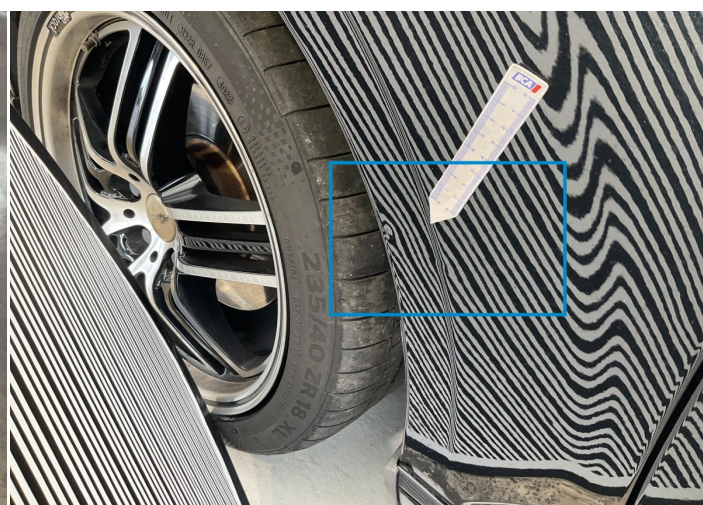

18. Fender / Front Left
Bodywork / Dent / Dent -

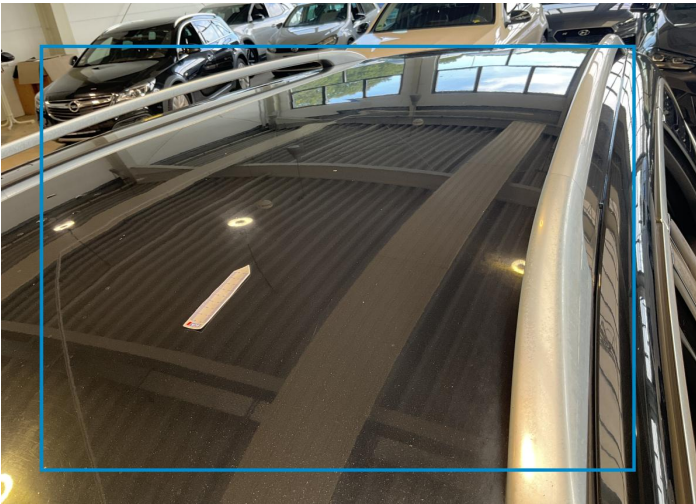

19. Roof
Bodywork / Dent / Deformation -



20. Roof Upholstery
Interior / Broken -



21. Seat / Front Left
Interior / Stained -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Alternator / Battery	✓
No Dashboard Lights	✓	Display Defect	✓
Service Light	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Navigation System	✓
Audio Equipment	✓	Parking Sensors / Cameras Functioning	✓
Other Equipments	✓		

Test Drive Inspection

Engine			
Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓
Brake			
Brake System Anomaly	✓		
Steering Wheel			
Steering Noise / Anomaly	!		
General			
Test Driven Status	✓		
✓ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
☐ Not tested			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)