



Expertise

Protocol number: 41584460
Order No. / Reference: 25144703
Inspection date: 17 Sept 2025

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue Aut. TREND

VIN: WF0JXXWPCJNU62962



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford S-Max 2.0 EcoBlue Aut. TREND	
Vehicle Identification number	WF0JXXWPCJNU62962
Mileage (Read)	112,245 km
First registration	10 Aug 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report not on hand)	
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Polar-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Re/Import	no
Vehicle with smoke odor	no
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	27,000 km
Last maintenance on / at	07/2025 at 109,565 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GK834306
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	8566 / BKM 01249		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,555 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 99H	Winter tyres on Steel	Pirelli	5mm / 5mm
2)	235/55 R17 99H	Winter tyres on Steel	Pirelli	6mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Storage compartments (glove compartment, illuminated map pockets on driver and passenger seat backrests)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated indicators and ambient lighting and electrically folding)
- Attachment points for safety partition grilles (attachment points for the 2nd row of seats)
- Hill start assist
- Overhead console (with glasses storage compartment and fold-out additional mirror for eye contact with rear passengers)
- Driver information system display 10.7cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Parking brake, electronic
- Ford EasyFold: Second row seat backrests can be electrically folded at the touch of a button
- Ford Power start function (keyless starting)
- Luggage compartment cover (removable)
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission (with manual shift option)
- Rear window wiper
- Interior mirror, automatically dimming
- Isofix mount (on all 2nd row seats)
- Electric child safety lock
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Steering wheel: Steering column, adjustable in height and reach
- Steering wheel: multifunction leather steering wheel
- Front center console with padded armrest (storage compartment and 2 cup holders)
- Fog light
- Emergency brake light (pulsating brake lights during heavy braking)
- Parking pilot system front and rear
- Upholstery: Cloth
- Tire repair kit (max. 80 km/h permitted when used)
- Tire pressure monitoring system (TPMS)
- Taillights with LED technology
- Windscreen wipers with rain sensor
- Low beam headlights with switch-off delay including "welcome function"
- Headlight assistant with day/night sensor
- Electromechanical power steering (EPAS (Electric Power Assisted Steering))
- Seats: Driver and passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Rollover Protection (RSC) and Traction Control (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (10-spoke design)
- Brake light, third
- Diesel particulate filter (DPF)
- tachometer
- Electronic Shifter
- Electric front and rear windows (with anti-pinch protection and automatic opening and closing function)
- High beam assistant
- Ford Easy Fuel (The Ford Easy Fuel convenient refueling system eliminates the need for a separate internal fuel cap and prevents misfueling by recognizing the size difference between petrol and diesel fuel nozzles. This ensures that the filler neck opens only when the correct fuel is used.)
- Cruise control with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- Back window, heater
- Interior lighting with delay circuit
- Intelligent Safety System (IPS Intelligent Protection System: - Front headrests, 4-way height and tilt adjustable - Front airbag for driver and front passenger - Driver knee airbag - Curtain airbags, front and for 2nd row - Side airbag for driver and front passenger - Side airbag for outer rear seats of the 2nd row - Seatbelt pretensioners and belt force limiters, front - 3-point seatbelts on all seats, height adjustable in the front)
- Reading lights front and rear (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: - Limitation of maximum speed and radio volume (to max. volume 15 of 32) - Speed warning (when the set speed limit is exceeded) - Safety assistance systems cannot be deactivated - Advanced warning system for unfastened seat belts)
- Radio equipment: Ford SYNC 3 with AppLink, touchscreen, DAB/ DAB+, and FordPass Connect (communication and entertainment system with voice control, support for Android Auto and Apple CarPlay, Bluetooth hands-free system and audio streaming, 14 different languages, graphic and acoustic, eCall emergency call system for sending an emergency call in the event of an accident or manual operation, live traffic information, Wi-Fi hotspot, radio-CD player, 2 USB ports, 8 speakers, and steering wheel remote control, 20.3 cm screen diagonal, digital radio reception DAB/DAB+)
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row with 3 individual seats - longitudinally adjustable - seat backrests with adjustable tilt and individually foldable - retractable headrests)



- Seats: Front sports seats (with increased lateral support)
- Start-stop system
- Power socket: 12-volt connection in the luggage compartment and center console
- Daytime running light
- Traffic sign recognition system
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control (remote luggage compartment unlocking - second folding vehicle key)

- Bumpers painted in body color
- Premium carpet floor mats front and rear (and in the 3rd row of seats if ordered as an option)
- Unfastened seat belt warning system for the 1st and 2nd rows (and the 3rd row if ordered as an option)

Extra equipment

- Removable trailer hitch (including ESP trailer stabilization)
- Paint finish: metallic
- Package: Business II (Ford navigation system including Ford SYNC 3, AppLink, 20.3 cm touchscreen, DAB/DAB+ voice control, Android Auto and Apple CarPlay, Bluetooth hands-free system and audio streaming, FordPass Connect, eCall emergency call system, radio-CD player, 2 USB ports, 8 speakers, steering wheel remote control, adaptive LED headlights, cornering lights, automatic headlight range control, headlight assistant, day/night sensor, high beam assistant, LED daytime running lights, anti-theft alarm, rear view camera)
- trunk tray
- Rear leveling, automatic
- Package: Winter (heated windscreen - heated leather steering wheel - individually and variably heated front seats)
- Side windows from 2nd row and rear window, dark tinted
- Safety partition grille, attached behind front seats
- Seats: Ford ergonomic seat (driver and front passenger seat 18-way adjustable: - length, height and angle of the seat - extendable thigh support - adjustable backrest - 4-way electrically adjustable lumbar support)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Instrument panel	Centre console - rear - Scratch(es) - Loss in value
2	Roof	Roof - dent(s) - Smart repair
3	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
4	Front bumper	Spoiler - Scratched - Paint
5	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Paint
6	Side panel - rear right side	Side panel - Dent / paintcoat damage - Paint
7	Door - rear right side	Door (Farbunterschied + Lackverlauf) - Unprofessionally repaired - Paint

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Body	Body - Stone chips - No deduction



No.	Component group	Description
3	Body	Body - Scratch(es) - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 22 Apr 2025	869,28 €
2	Rear, Provided by user / customer, from 27 May 2025	1.352,34 €
3	Front, Provided by user / customer, from 10 Aug 2024	4.231,28 €

Repainting

No.	Repainting
1	Door - rear right side, Unprofessionally carried out

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

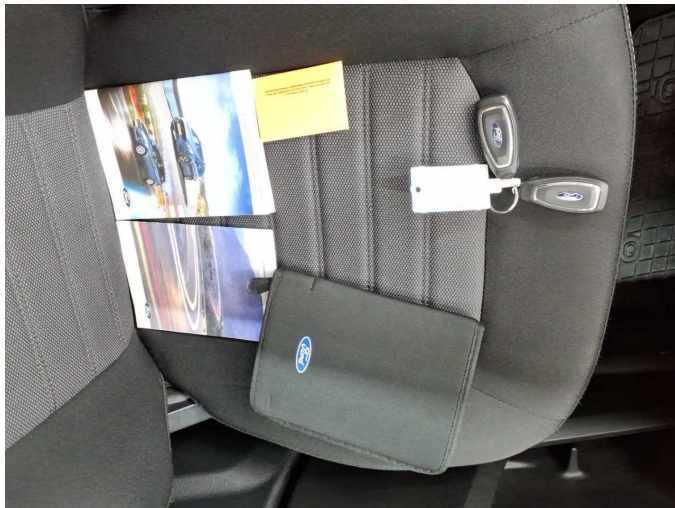


Figure 13: Documents

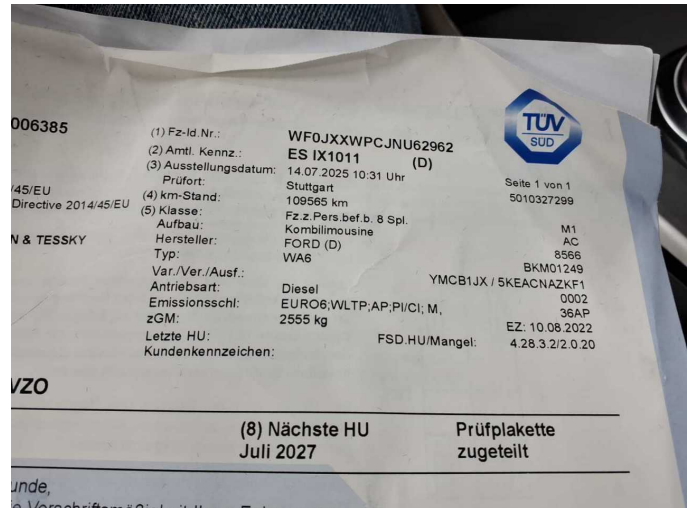


Figure 14: Documents

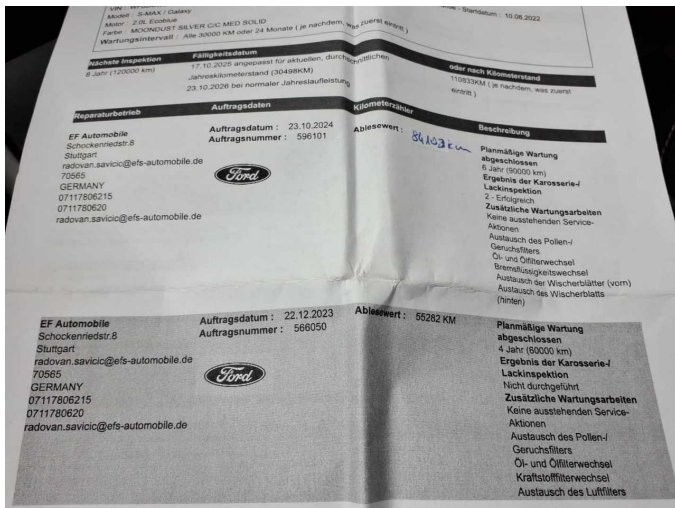


Figure 15: Documents

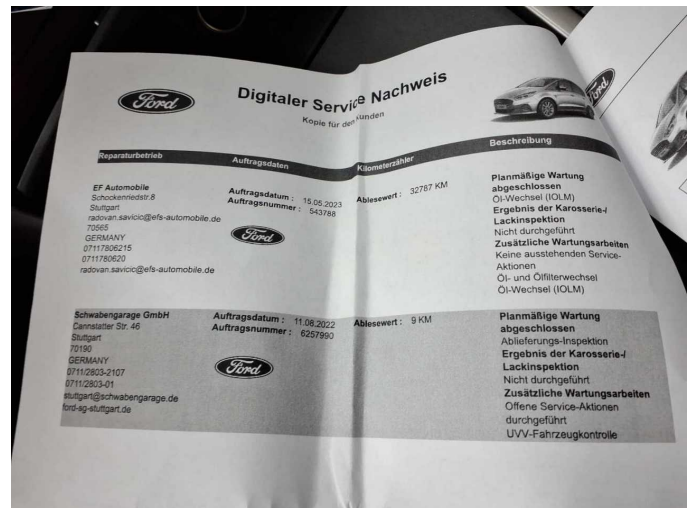


Figure 16: Documents

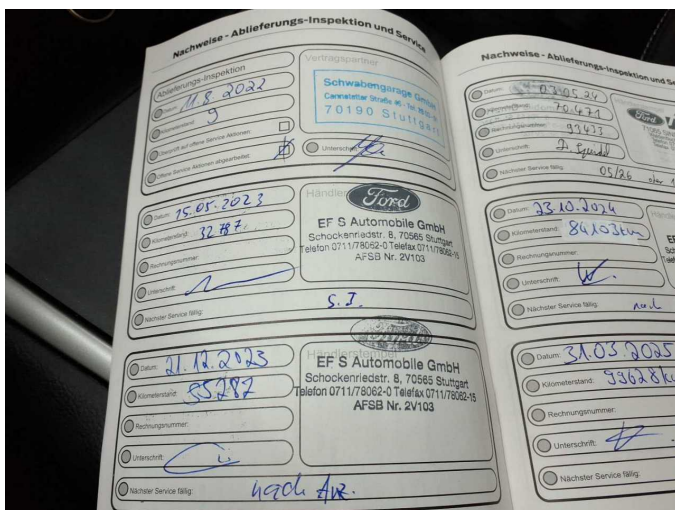


Figure 17: Documents

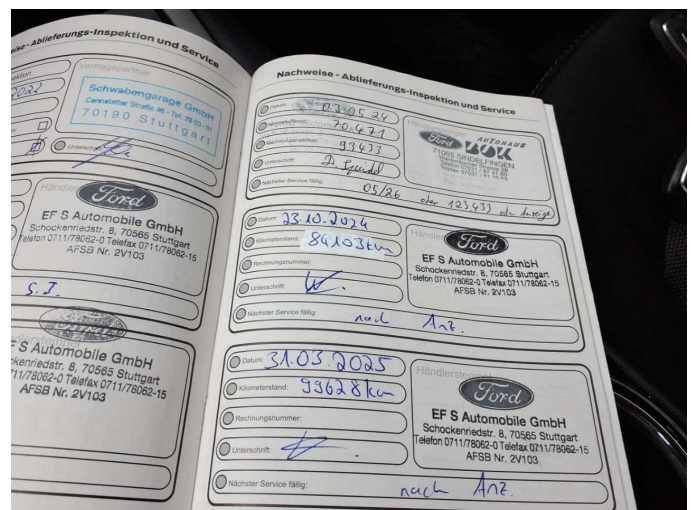


Figure 18: Documents

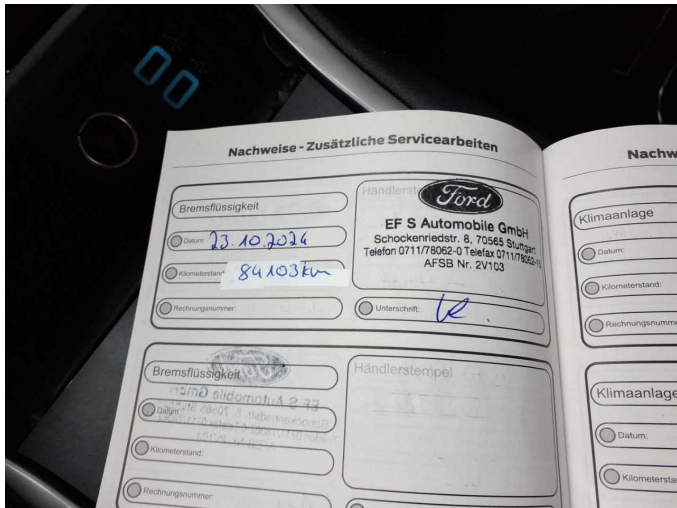


Figure 19: Documents



Figure 20: Documents



Figure 21: Additional tyres

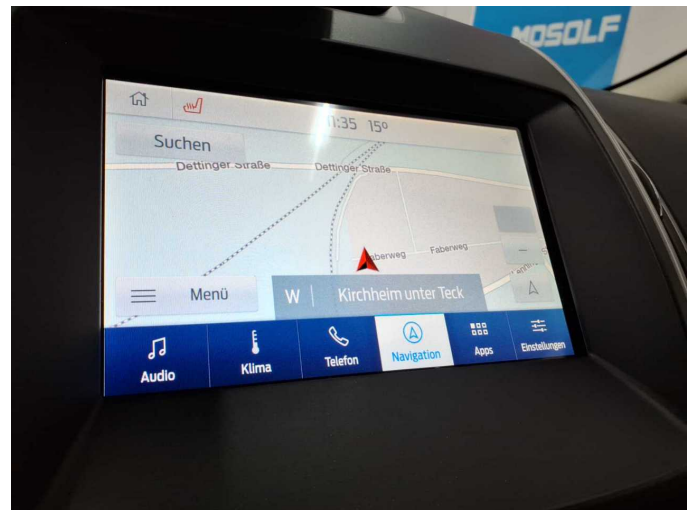


Figure 22: Navigation



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

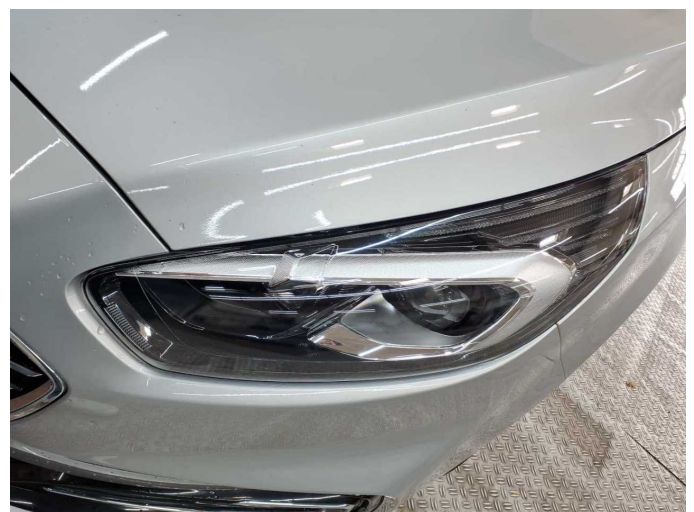


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Damage 1: Instrument panel: Centre console - rear - Scratch(es) - Loss in value



Damage 1: Instrument panel: Centre console - rear - Scratch(es) - Loss in value



Damage 1: Instrument panel: Centre console - rear - Scratch(es) - Loss in value



Damage 2: Roof: Roof - dent(s) - Smart repair



Damage 2: Roof: Roof - dent(s) - Smart repair



Damage 3: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 3: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 4: Front bumper: Spoiler - Scratched - Paint



Damage 4: Front bumper: Spoiler - Scratched - Paint



Damage 4: Front bumper: Spoiler - Scratched - Paint




Damage 5: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Paint



Damage 5: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Paint



Damage 5: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Paint

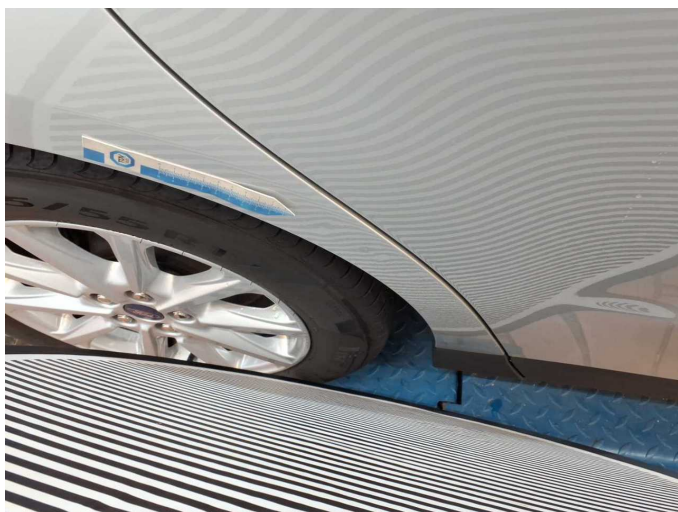


Damage 6: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint



Damage 6: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint




Damage 6: Side panel - rear right side: Side panel - Dent / paintcoat damage - Paint

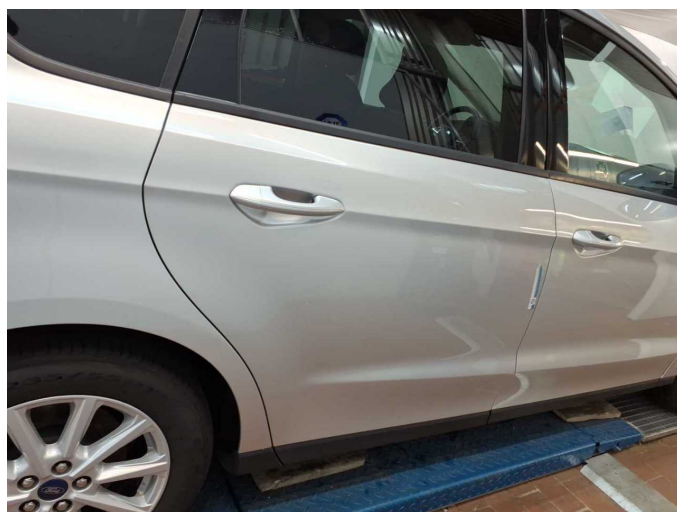

Damage 7: Door - rear right side: Door (Farbunterschied + Lackverlauf) - Unprofessionally repaired - Paint



Damage 7: Door - rear right side: Door (Farbunterschied + Lackverlauf) - Unprofessionally repaired - Paint

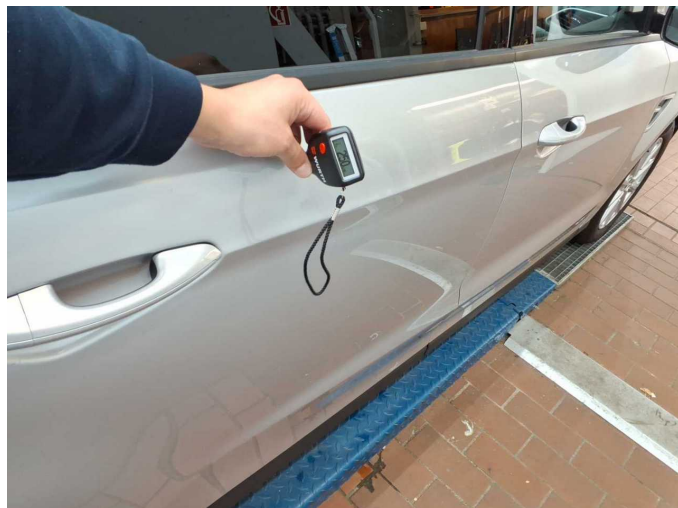

Repainting 1: Door - rear right side



Repainting 1: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0JXXWPCJNU62962
Hersteller / Modell: FORD FORD S-Max 2.0 EcoBlue Aut. TREND

Datum	KM-Stand	Beschreibung
16.07.2025	109.565	AU
31.03.2025	99.628	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.01.2025	91.356	Batterie ern; Systemtest/Eigendiagnose
22.10.2024	84.103	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.05.2024	70.471	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.02.2024	61.337	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
27.12.2023	55.282	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.05.2023	32.787	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges