




FORD Galaxy Galaxy 2.0 TDCi

VIN NO WF0KXXWPCKGY68729


Registration Number PCKGY68729



MOT Date

 2026-02-01

Last Service

 2022-10-20

Number of Owners

 1


Last Service Mileage

 43902


Number of Keys

 2


First Registration Date

 2016-11-15

Odometer Reading

 62609 km

Country First Registered

 Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250926083356
Inspection Date / Place	2025-09-26 / BCA Neuss	Cosmetic Grade	4


Vehicle Summary



Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Road Worthy	Yes
Colour	White	Engine Size (cc)	1998
Engine Size	2.0	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	7
Seat Covering Name	schwarz	Seat Covering	Leather
Charging Cables		NEDC CO2 Rating (q/km)	129
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	Missing	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			



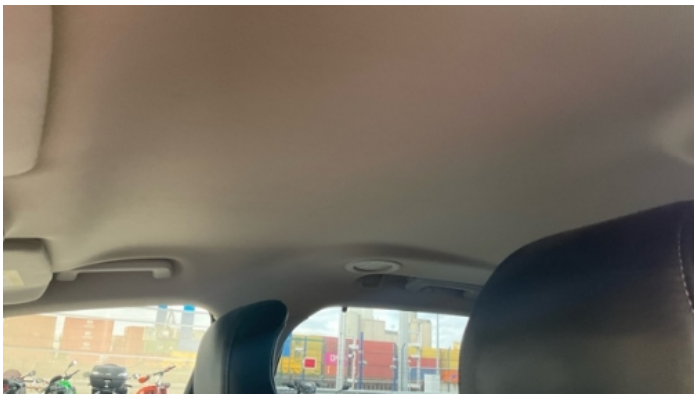

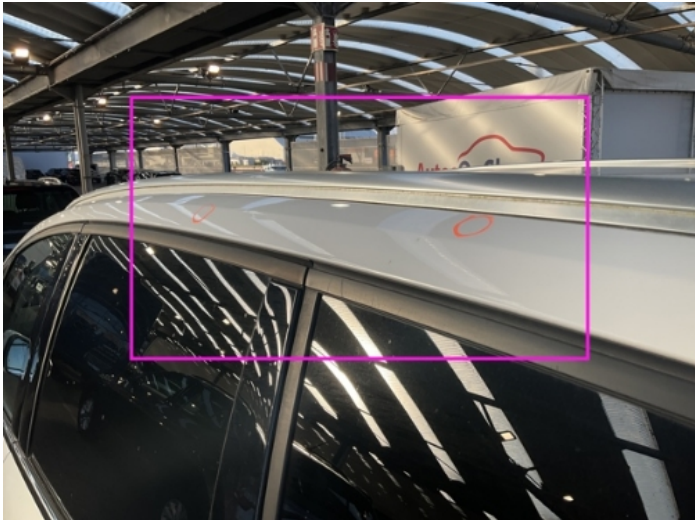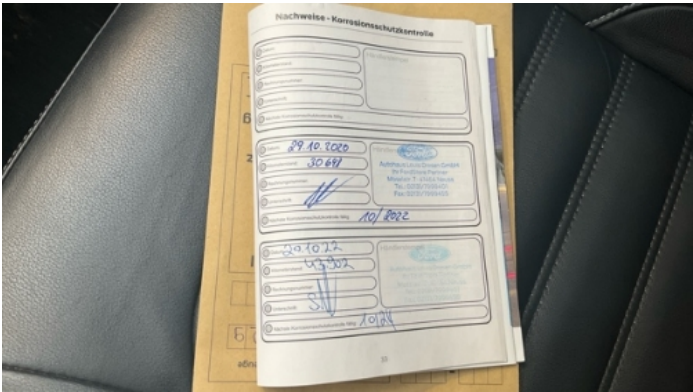

Equipment

Tinted Glass	Airbag Status	Anti-lock braking	Cruise control
Front parking sensors	Remote central locking	Satellite navigation	Electrically adjustable seats
Electric tailgate	LED Headlamps	Rear parking sensors	USB Socket
Alloys wheels	Bluetooth telephone interface	Diesel particulate filter	Remote adjusting wing mirrors
Roof rails	Stability control	Electrically folding wing mirrors	Leather steering wheel

Radio

Equipment Details


Air Conditioning	Yes	Alloy Wheel Size	17
Seat Heating	Front		

Wheels & Tyres


Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	6	Extra Wheel - 4 Tyre Depth	6
Right Front Tyre Depth	7	Left Front Tyre Depth	7
Right Rear Tyre Depth	7	Left Rear Tyre Depth	7

Cosmetic Damage

18 Schäden

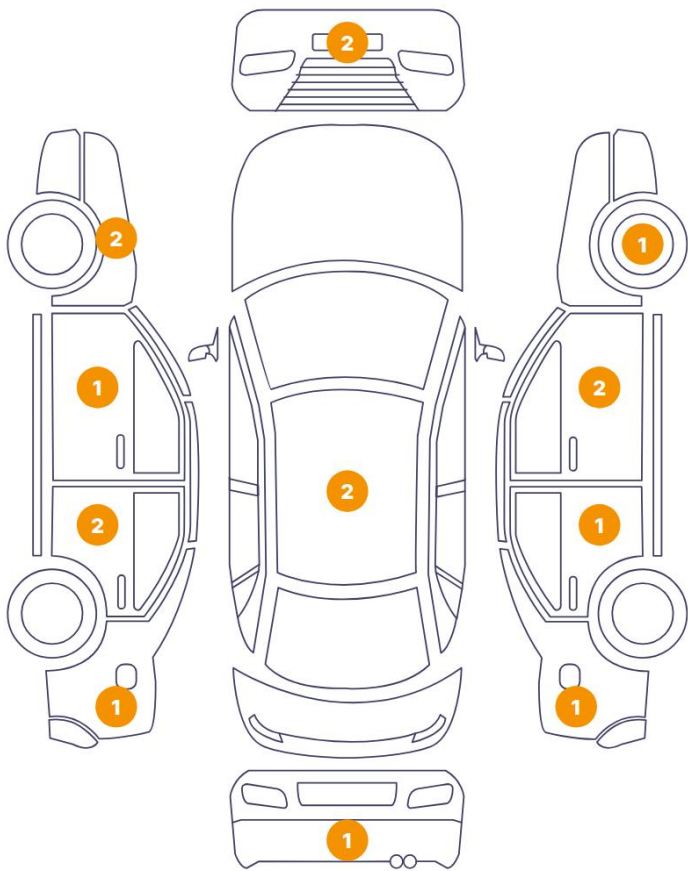


0 Schäden

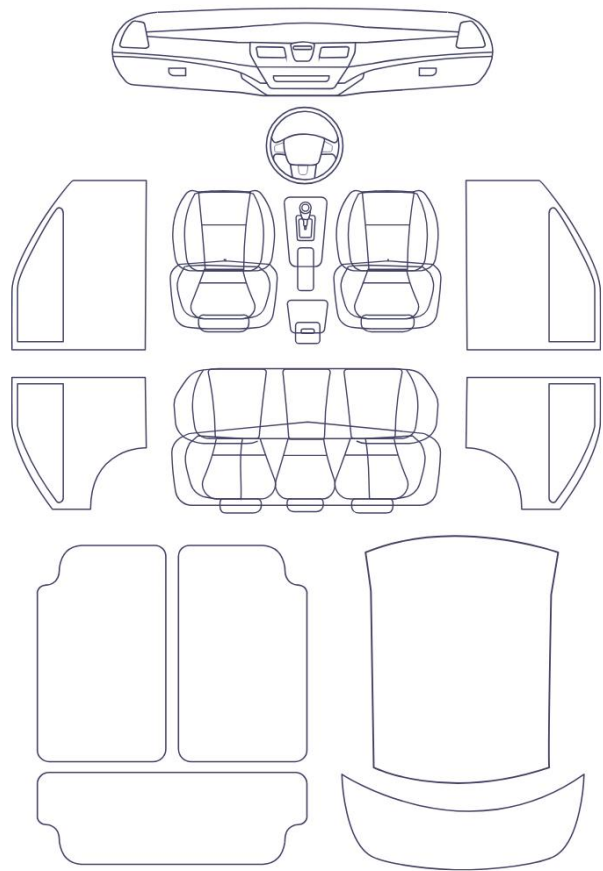


Component		Damage	Comments
1	Wing Expander / Front Left	Paint / Poor Previous Repair	
2	Bumper / Front	Paint / Scratch / Scuff	
3	Bumper / Front	Paint / Scratch / Scuff	
4	Wing Expander / Front Left	Paint / Scratch / Scuff	
5	Door / Front Left	Paint / Scratch / Scuff	
6	Door / Back Left	Paint / Scratch / Scuff	
7	Pillar / Back Left	Bodywork / Dent / Dent	
8	Side Panel / Back Left	Paint / Scratch / Scuff	
9	Side Panel / Back Right	Bodywork / Dent / Dent	
10	Door / Back Right	Paint / Scratch / Scuff	
11	Door / Front Right	Paint / Scratch / Scuff	
12	Mirror Shell / Front Right	Paint / Scratch / Scuff	

13	Rim / Front Right	Out of Bodywork / Scratch
14	Bumper / Back	Paint / Scratch / Scuff
15	Roof	Bodywork / Dent / Dent
16	Roof	Bodywork / Dent / Dent

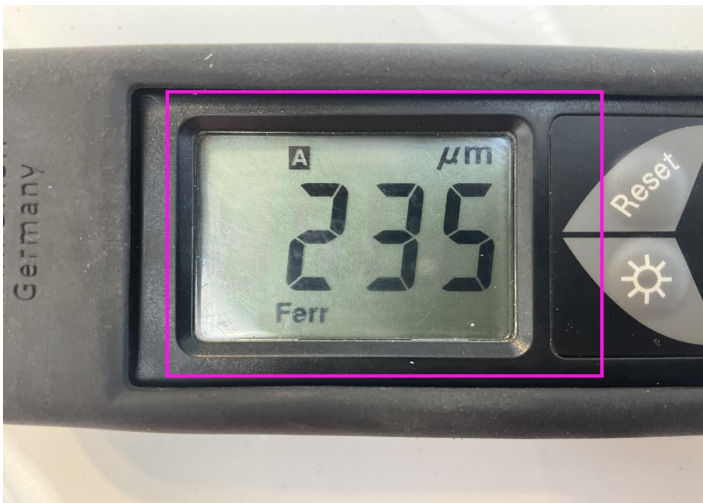

1. Wing Expander / Front Left
Paint / Poor Previous Repair -

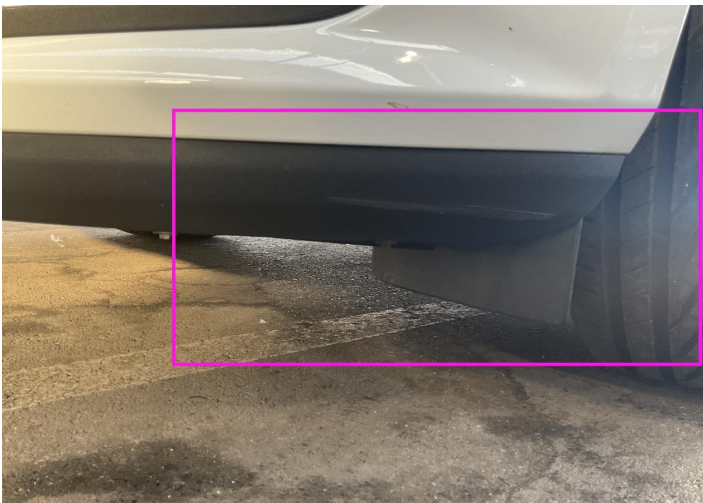

2. Bumper / Front
Paint / Scratch / Scuff -




3. Bumper / Front
Paint / Scratch / Scuff -



4. Wing Expander / Front Left
Paint / Scratch / Scuff -




5. Door / Front Left
Paint / Scratch / Scuff -

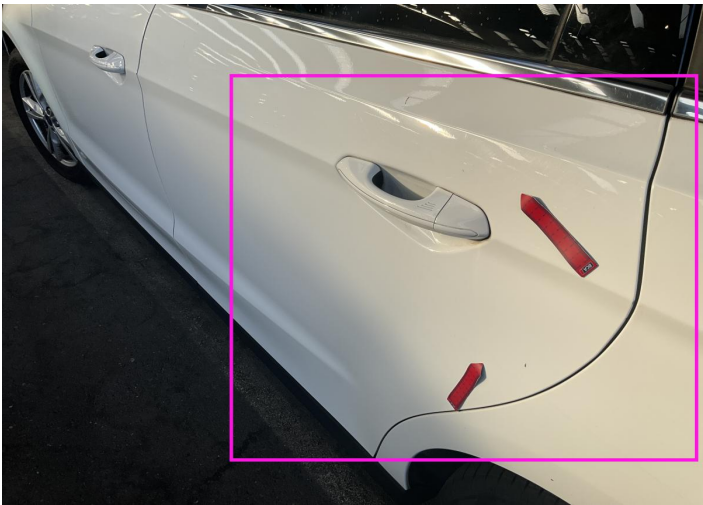

6. Door / Back Left
Paint / Scratch / Scuff -



7. Pillar / Back Left
Bodywork / Dent / Dent -

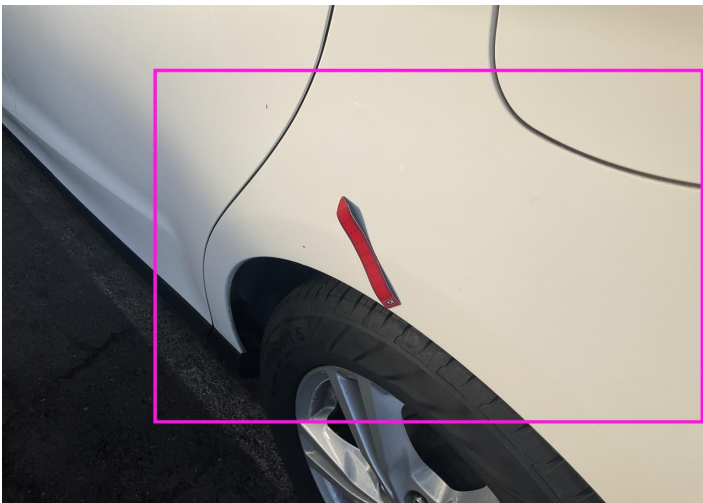

8. Side Panel / Back Left
Paint / Scratch / Scuff -



9. Side Panel / Back Right
Bodywork / Dent / Dent -



10. Door / Back Right
Paint / Scratch / Scuff -



11. Door / Front Right
Paint / Scratch / Scuff -




12. Mirror Shell / Front Right
Paint / Scratch / Scuff -




13. Rim / Front Right
Out of Bodywork / Scratch -



14. Bumper / Back
Paint / Scratch / Scuff -

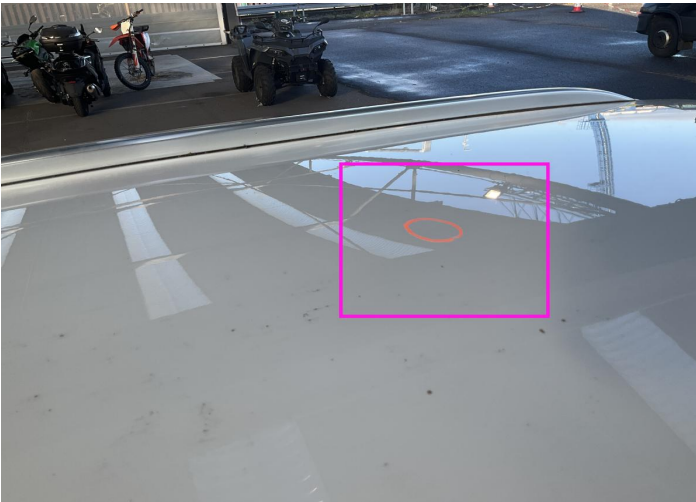

15. Roof
Bodywork / Dent / Dent -

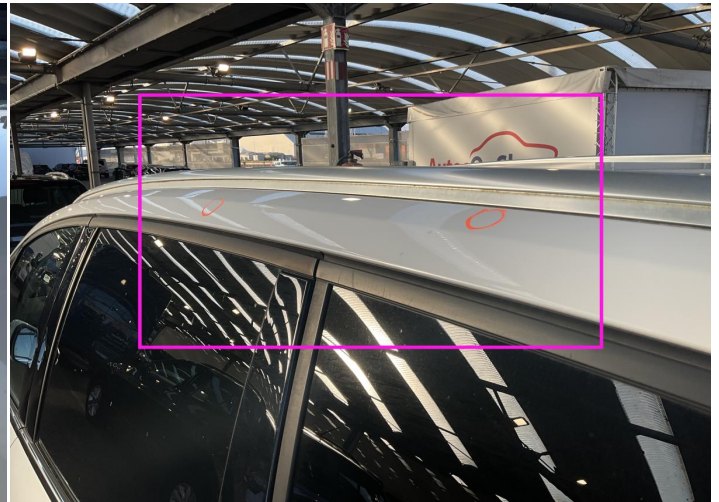

16. Roof
Bodywork / Dent / Dent -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Diesel Particulate Filter Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
No Dashboard Lights	✓	Display Defect	✓
Service Light	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Equipments Test

AC / Heating System	✓	Central Locking	✓
Main & Spare Keys Functioning	✓	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	Other Equipments	✓

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel			
Steering Noise / Anomaly	✓	Flywheel Noise	✓
Engine			
Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓
Brake			
Brake System Anomaly	✓		
Clutch			
Clutch Pedal Low / High	✓	Clutch Abnormal	✓
Clutch Functioning	✓		
General			
Test Driven Status	✓		
✓ <i>No troubles detected, good condition or correct tests, according to vehicle age and mileage</i>			
! <i>Damages or malfunction detected that requires repairs by the buyer</i>			
NA <i>Not applicable</i>			
☐ <i>Not tested</i>			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)