



Expertise

Protocol number: 41221839
Order No. / Reference: 25031828
Inspection date: 25 Aug 2025

Manufacturer: Ford	Model: Galaxy 2.0 EcoBlue S&S Aut. TITANIUM
VIN: WF0KXXWPCKMJ44760	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Galaxy 2.0 EcoBlue S&S Aut. TITANIUM	
Vehicle Identification number	WF0KXXWPCKMJ44760
Mileage (Read)	181,291 km
First registration	9 Mar 2021
Number of holders	1
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Blazer-Blau
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last maintenance on / at	10/2024 at 179,277 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FZ463160
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BKM 00961		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,595 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/55 R17 103W	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Dunlop	3mm / 3mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Dunlop	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Anti-lock braking system (ABS)
- Attachment points for safety barriers
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires
- Hill start assist
- Roof rails "aluminum look"
- tachometer
- Lane Assistant including Lane Keeping Assist and Fatigue Warning
- FordKeyFree system
- FordPass Connect including eCall, live traffic information and Wi-Fi hotspot
- Cruise control system with intelligent speed limiter
- Back window, heater
- Interior lighting with delay circuit
- Isofix mount
- Air conditioning with automatic temperature control, CFC-free
- Steering wheel: multifunction leather steering wheel
- Steering wheel: paddle shifters on the steering wheel
- Front center console with padded armrest
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect
- Package: Winter
- Upholstery: Cloth
- Tire pressure monitoring system (TPMS)
- Headlight assistant with day/night sensor
- Electro-mechanical power steering
- Seats: 3rd row with 2 individual seats (FoldFlatSystem)
- Seats: Comfort seats, front
- Seats: Trays on the front seat backrests
- Power socket: 12-volt connection in the luggage compartment and center console
- Daytime running lights in LED technology
- Lashing eyes in the luggage compartment
- Thermal insulation glazing
- Cigarette lighter
- ambient lighting at the front with LED technology
- Exterior mirrors painted in body color, electrically adjustable and heated
- Tires: Tire repair kit
- Brake light, third
- Diesel particulate filter (DPF)
- Driver information system display 25.4 cm color
- Electric windows front and rear
- Parking brake, electronic
- Ford Power start function
- Removable luggage compartment cover
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission
- Rear window wiper
- Intelligent security system
- Electric child safety lock
- Paint finish: Uni
- Steering wheel: Steering column, adjustable in height and reach
- Reading lights front and rear
- MyKey key system (individually programmable second key)
- Fog lights with LED technology
- Emergency brake light
- Parking pilot system front and rear
- Rain sensor
- Low beam headlights with switch-off delay including "welcome function"
- Seats: 2nd row with 3 individual seats (FoldFlat System)
- Seats: Driver and passenger seats, 4-way manually adjustable
- Start-stop system
- Socket: 230-volt connection (150 watts)
- Front bumper painted in body color
- Velour carpet floor mats
- Electronic immobilizer
- Central locking with remote control

Extra equipment

- Adaptive cruise control with Pre-Collision Assist and pedestrian detection (distance display and distance warning, forward collision warning system (FA - Forward Alert) and active emergency braking assistant - intelligent speed limiter - traffic jam assistant with Stop&Go function)
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Elimination of the 3rd row of seats (Omitted: 3rd row of seats, 3-zone automatic climate control and carpet floor mats for the 3rd row of seats)
- Safety partition net, behind the 2nd row of seats for luggage compartment
- Side windows from 2nd row and rear window, dark tinted
- Sun blinds integrated in the rear doors



- Package: Business III (Automatic) (Sony Navigation including Ford SYNC 3, AppLink, touchscreen, voice control, radio-CD player, MP3-capable, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall DAB/DAB+, adaptive LED headlights with anti-glare high beam, ACC, traffic jam assist, pre-collision assist, forward collision warning, emergency brake assist, front and rear view camera, blind spot assist, cross traffic alert, dynamic distance detection, electric and sensor-controlled tailgate, Ford Key Free, park assist)
- Swiveling trailer hitch (including ESP trailer stabilization)
- Upholstery: Premium leather (leather seat center panels - driver's seat, 10-way electrically adjustable with memory function - passenger seat, 10-way electrically adjustable - exterior mirror, driver's side, automatically dimming)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Equipment	Vehicle key (Batterie) - Empty - Replace
3	Equipment	Tirefit filler - Expired - Replace
4	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
5	Engine	Engine cowling - lower - Broken / torn - Replace
6	Engine	Engine cover - top / cover (Marderschaden) - Broken / torn - Replace
7	Door - front left side	Door handle - outside (Schlossabdeckung) - Missing - Replace
8	Instrument panel	Centre console - front (Armaturenbrett eingeschnitten, Luftgitter) - Broken / torn - Replace
9	Trim / covers	Door trim - front right side - Broken / torn - Replace
10	Front bumper	Spoiler - Scratched - Paint
11	Rear bumper	Rear bumper - Scratch(es) - Paint
12	Mudguard - left side	Mudguard - left side - Scratch(es) - Paint
13	Bonnet	Bonnet (Sandstrahleffekt) - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	2nd wheel set	Tyres - complete set - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear commensurate with its age and use.



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view ([Online link](#))



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

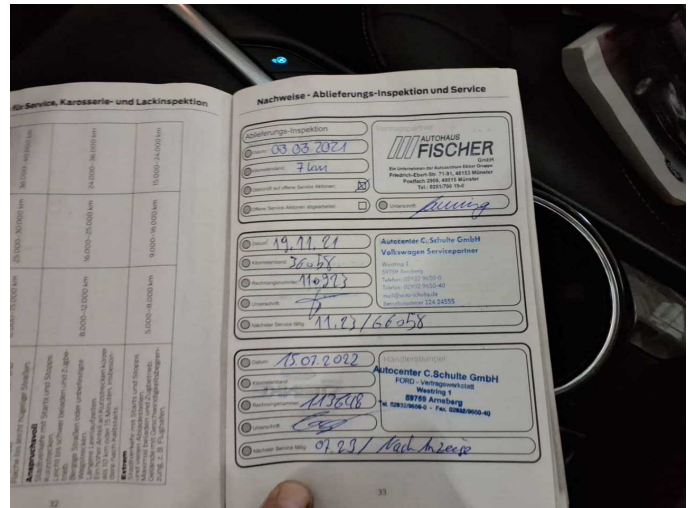


Figure 14: Documents

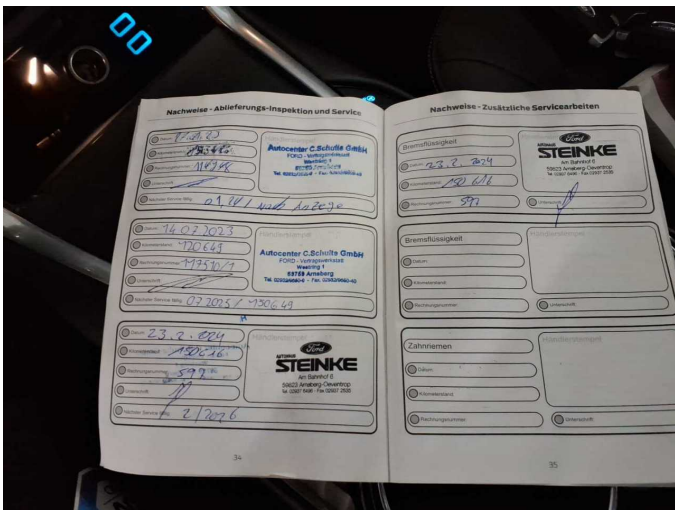


Figure 15: Documents

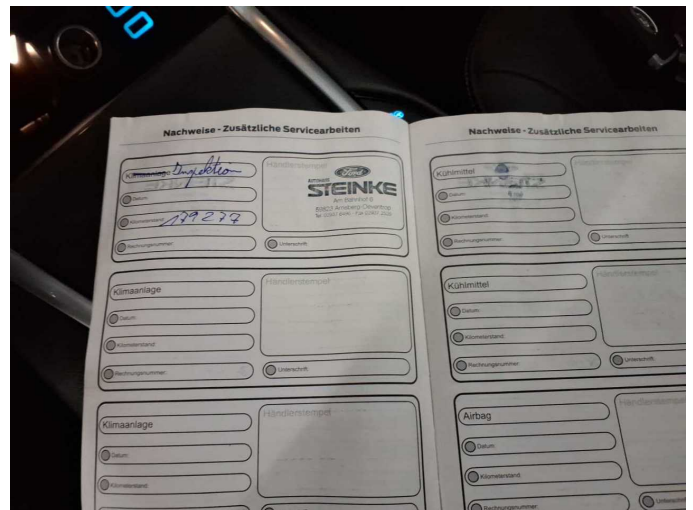


Figure 16: Documents

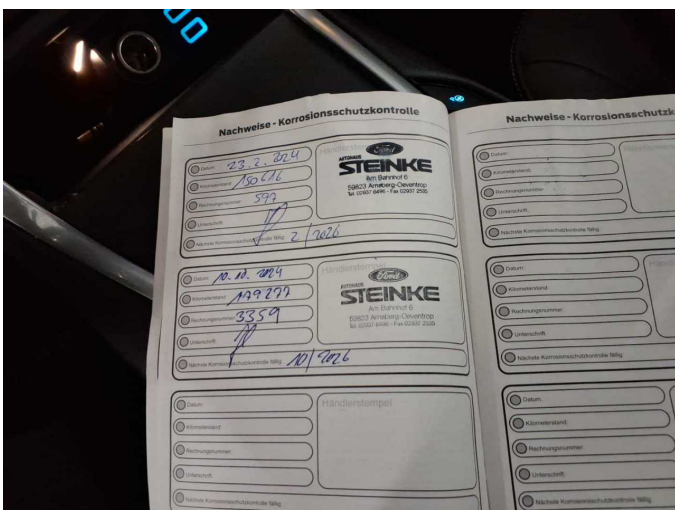


Figure 17: Documents



Figure 18: Additional tyres

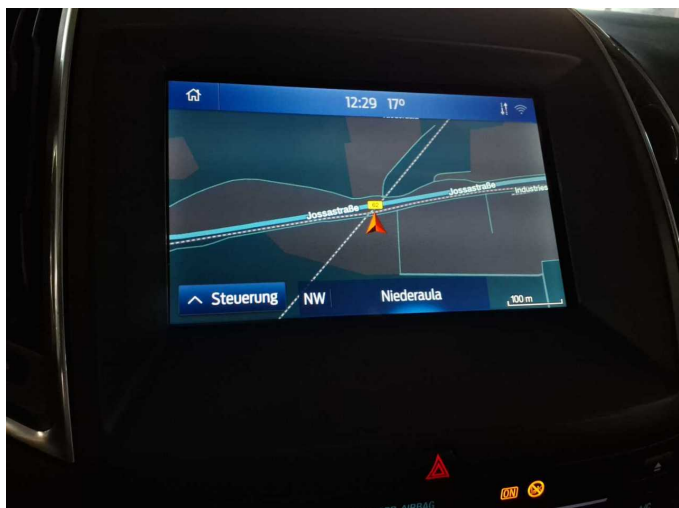


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

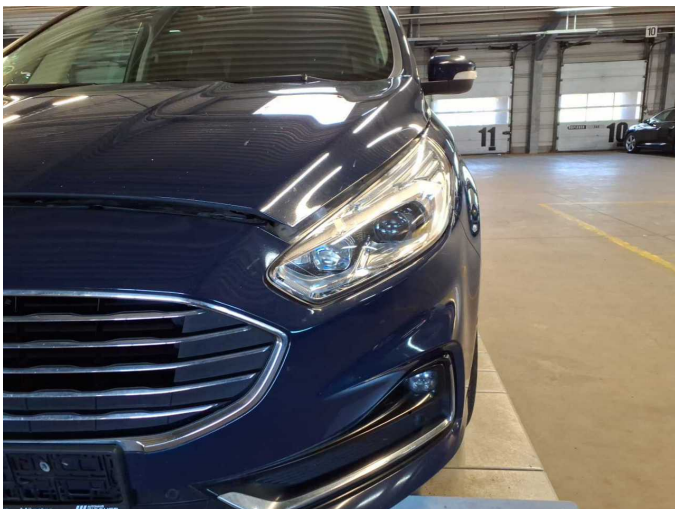


Figure 29: Misc.

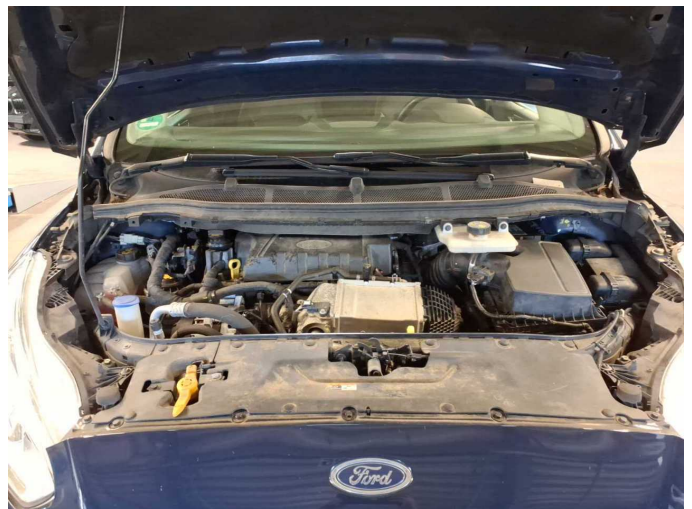


Figure 30: Misc.

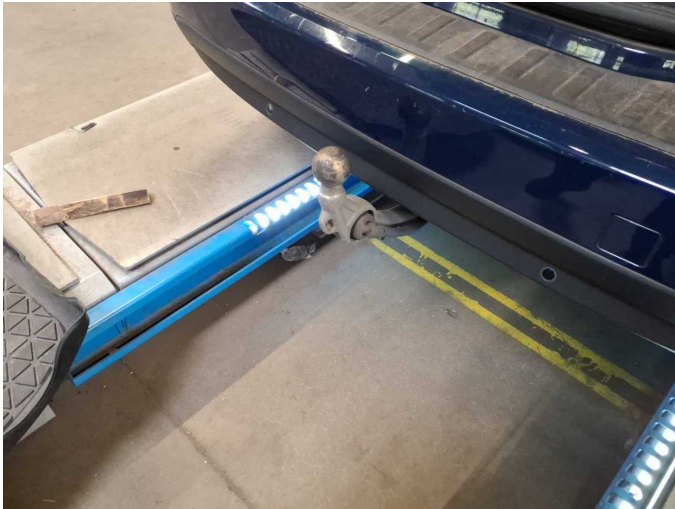


Figure 31: Misc.



Figure 32: Misc.

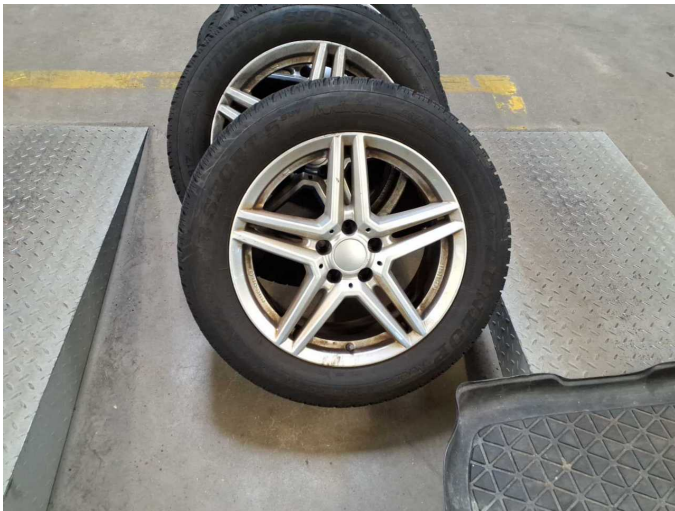


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 2: Equipment: Vehicle key (Batterie) - Empty - Replace




Damage 3: Equipment: Tirefit filler - Expired - Replace



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

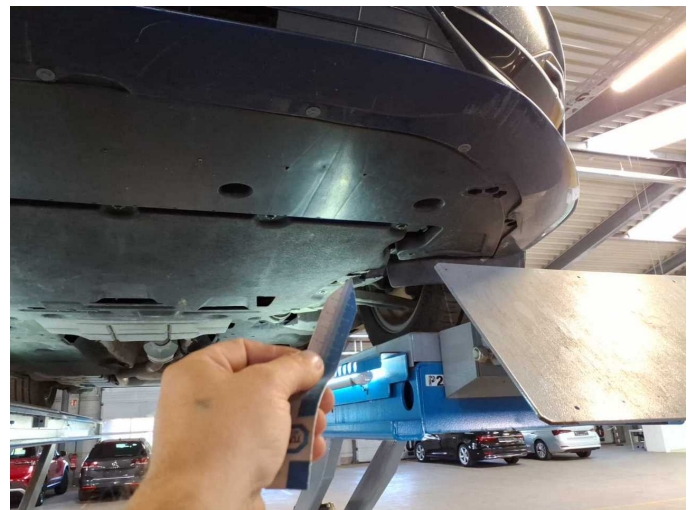


Damage 5: Engine: Engine cowling - lower - Broken / torn - Replace




Damage 5: Engine: Engine cowling - lower - Broken / torn - Replace



Damage 6: Engine: Engine cover - top / cover (Marderschaden) - Broken / torn - Replace

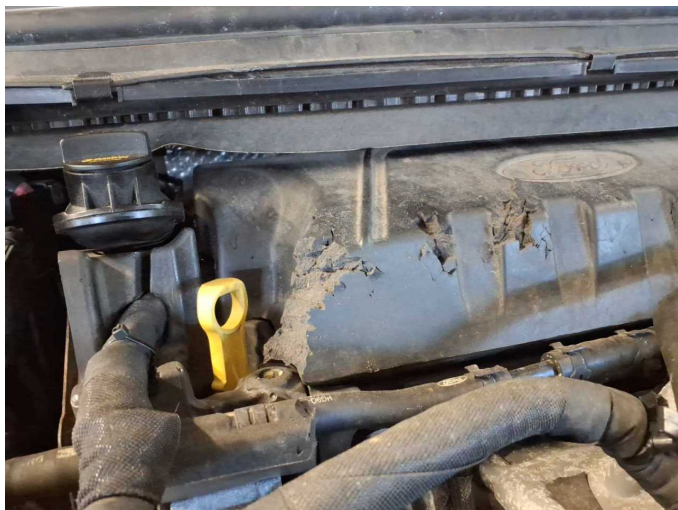

Damage 6: Engine: Engine cover - top / cover (Marderschaden) - Broken / torn - Replace

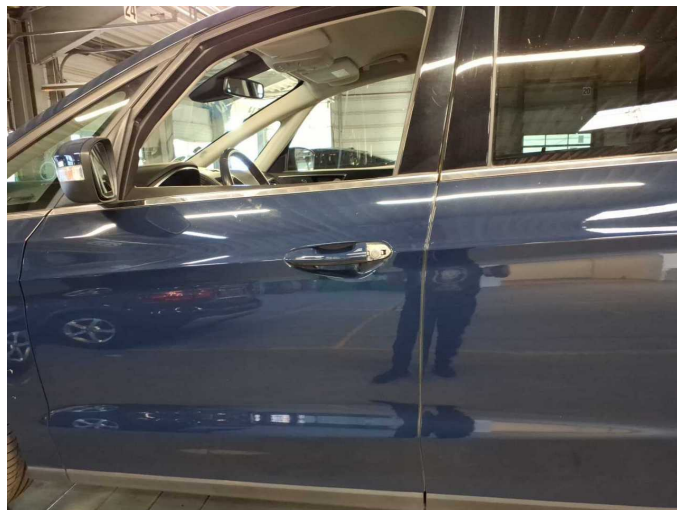

Damage 7: Door - front left side: Door handle - outside (Schlossabdeckung) - Missing - Replace



Damage 7: Door - front left side: Door handle - outside (Schlossabdeckung) - Missing - Replace



Damage 8: Instrument panel: Centre console - front (Armaturenbrett eingeschnitten, Luftgitter) - Broken / torn - Replace



Damage 8: Instrument panel: Centre console - front (Armaturenbrett eingeschnitten, Luftgitter) - Broken / torn - Replace



Damage 8: Instrument panel: Centre console - front (Armaturenbrett eingeschnitten, Luftgitter) - Broken / torn - Replace



Damage 8: Instrument panel: Centre console - front (Armaturenbrett eingeschnitten, Luftgitter) - Broken / torn - Replace



Damage 9: Trim / covers: Door trim - front right side - Broken / torn - Replace



Damage 9: Trim / covers: Door trim - front right side - Broken / torn - Replace



Damage 10: Front bumper: Spoiler - Scratched - Paint



Damage 10: Front bumper: Spoiler - Scratched - Paint




Damage 10: Front bumper: Spoiler - Scratched - Paint



Damage 10: Front bumper: Spoiler - Scratched - Paint




Damage 10: Front bumper: Spoiler - Scratched - Paint

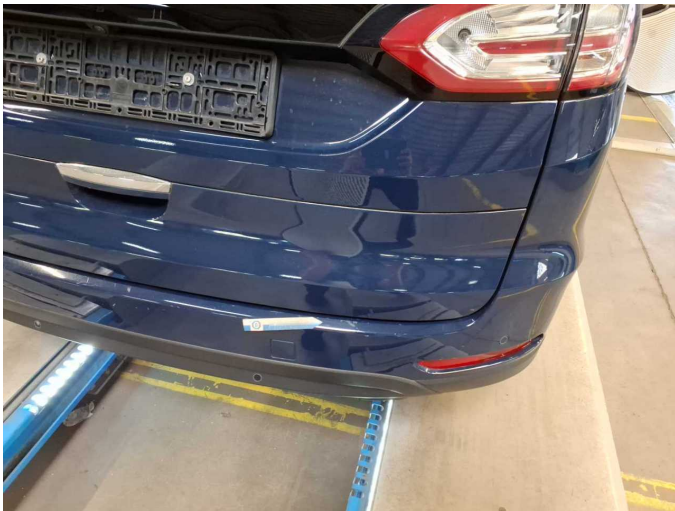

Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint

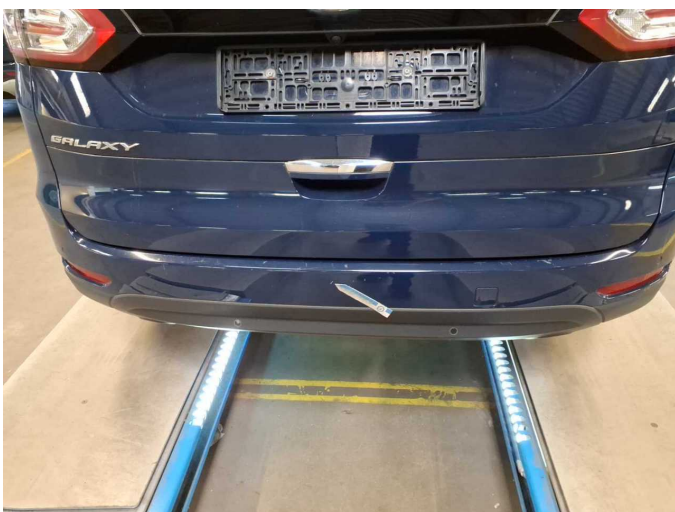


Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint

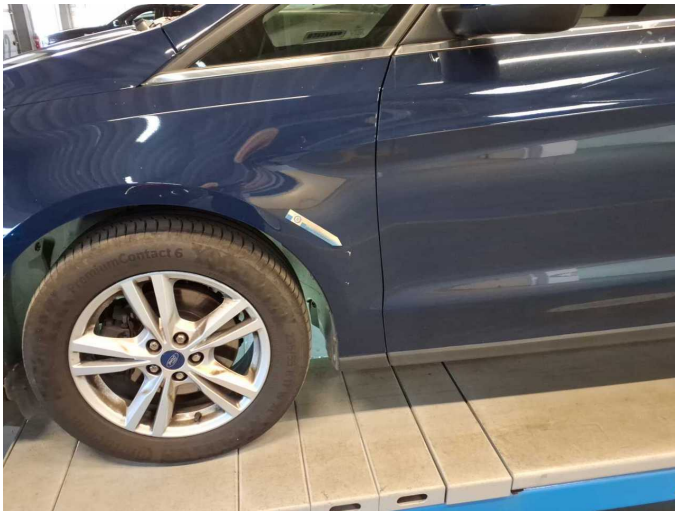

Damage 12: Mudguard - left side: Mudguard - left side - Scratch(es) - Paint

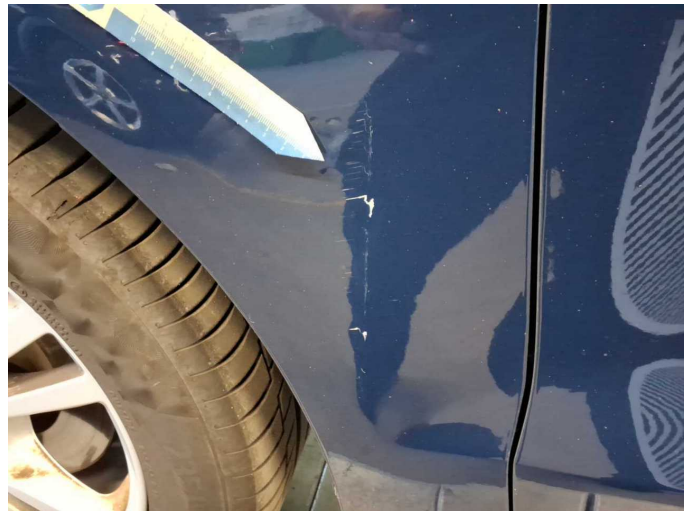


Damage 12: Mudguard - left side: Mudguard - left side - Scratch(es) - Paint

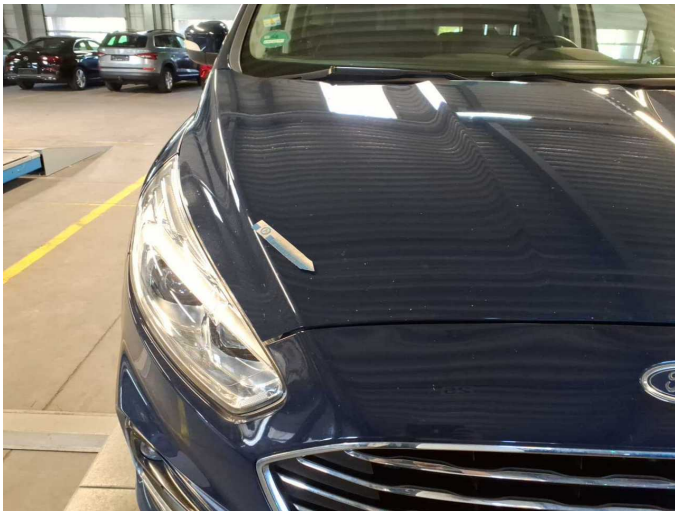

Damage 13: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 13: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

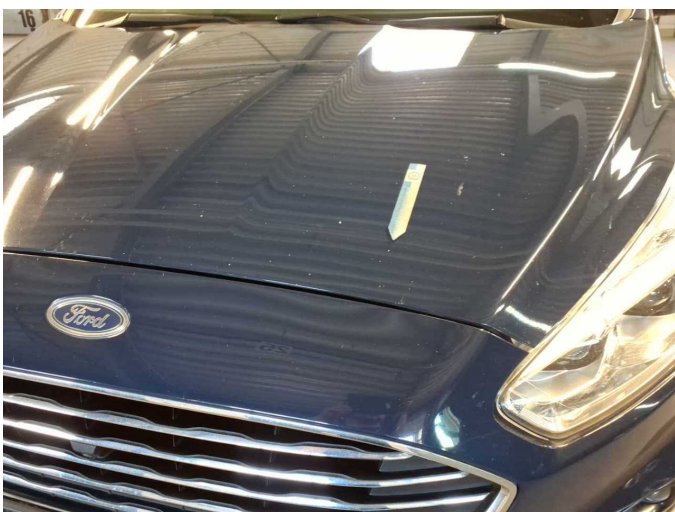

Damage 13: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 13: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0KXXWPCKMJ44760
Hersteller / Modell: FORD FORD Galaxy 2.0 EcoBlue S&S Aut. TITANIUM

Datum	KM-Stand	Beschreibung
14.07.2025	180.846	Batterie ern; Systemtest/Eigendiagnose
23.10.2024	179.277	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
13.06.2024	150.616	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.10.2023	135.423	Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
17.07.2023	120.649	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.03.2023	95.346	Motoröl b. Wartung; Regelwartungsdienst
15.07.2022	67.124	Bremsflüssigkeit ern; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
15.12.2021	36.225	Kleine Inspektion; Motoröl b. Wartung