



Expertise

Protocol number: 41592873
Order No. / Reference: 25147420
Inspection date: 17 Sept 2025

Manufacturer: Ford	Model: Focus 1.5 EcoBlue Start-Stopp-System Aut. ACTIVE
VIN: WF0NXXGCHNKP10124	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus 1.5 EcoBlue Start-Stopp-System Aut. ACTIVE	
Vehicle Identification number	WF0NXXGCHNKP10124
Mileage (Read)	113,407 km
First registration	18 May 2020
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Polar-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	32 %
Last maintenance on / at	04/2025 at 102,532 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FS941354
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BPU 00077		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	1,910 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R18 92V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	215/50 R18 92V	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R16 96M	Summer tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Airbag: Passenger airbag deactivation • Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated • Crossover body kit • Roof rails, black • Diesel particulate filter (DPF) • Front door sill trim • Driver information system • Lane Assistant including Lane Keeping Assist • Electric windows front and rear • Electric parking brake with auto-hold function • Ford Power start function • Luggage compartment cover and luggage compartment lighting • Transmission: 8-speed automatic transmission • Back window, heater • Interior lighting with LED technology • Intelligent security system • Air conditioning, manual • Honeycomb grille • LED fog lights • Steering wheel: leather steering wheel 3-spoke design • Center console "Premium" front • Navigation: Ford Navigation, Ford SYNC 3 with AppLink, 8" touchscreen (20.3 cm) with DAB/DAB+ • Pollen filter and dust filter • Post-Collision Assist • Tire pressure monitoring system (TPMS) • Headlights, dark contrasting • Electro-mechanical power steering • Seats: Map pocket on driver and passenger seat backrests • Seats: Front sports seats with increased lateral support • Carpet floor mats front, velour • Electronic immobilizer • Heat-insulating glazing, tinted • Additional heating | <ul style="list-style-type: none"> • Anti-lock braking system (ABS) with electronic brake-force distribution (EBD) • Tires: 7 J x 17 alloy wheels (4) with 215/55 R 17 tires • Woven fabric headliner • Roof spoiler painted in body color • tachometer • Electronic Safety and Stability Program (ESP) • Driving mode switch, selective • Chassis: Chassis with 30 mm increased ground clearance • Ford ECO Coach • FordPass Connect including eCall, Live Traffic Information (only with navigation) and Wi-Fi hotspot • Cruise control system with intelligent speed limiter • Glove compartment, illuminated • Rear window wiper • Instrument lighting, adjustable • Isofix mount • Headrests 2 front and 3 rear, height adjustable • Paint: Race Red • LED daytime running lights • Steering column, adjustable • MyKey key system (individually programmable second key) • Emergency brake light • Parking pilot system front and rear • Upholstery: Cloth • Pre-Collision Assist • Spare wheel: emergency wheel • Headlight assistant with day/night sensor • Seats: Driver's seat height adjustable • Seats: Rear seat backrest • Start-stop system • Unfastened seat belt warning system for the 1st and 2nd row of seats • Central/double locking |
|---|--|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated indicators and ambient lighting and electrically folding - with Blind Spot Assist including Cross Traffic Alert - Cross Traffic Alert is a function that uses the Blind Spot Assist radar sensors to monitor an area of approximately 40 m to the left and right of the vehicle when reversing out of perpendicular parking spaces and can automatically trigger braking.) | <ul style="list-style-type: none"> • Display: Head-up display • Paint finish: metallic • Charging station for mobile devices (inductive) |
|---|---|



- Package: Design IV (Active) (side windows from the 2nd row and rear window, dark tinted - intelligent LED headlights with glare-free high beam assist and camera-based cornering lights - adaptive headlight beam and automatic headlight range control - sequential LED indicators, front - LED taillights - windshield wipers with rain sensor - interior mirror with automatic dimming - four 7 J x 18 alloy wheels in a 5x2-spoke Y design in black, with a high-sheen finish and 215/50 R 18 tires)
- Package: Comfort (2-zone automatic climate control for driver and passenger side, separately adjustable - Ford Key Free system (keyless locking/unlocking) including Ford Power start function (keyless starting) - Windshield wipers with rain sensor, variably adjustable sensitivity - Interior mirror, automatically dimming - Headlight dipped beam with switch-off delay)
- Package: Technology II (Cool&Conn, ST-Line, Active) (Traffic Jam Assist with Stop & Go function - Lane Keeping Pilot - Intelligent Cruise Control, Adaptive iACC - with traffic sign recognition - Wrong-way driver warning function - Evasive Steer Assistance (ESA) - High Beam Assist (in conjunction with intelligent LED headlights with glare-free high beam assistant) - Fatigue Warning - Windshield wipers with rain sensor, variable sensitivity adjustment - Interior mirror with automatic dimming - Headlight dipped beam with switch-off delay)
- Navigation: Ford Navigation, SYNC 3 with AppLink, 8" touchscreen (20.3 cm), B&O Sound System, DAB/DAB+ (Ford SYNC 3 communication and entertainment system with voice control, radio, 2 USB ports, steering wheel remote control, Bluetooth hands-free system and audio streaming, SMS reading and sending option, voice control for audio, telephone, destination search, support for Android Auto and Apple CarPlay, dynamic navigation with TMCpro, road map for Europe, advanced voice output, detailed visualization, 675-watt premium sound system with 10 speakers including subwoofer)
- Package: Easy-Parking Plus (Active Parking Assistant with parking and exit function and partially automated vehicle guidance - rear view camera with "Split View" technology)
- Package: Family (rear seat backrest with ski-loading function - rear center armrest with 2 cup holders - electric child safety lock - front passenger seat, manually height-adjustable, with adjustable lumbar support (already standard on Titanium))
- Package: Active Plus Styling Package (black woven headliner - front and rear carpeted floor mats with Nordic Blue decorative stitching - center console knee pads with Nordic Blue decorative stitching - Trek Blue-design appliqués on the front doors and in the instrument panel area)
- Package: Winter (heated windscreen - heated steering wheel - front seats, individually and variably heated)
- Panoramic sunroof, electric
- Upholstery: Leather-fabric (leather seat bolsters - driver's seat, 8-way electrically adjustable - front seats, individually and variably heated)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smart repair
2	Steering system	Steering wheel - Paint defect - Replace



Wear and tear

No.	Component group	Description
1	Body	Body - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Wheel / tyres	Alloy rim - front left side - Scratched - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Accident damages

No. Accident

- Side right

Repainting

No. Repainting

- Mudguard - left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	177 µm	Door - front left side	336 µm
----------------------	--------	------------------------	--------

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

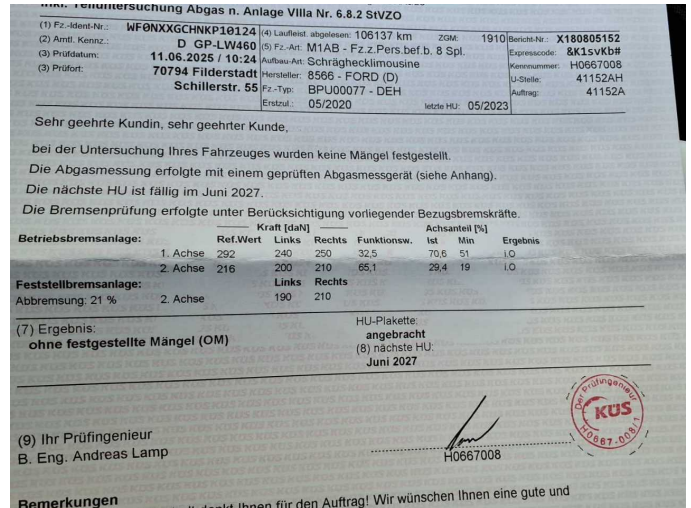


Figure 14: Documents

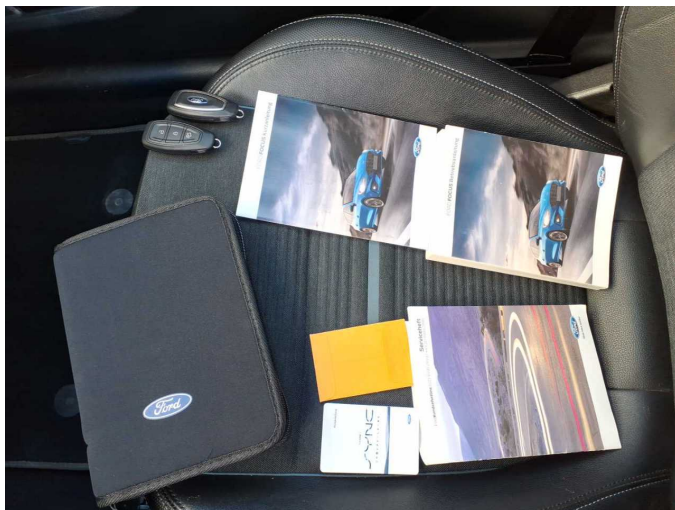


Figure 15: Documents

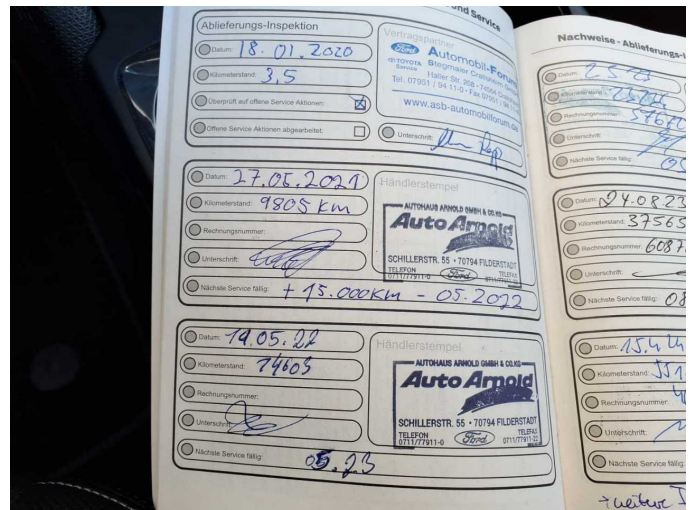


Figure 16: Documents

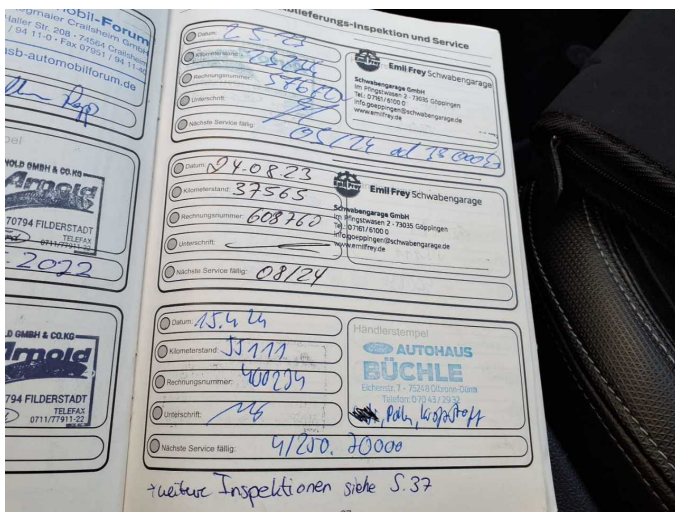


Figure 17: Documents



Figure 18: Documents

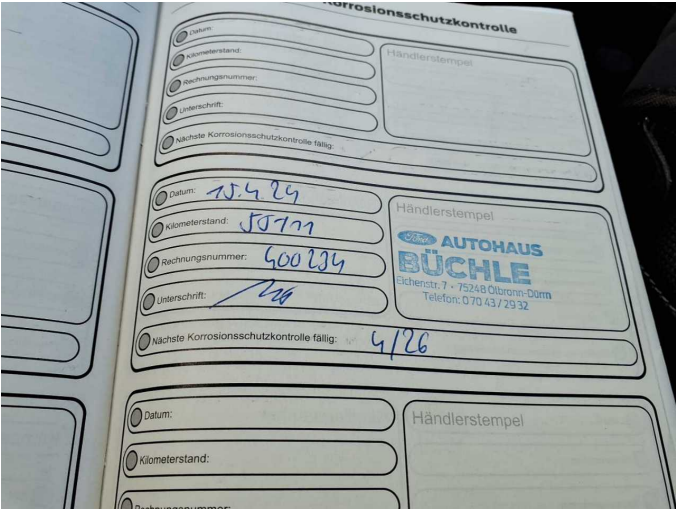


Figure 19: Documents

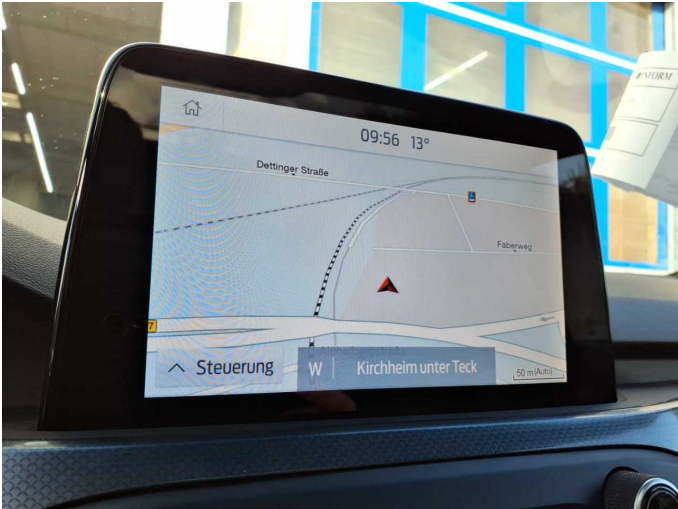


Figure 20: Navigation

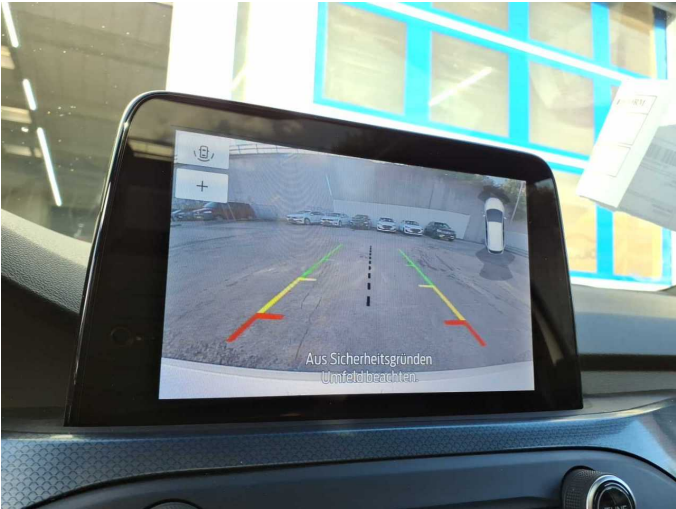


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

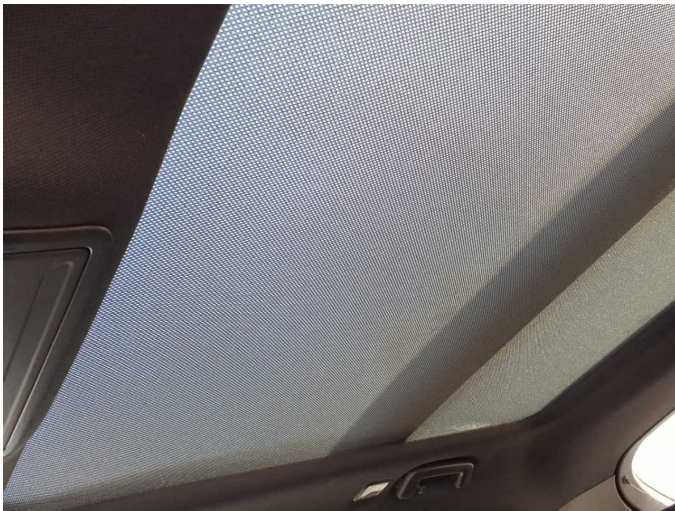


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

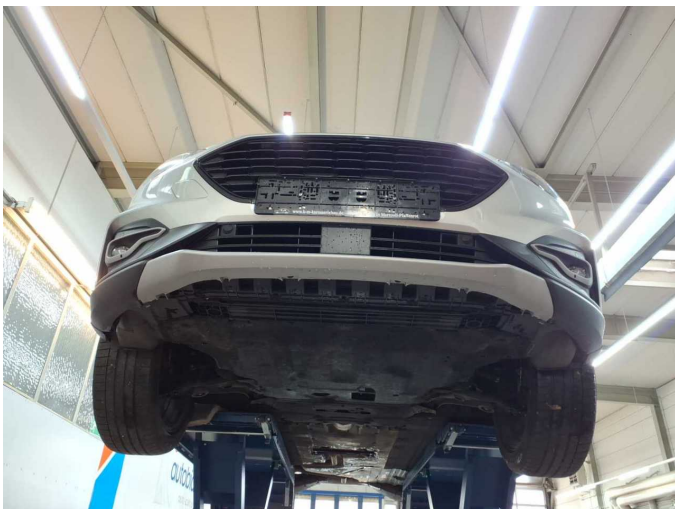


Figure 35: Misc.




Figure 36: Misc.




Damage 1: Door - front right side: Door - dent(s) - Smart repair



Damage 1: Door - front right side: Door - dent(s) - Smart repair

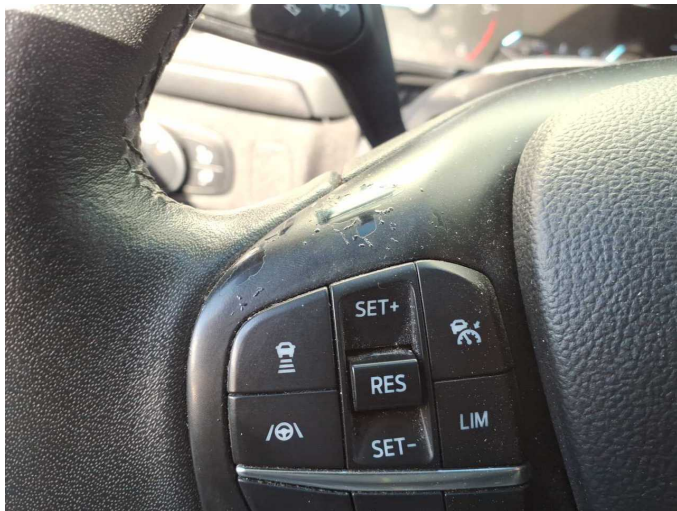


Damage 2: Steering system: Steering wheel - Paint defect - Replace

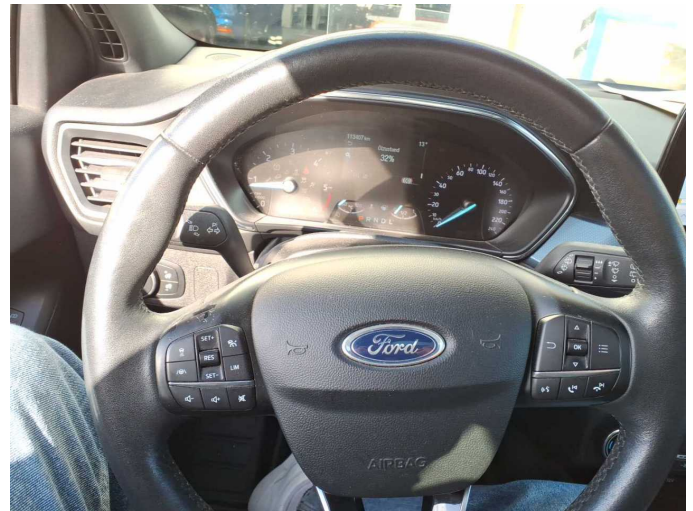

Damage 2: Steering system: Steering wheel - Paint defect - Replace



Accident 1: Side right

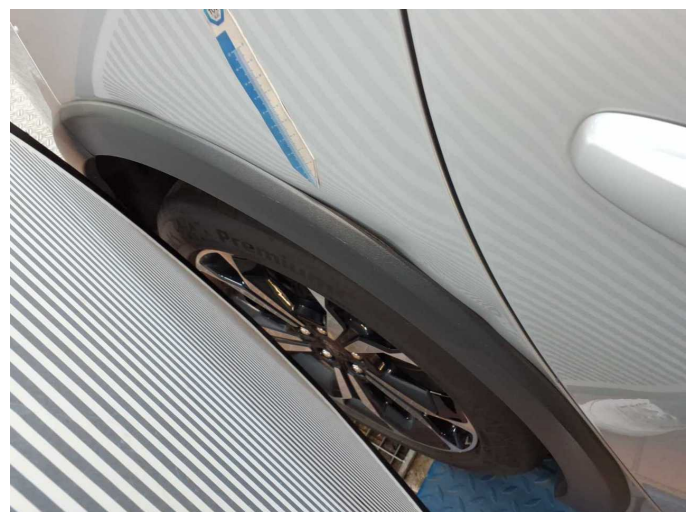

Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right




Accident 1: Side right



Accident 1: Side right




Accident 1: Side right

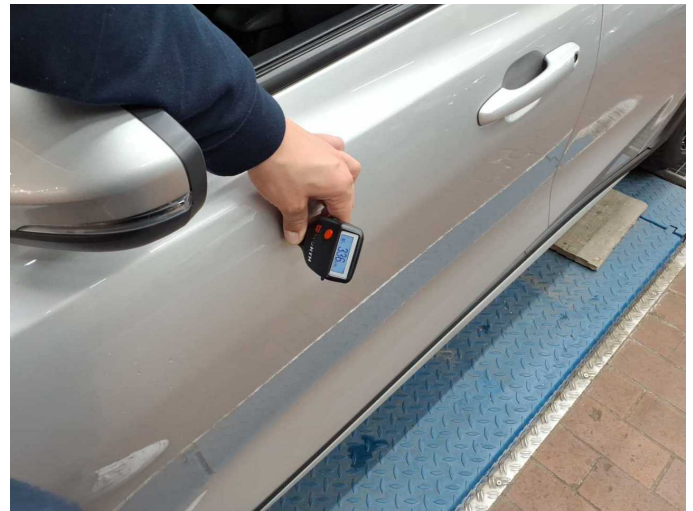

Repainting 1: Mudguard - left side, Door - front left side



Repainting 1: Mudguard - left side, Door - front left side

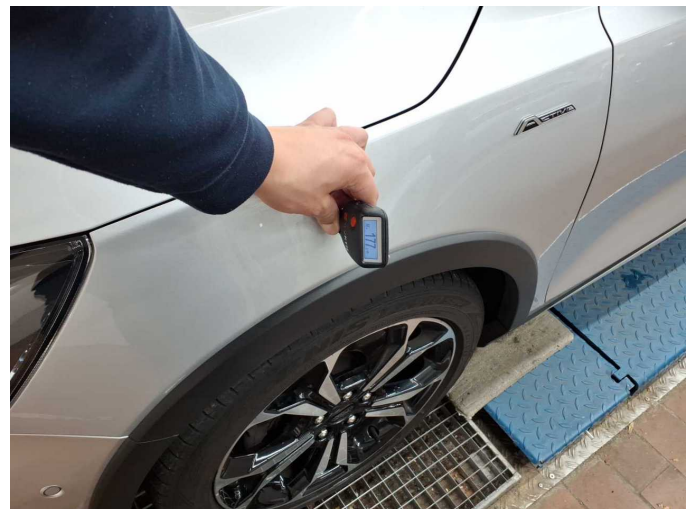

Repainting 1: Mudguard - left side, Door - front left side



Repainting 1: Mudguard - left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0NXXGCHNKP10124

Hersteller / Modell: FORD FORD Focus 1.5 EcoBlue Start-Stopp-System Aut. ACTIVE

Datum	KM-Stand	Beschreibung
03.07.2025	106.137	HU + AU
30.04.2025	102.532	Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges
02.12.2024	85.411	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.09.2024	70.612	Motoröl b. Wartung; Ölwechsel
16.07.2024	67.055	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
16.04.2024	55.111	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst
24.08.2023	37.565	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.05.2023	23.234	AU; Motoröl b. Wartung; Ölwechsel
19.05.2022	14.603	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
27.05.2021	9.805	Motoröl b. Wartung; Ölwechsel