



Expertise

Protocol number: 41172785  
Order No. / Reference: 25113901  
Inspection date: 21 Aug 2025

Manufacturer: Ford

Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System TITANIUM

VIN: WF0PXXGCHPNY32625



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System TITANIUM	
Vehicle Identification number	WF0PXXGCHPNY32625
Mileage (Read)	223,362 km
First registration	29 Mar 2022
Number of holders	1
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / incomplete	<b>Next maintenance in</b>	48 %
<b>Last maintenance on / at</b>	04/2025 at 207,624 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	GK785594
<b>Previous damage / Accident</b>	None detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	8566 / BPV 00642		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	1,955 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/60 R16 96H	Summer tyres on Light alloy	Goodyear	7mm / 7mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



## Equipment

### Standard equipment

- |   |  |
|---|--|
| <ul style="list-style-type: none"> <li>• Airbag: Passenger airbag deactivation</li> <li>• Electrically folding exterior mirrors</li> <li>• Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated</li> <li>• Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires</li> <li>• Woven fabric headliner</li> <li>• Roof spoiler painted in body color</li> <li>• tachometer</li> <li>• Driver information system with on-board computer, color (10.7 cm screen diagonal)</li> <li>• Parking brake, electronic</li> <li>• FordPass Connect including eCall, Live Traffic Information (only with navigation) and Wi-Fi hotspot</li> <li>• Cruise control system</li> <li>• Glove compartment, illuminated</li> <li>• Rear window wiper</li> <li>• Interior mirror, automatically dimming</li> <li>• Isofix mount</li> <li>• Headrests 2 front and 3 rear, height adjustable</li> <li>• LED headlights</li> <li>• Steering wheel: 3-spoke design</li> <li>• Make-up mirrors in driver and passenger sun visors</li> <li>• MyKey key system (individually programmable second key)</li> <li>• Parking pilot system front and rear</li> <li>• Upholstery: Cloth</li> <li>• Pre-Collision Assist</li> <li>• Tire pressure monitoring system (TPMS)</li> <li>• Headlight assistant with day/night sensor</li> <li>• Seats: Passenger seat height adjustable, manual</li> <li>• Seats: Map grid on driver and passenger seat backrests</li> <li>• Seats: Front sports seats with increased lateral support</li> <li>• 12 volt socket in the luggage compartment</li> <li>• Lashing eyes in the luggage compartment</li> <li>• Electronic immobilizer</li> <li>• Central locking with remote control and remote luggage compartment release</li> </ul> | <ul style="list-style-type: none"> <li>• Anti-lock braking system (ABS) with electronic brake-force distribution (EBD)</li> <li>• Attachment points behind the 2nd row of seats for mounting the safety net</li> <li>• Hill start assist</li> <li>• Roof rails, aluminum</li> <li>• Diesel particulate filter (DPF)</li> <li>• Electronic Safety and Stability Program (ESP)</li> <li>• Lane Assistant including Lane Keeping Assist</li> <li>• Electric windows front and rear</li> <li>• Ford Power start function</li> <li>• Luggage compartment cover</li> <li>• Speed limiter</li> <li>• Transmission: 6-speed manual transmission</li> <li>• Back window, heater</li> <li>• Interior lighting with LED technology</li> <li>• Intelligent security system</li> <li>• Air conditioning with automatic temperature control</li> <li>• LED taillights</li> <li>• Leather gear knob</li> <li>• Steering column, adjustable</li> <li>• Center console "Premium" front</li> <li>• Navigation: Ford SYNC 4 including Ford navigation system with AppLink, 13.2" touchscreen and DAB/DAB+</li> <li>• Post-Collision Assist</li> <li>• Tire repair kit</li> <li>• Windscreen wipers with rain sensor (sensitivity adjustable)</li> <li>• Power steering electro-mechanical speed-dependent</li> <li>• Seats: Driver's seat height adjustable</li> <li>• Seats: Rear seat backrest</li> <li>• Start-stop system</li> <li>• Carpet floor mats front</li> <li>• Unfastened seat belt warning system for the 1st and 2nd row of seats</li> </ul> |
|---|--|

### Extra equipment

- |  |   |
|--|---|
| <ul style="list-style-type: none"> <li>• Paint finish: Frozen White</li> <li>• Side windows from 2nd row and rear window, dark tinted</li> <li>• Safety partition net for luggage compartment</li> </ul> | <ul style="list-style-type: none"> <li>• Package: Winter (heated windscreen - heated steering wheel - front seats, individually and variably heated)</li> </ul> |
|--|---|



## Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

## Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Wheel / tyres	Wheel cover - front right side - Scratched - Replace
3	Trim / covers	Door trim - rear left side - Scratched - Replace
4	Front bumper	Front bumper - Scratched - Paint

## Wear and tear

No.	Component group	Description
1	Roof	Roof - Stone chips - No deduction
2	Wheel / tyres	Wheel cover - front left side - Scratched - No deduction
3	Side panel - rear right side	Side panel - dent(s) - No deduction
4	Side panel - rear left side	Sill - Dent / paintcoat damage - No deduction
5	Trim / covers	Roof lining - Soiled - No deduction
6	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

## Missing parts

### Description

Documents - Service book

## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle



## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Apparently, no repaired previous damage could be found on the vehicle.





**Figure 1:** Diagonal front (left)



**Figure 2:** Diagonal front (right)



**Figure 3:** Diagonal rear (left)



**Figure 4:** Diagonal rear (right)



**Figure 5:** Interior - front



**Figure 6:** Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

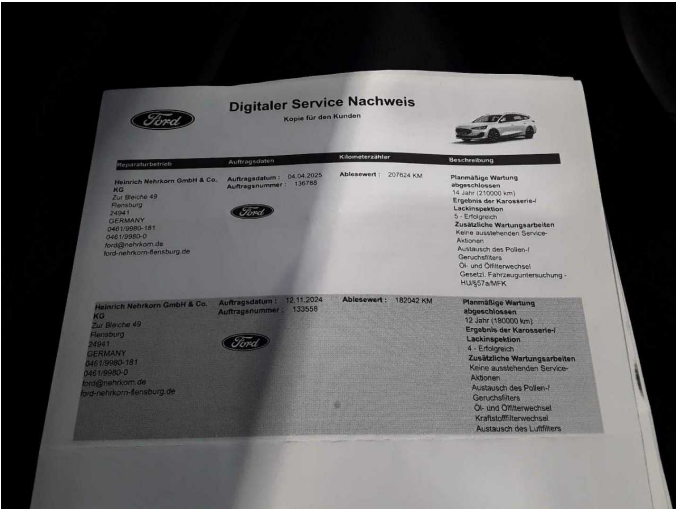


Figure 15: Documents

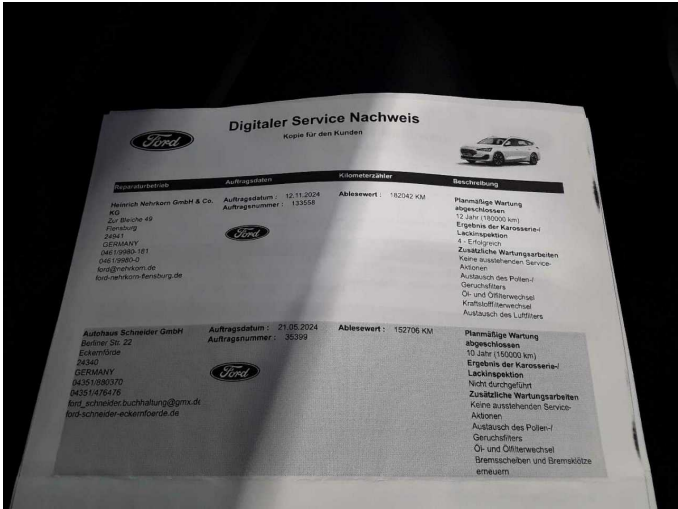


Figure 16: Documents

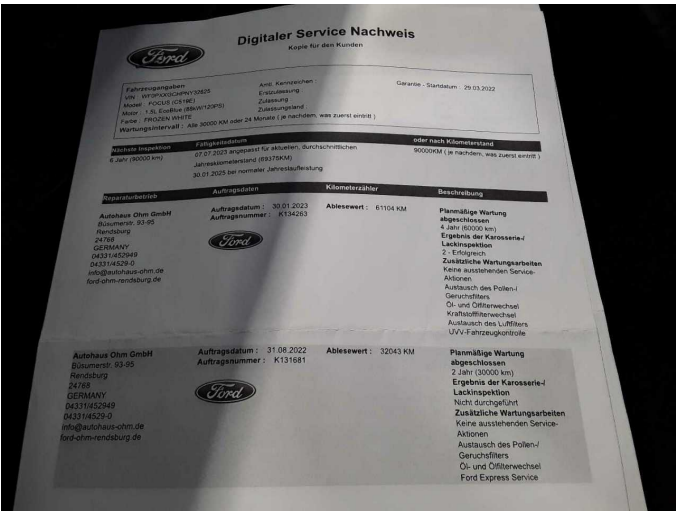


Figure 17: Documents

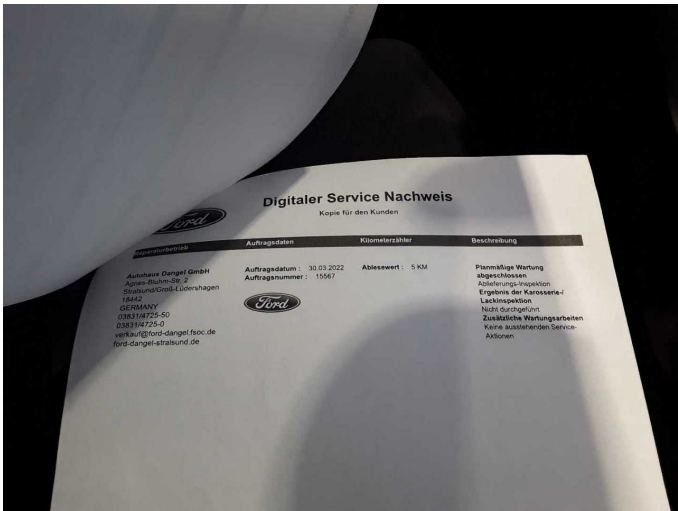


Figure 18: Documents





Figure 19: Documents



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.






**Damage 2:** Wheel / tyres: Wheel cover - front right side - Scratched - Replace



**Damage 2:** Wheel / tyres: Wheel cover - front right side - Scratched - Replace

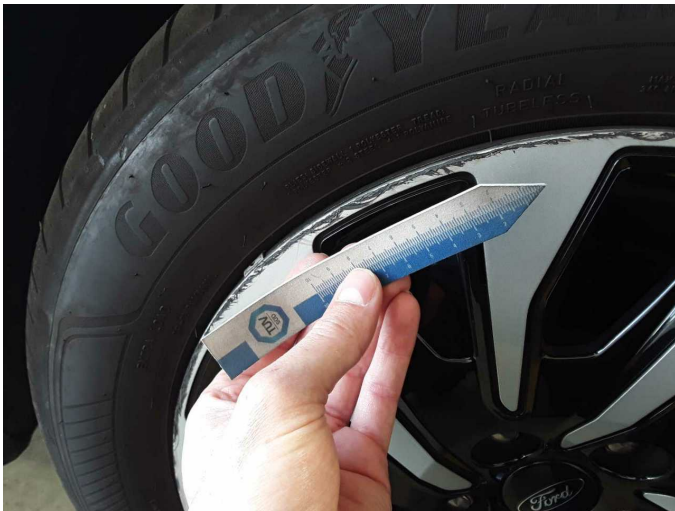

**Damage 2:** Wheel / tyres: Wheel cover - front right side - Scratched - Replace



**Damage 3:** Trim / covers: Door trim - rear left side - Scratched - Replace



**Damage 3:** Trim / covers: Door trim - rear left side - Scratched - Replace



**Damage 3:** Trim / covers: Door trim - rear left side - Scratched - Replace



**Damage 4:** Front bumper: Front bumper - Scratched - Paint



**Damage 4:** Front bumper: Front bumper - Scratched - Paint



**Damage 4:** Front bumper: Front bumper - Scratched - Paint



**Wear and tear 2:** Wheel / tyres: Wheel cover - front left side - Scratched - No deduction



**Wear and tear 2:** Wheel / tyres: Wheel cover - front left side - Scratched - No deduction