



FORD S-Max

S-Max 2.0 TDCi DPF

VIN NO WF0SXXGBWSEG20567
Registration Number BWSEG20567



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2026-10-01	1	2	174559 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-04-17	155281	2015-05-22	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250523154013
Inspection Date / Place	2025-05-23 / BCA Heidenheim	Cosmetic Grade	2

Vehicle Summary



Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Road Worthy	Yes
Colour	Light Grey	Engine Size (cc)	1997
Engine Size	2.0	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	139
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





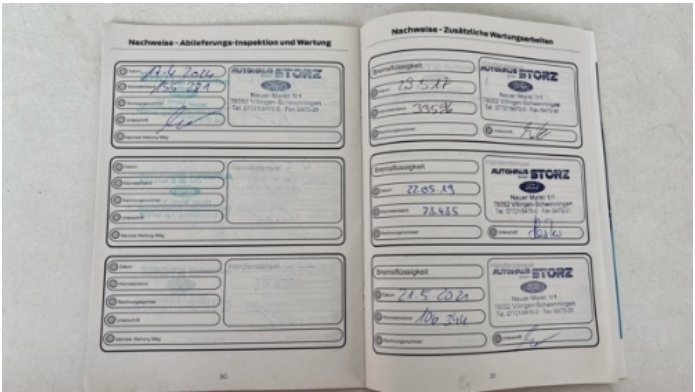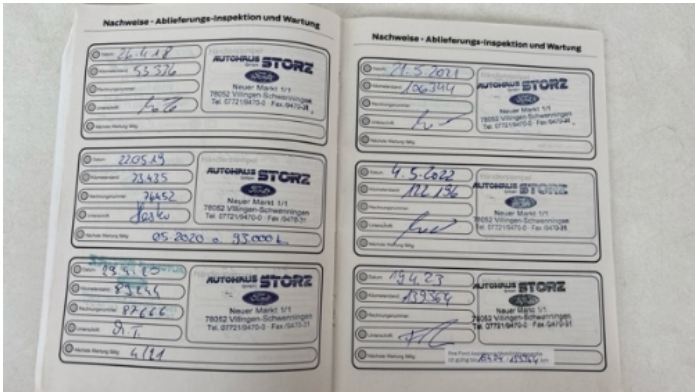

Equipment

Tinted Glass	USB Socket	Anti-lock braking	Bluetooth telephone interface
Front fog lamps	Heated windscreen	Remote central locking	Split folding rear seats
Leather steering wheel	Rear parking sensors	Tow ball	Airbag Status
Auxiliary Socket	Cruise control	Front parking sensors	Remote adjusting wing mirrors
Satellite navigation	Stability control	Radio	Rear sunblind


Equipment Details

Tow Ball Type	Detachable	Air Conditioning	Dual Zone Climate Control
Seat Heating	Front		

Wheels & Tyres

Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5
Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	7	Extra Wheel - 4 Tyre Depth	7

Cosmetic Damage

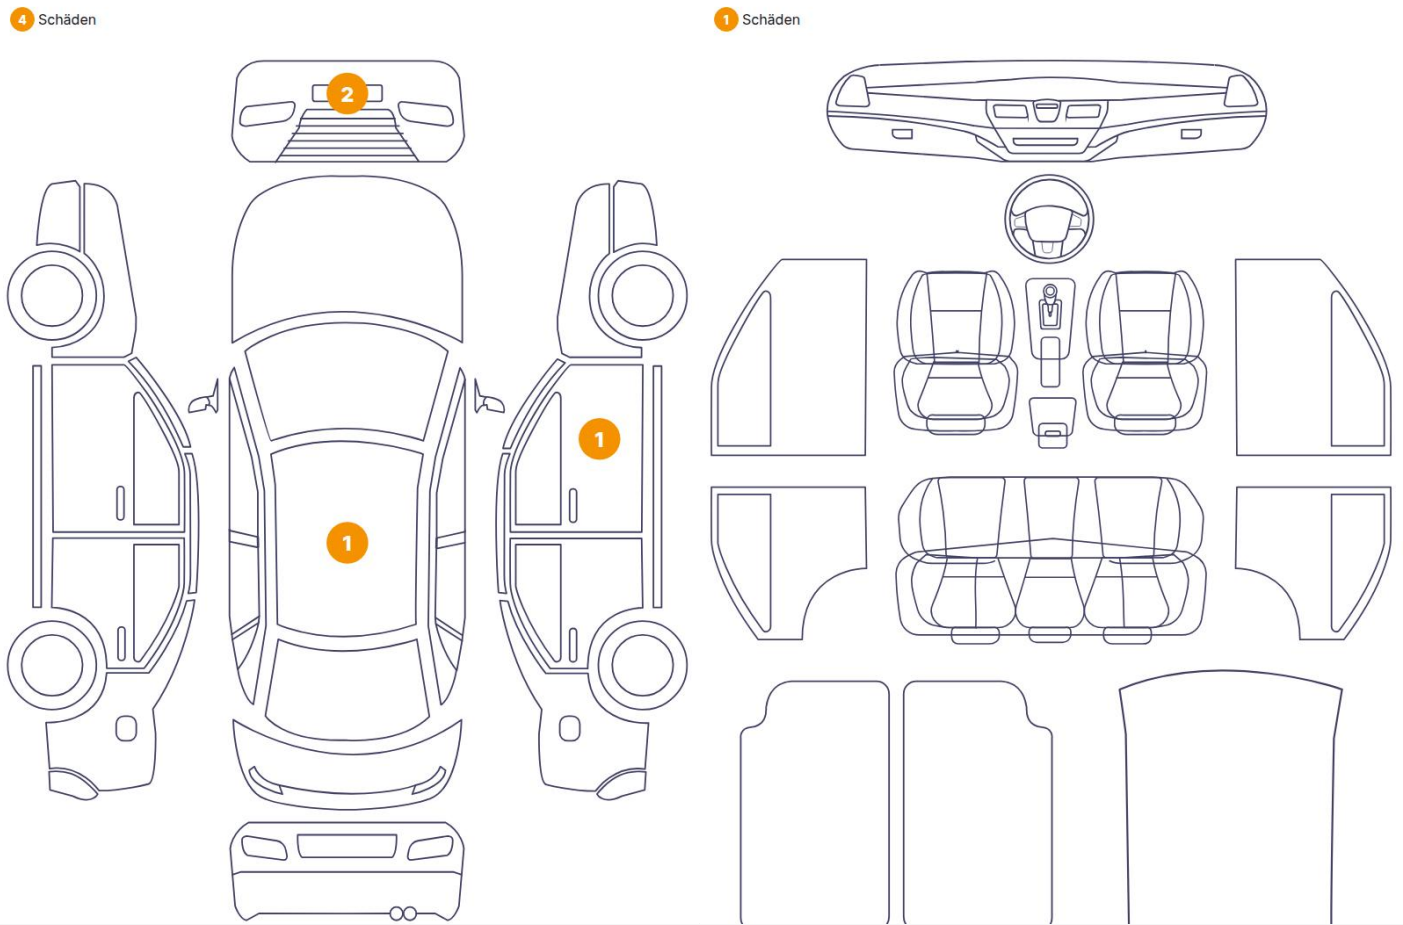

Component	Damage	Comments
1 Roof	Paint / Poor Previous Repair	
2 Bumper / Front	Paint / Scratch / Scuff	
3 Bumper / Front	Paint / Scratch / Scuff	
4 Mirror Shell / Front Right	Paint / Scratch / Line	
5 Luggage Space Cover / Back	Interior / Dirty	



1. Roof
Paint / Poor Previous Repair -



2. Bumper / Front
Paint / Scratch / Scuff -



3. Bumper / Front
Paint / Scratch / Scuff -



4. Mirror Shell / Front Right
Paint / Scratch / Line -



5. Luggage Space Cover / Back
Interior / Dirty -

Mechanical Condition

Control Lights

Display Defect	✓	Service Light	✓
ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓

Equipments Test

Central Locking	✓	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	!	AC / Heating System	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel

Steering Noise / Anomaly	✓
----------------------------	---

Engine

Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓

Clutch

Clutch Functioning	✓
--------------------	---

General

Test Driven Status	✓
--------------------	---

- ✔ *No troubles detected, good condition or correct tests, according to vehicle age and mileage*
- ❗ *Damages or malfunction detected that requires repairs by the buyer*
- NA *Not applicable*
- ☐ *Not tested*

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)