



FORD Mustang Mach-E

Mustang Mach-E AWD

VIN NO WF0TK4SX7NMA36888
Registration Number X7NMA36888



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2025-09-01	1	2	41227 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-10-09	32115	2022-09-14	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20251021152632
Inspection Date / Place	2025-10-21 / BCA Neuss	Cosmetic Grade	2

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Battery Electric Vehicle	Road Worthy	Yes
Colour	Black	Engine Size (cc)	
Engine Size		No of Doors	5
Body Type	SUV	Drive Train	All-Wheel-Drive permanent
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth/Synthetic Leather
Charging Cables	OUC + Type 2	WLTP CO2 Emissions	
Gearbox Type	Automatic	Battery State of Health	96

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			


Vehicle Remarketing Imagery

[Click Here For Larger Images](#)




Vehicle Remarketing Imagery

[Click Here For Larger Images](#)

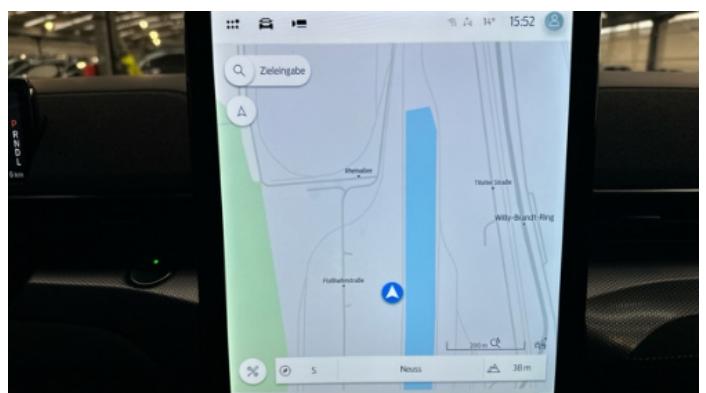

Vehicle Remarketing Imagery

[Click Here For Larger Images](#)

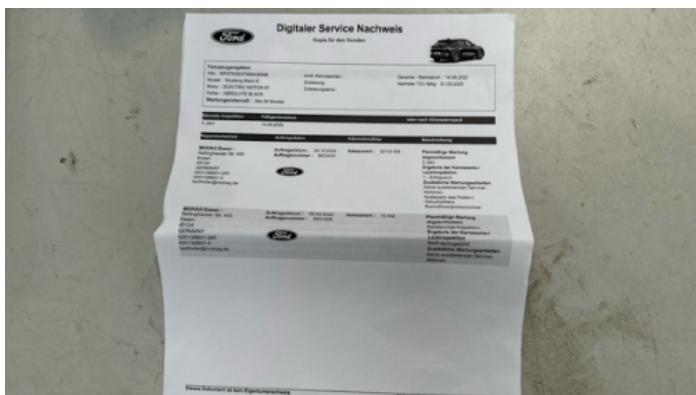

Equipment

Tinted Glass	USB Socket	Adaptivecruisecontrol	Alloys wheels
Anti-lock braking	Bluetooth telephone interface	Digital Radio	Enhanced speaker system
Remote adjusting wing mirrors	Reversing Camera	Stability control	Distancewarningsystem
Electrically folding wing mirrors	Laneassist	LED Headlamps	Rear parking sensors
Trafficsignrecognition	360°camera	Airbag Status	AndroidAuto
AppleCarPlay	Cruise control	Digitaldashboard	Front parking sensors
Remote central locking	Satellite navigation	Sunroof	Electrically adjustable seats
Electrictailgate	Leather steering wheel	Radio	

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	20
Enhanced Speaker System	B&O	Seat Heating	Front
Sunroof Type	Fixed Panoramic		

Wheels & Tyres


Left Rear Tyre Depth	5	Right Front Tyre Depth	5
Left Front Tyre Depth	5	Right Rear Tyre Depth	5

Cosmetic Damage

17 Schäden

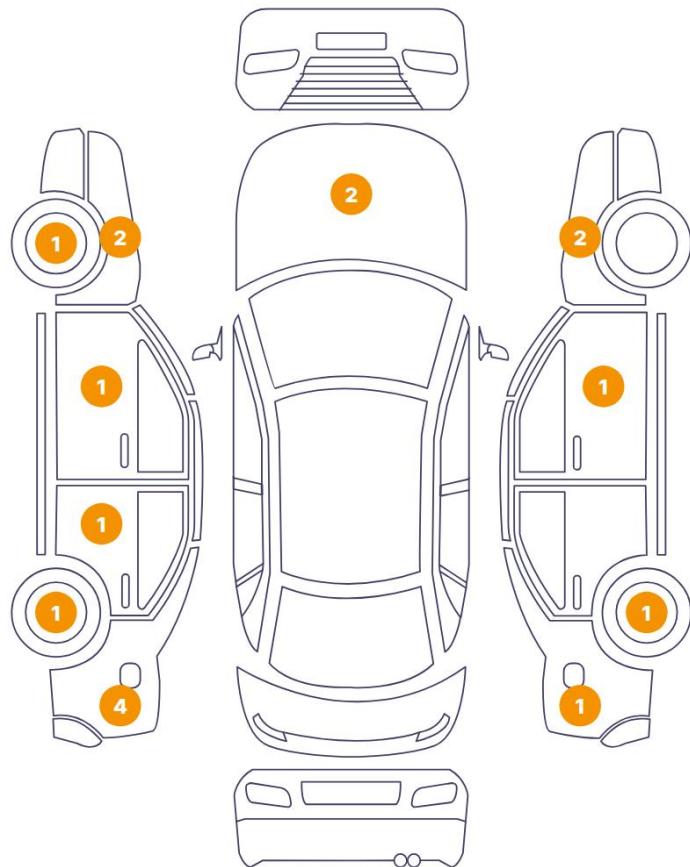

1 Schäden

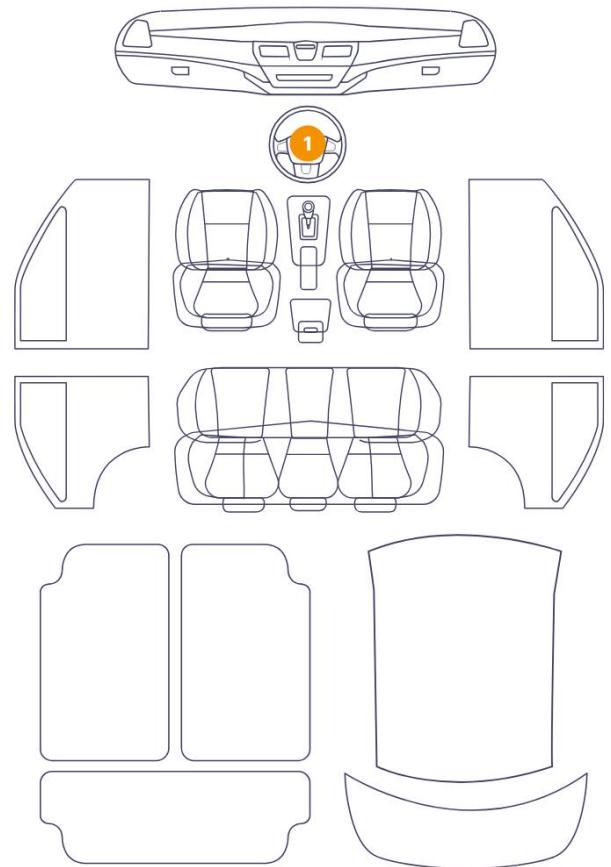

Component	Damage	Comments
1 Rim / Back Left	Out of Bodywork / Scratch	
2 Rim / Front Left	Out of Bodywork / Scratch	
3 Rim / Back Right	Out of Bodywork / Scratch	
4 Fender / Back Left	Paint / Scratch / Scuff	
5 Fender / Back Left	Paint / Scratch / Scuff	
6 Fender / Front Right	Paint / Scratch / Scuff	
7 Pillar / Front Left	Paint / Scratch / Scuff	
8 Fender / Back Left	Paint / Scratch / Scuff	
9 Fender / Back Right	Paint / Scratch / Scuff	
10 Fender / Front Right	Paint / Scratch / Scuff	
11 Fender / Front Left	Bodywork / Dent / Dent	
12 Steering Wheel / Front	Interior / Scratched	


13	Hood	Paint / Stone Chip
14	Pillar / Back Left	Paint / Scratch / Scuff
15	Fender / Back Left	Paint / Scratch / Scuff
16	Fender / Front Left	Paint / Scratch / Scuff
17	Door / Front Right	Bodywork / Dent / Dent
18	Hood	Bodywork / Dent / Dent

Vehicle Condition Imagery


[Click Here For Larger Images](#)



1. Rim / Back Left
Out of Bodywork / Scratch -

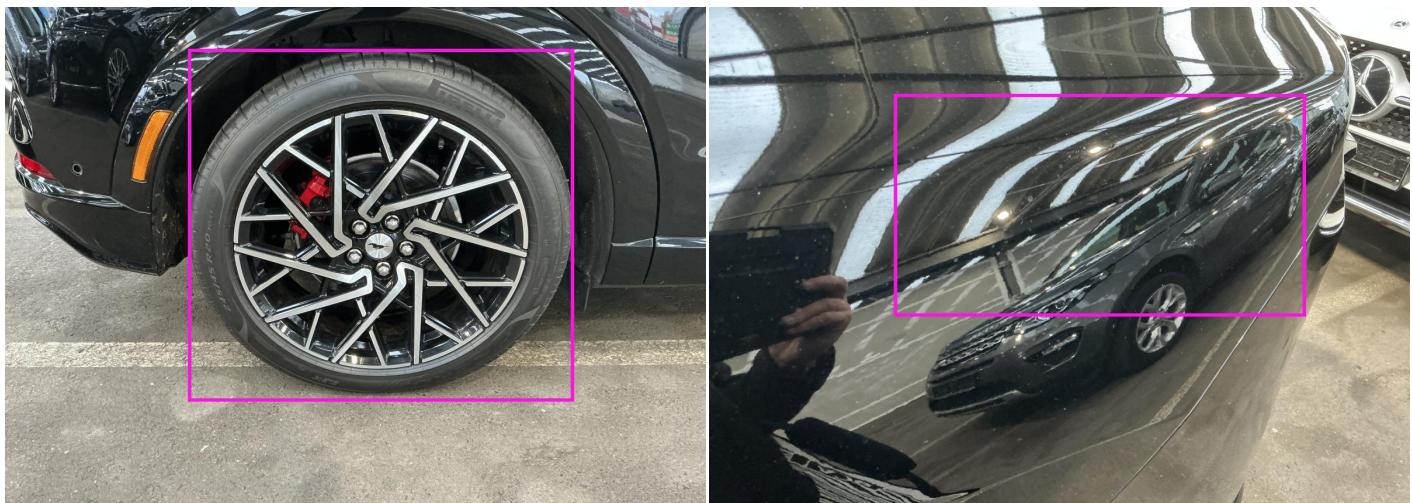


3. Rim / Back Right
Out of Bodywork / Scratch -

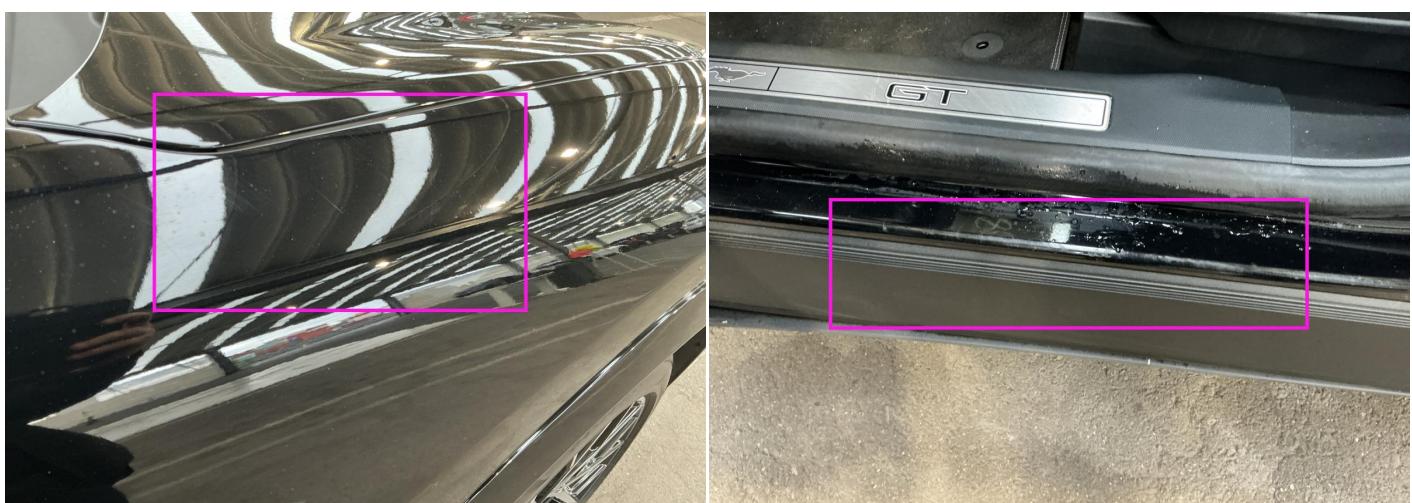

6. Fender / Front Right
Paint / Scratch / Scuff -


7. Pillar / Front Left
Paint / Scratch / Scuff -

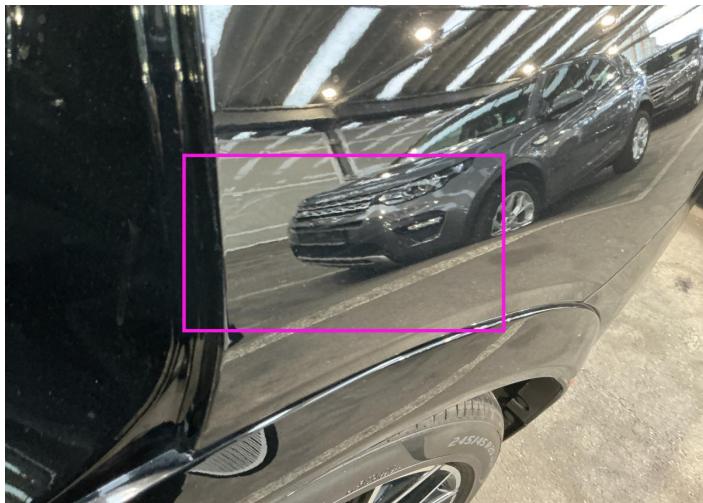


8. Fender / Back Left
Paint / Scratch / Scuff -



9. Fender / Back Right
Paint / Scratch / Scuff -

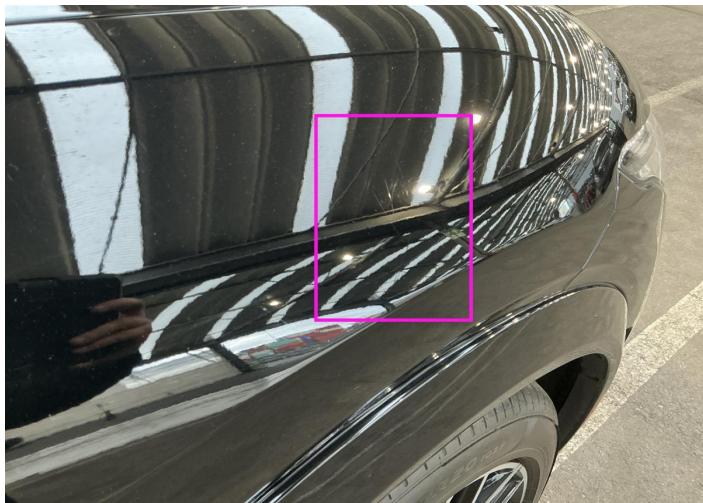

10. Fender / Front Right
Paint / Scratch / Scuff -

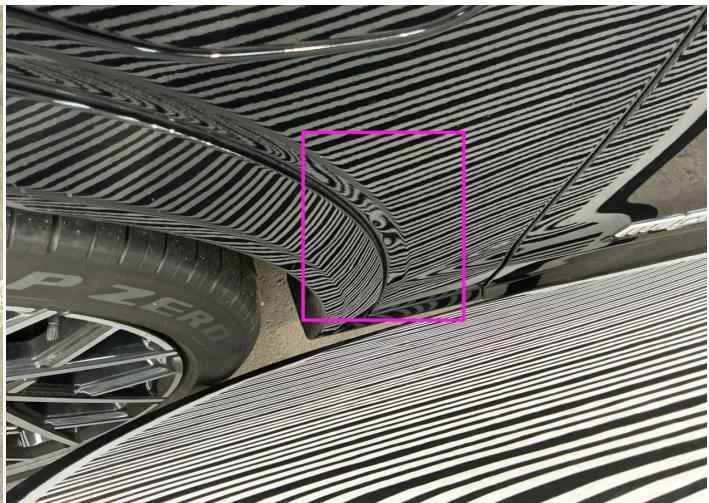


11. Fender / Front Left
Bodywork / Dent / Dent -



12. Steering Wheel / Front
Interior / Scratched -




13. Hood
Paint / Stone Chip -

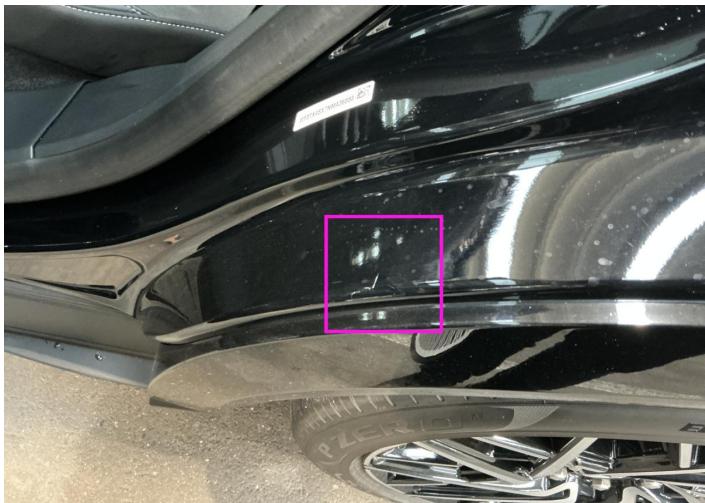

14. Pillar / Back Left
Paint / Scratch / Scuff -



15. Fender / Back Left
Paint / Scratch / Scuff -

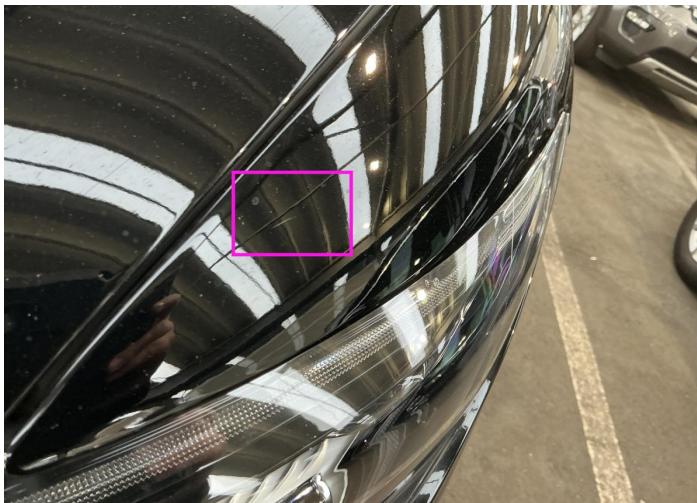

16. Fender / Front Left
Paint / Scratch / Scuff -



17. Door / Front Right
Bodywork / Dent / Dent -



18. Hood
Bodywork / Dent / Dent -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
All - wheel Drive	✓	No Dashboard Lights	✓
Display Defect	✓	Tire Pressure Monitoring System	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	NA
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Equipments Test

Electric Windows	✓	Navigation System	✓
Audio Equipment	✓	AC / Heating System	✓
Main & Spare Keys Functioning	✓	Parking Sensors / Cameras Functioning	✓

Levels

Brakes Fluid	NA	Coolant Fluid	NA
--------------	----	---------------	----

Hybrid/EV

Charge Lead Condition	✓	Charge Port Condition	✓
-----------------------	---	-----------------------	---

Test Drive Inspection

Steering Wheel

Steering | Noise / Anomaly 

Engine

The Gears Scratch / Skip / Abnormal Operation 

Brake

Brake System Anomaly 

General

Test Driven Status 

 **No troubles detected, good condition or correct tests, according to vehicle age and mileage**

 **Damages or malfunction detected that requires repairs by the buyer**

 **Not applicable**

 **Not tested**

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)