



SMART smart forfour smart forfour

VIN NO WME4540311B015330
Registration Number 311B015330



MOT Date



Last Service



Number of Owners



Last Service Mileage



Number of Keys



First Registration Date



Odometer Reading



Country First Registered



Inspection Report Summary

Customer	BCA Online	Report Number	P20250828085033
Inspection Date / Place	2025-08-28 / Dello Lübeck	Cosmetic Grade	4

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Yes
Colour	Black	Engine Size (cc)	1332
Engine Size	1.3	No of Doors	4
Body Type	Sedan	Drive Train	Front
Seat Colour		No of Seats	4
Seat Covering Name	Schwarz	Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	138
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	-	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			







Equipment

Tow ball	Anti-lock braking	Remote central locking	Sunroof
Radio	Airbag Status	Front fog lamps	Stability control
Leather steering wheel			

Equipment Details


Tow Ball Type	Detachable	Air Conditioning	Yes
Sunroof Type	Opening Panoramic		

Wheels & Tyres


Right Front Tyre Depth	4	Left Front Tyre Depth	4
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5

Cosmetic Damage

19 Schäden

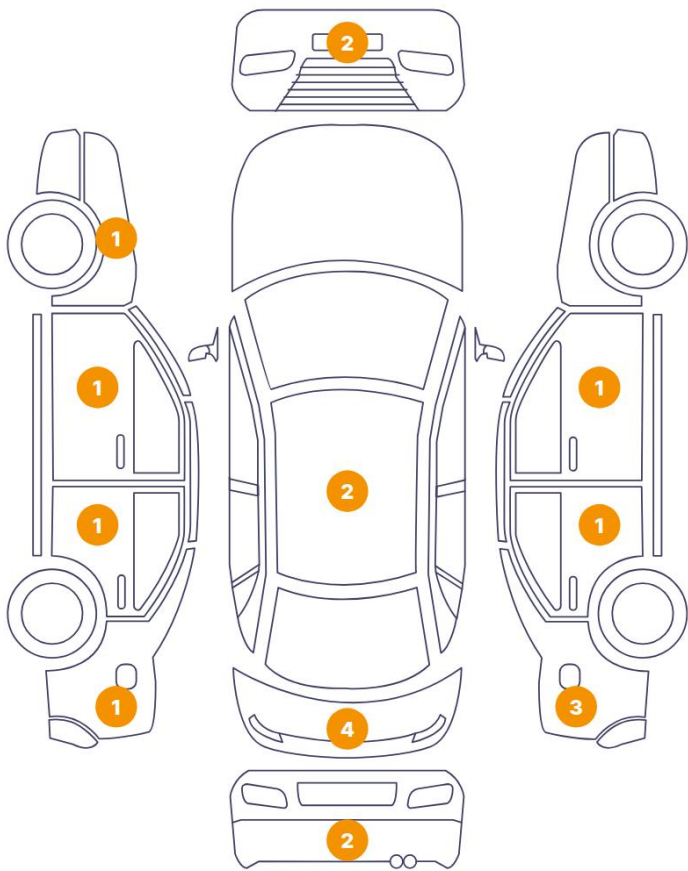

3 Schäden

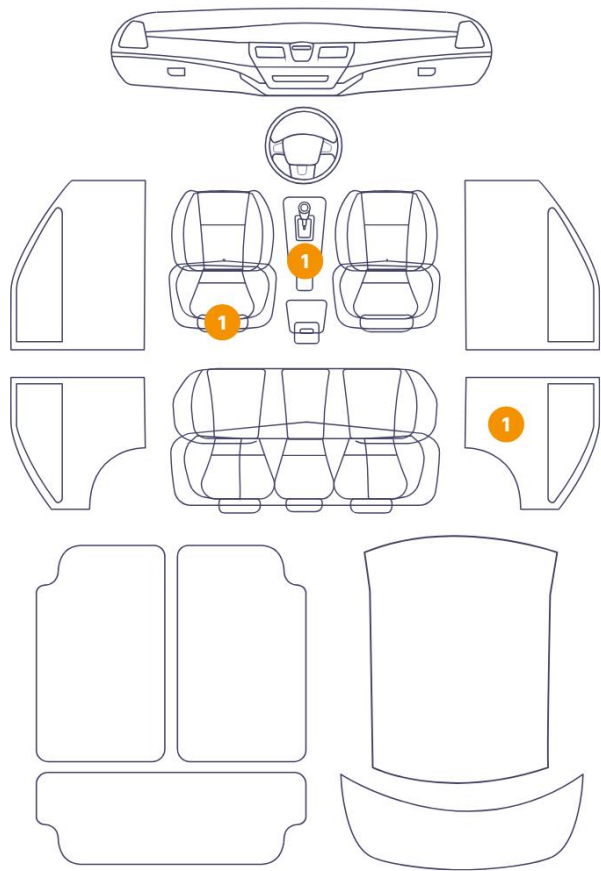


Component		Damage	Comments
1	Tailgate	Paint / Poor Previous Repair	
2	Fender / Front Left	Bodywork / Dent / Dent	
3	Mirror / Front Left	Bodywork / Breakage / Crack	
4	Side Panel / Back Left	Bodywork / Dent / Dent	
5	Tailgate	Anomalyon Element	
6	Tailgate	Anomalyon Element	
7	Side Window / Back Left	Anomalyon Element	
8	Roof	Bodywork / Dent / Hail Area	
9	Fender / Back Right	Paint / Scratch / Scuff	
10	Side Panel / Back Right	Bodywork / Dent / Dent	
11	Side Panel / Back Right	Bodywork / Dent / Dent	
12	Side Window / Back Right	Anomalyon Element	

13	Mirror / Front Right	Paint / Scratch / Scuff
14	Bumper / Front	Paint / Scratch / Scuff
15	Bumper / Front	Paint / Scratch / Scuff
16	Panel Filling / Back Right	Interior / Scratched
17	Tailgate	Paint / Corrosion
18	Bumper / Back	Paint / Scratch / Scuff
19	Bumper / Back	Paint / Scratch / Scuff
20	Seat / Front Left	Interior / Holed
21	HandBrake Handle	Interior / Ripped
22	Roof	Paint / Scratch / Scuff




1. Tailgate
Paint / Poor Previous Repair -

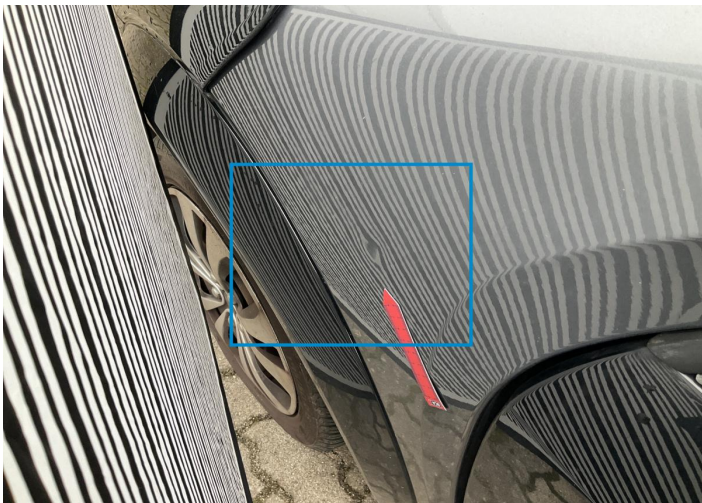

2. Fender / Front Left
Bodywork / Dent / Dent -




3. Mirror / Front Left
Bodywork / Breakage / Crack -

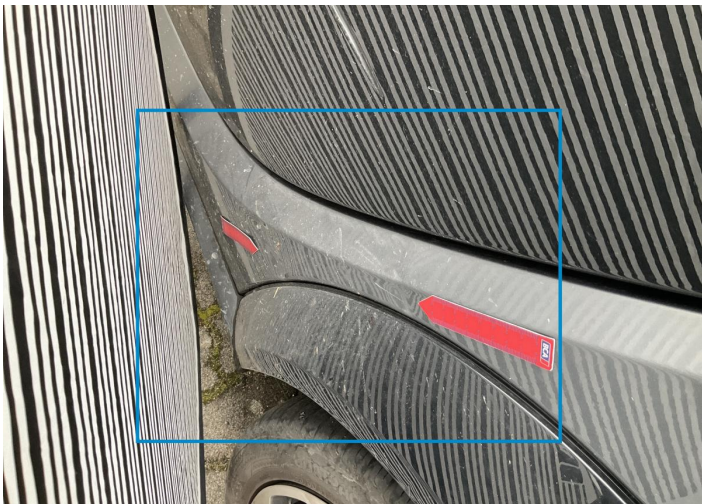

4. Side Panel / Back Left
Bodywork / Dent / Dent -



5. Tailgate
Anomalyon Element -

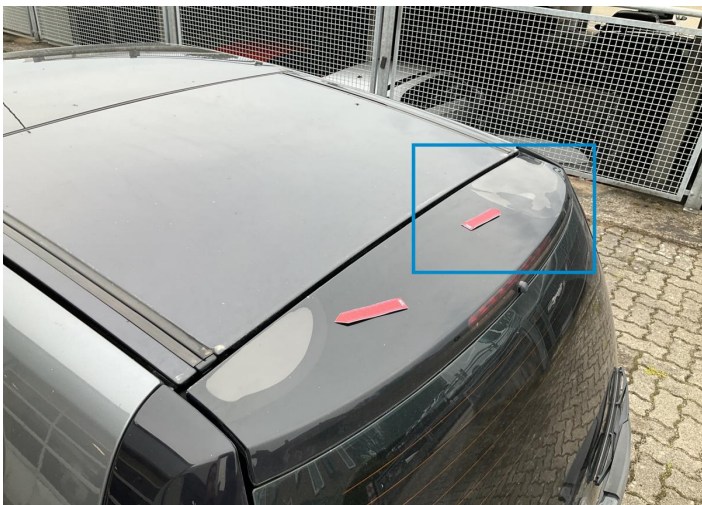

6. Tailgate
Anomalyon Element -



7. Side Window / Back Left
Anomalyon Element -




8. Roof
Bodywork / Dent / Hail Area -



9. Fender / Back Right
Paint / Scratch / Scuff -



10. Side Panel / Back Right
Bodywork / Dent / Dent -

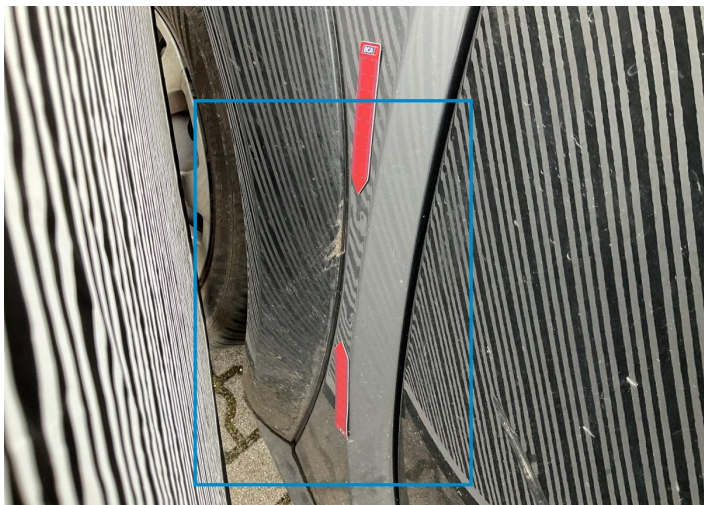

11. Side Panel / Back Right
Bodywork / Dent / Dent -



12. Side Window / Back Right
Anomalyon Element -



13. Mirror / Front Right
Paint / Scratch / Scuff -




14. Bumper / Front
Paint / Scratch / Scuff -



15. Bumper / Front
Paint / Scratch / Scuff -




16. Panel Filling / Back Right
Interior / Scratched -

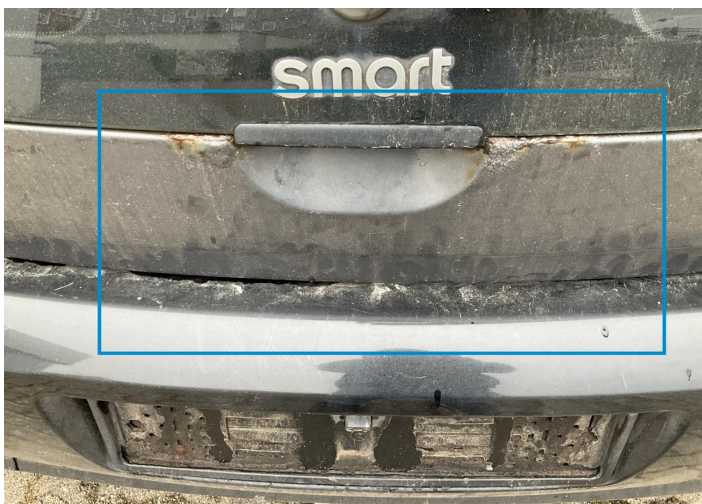

17. Tailgate
Paint / Corrosion -



18. Bumper / Back
Paint / Scratch / Scuff -

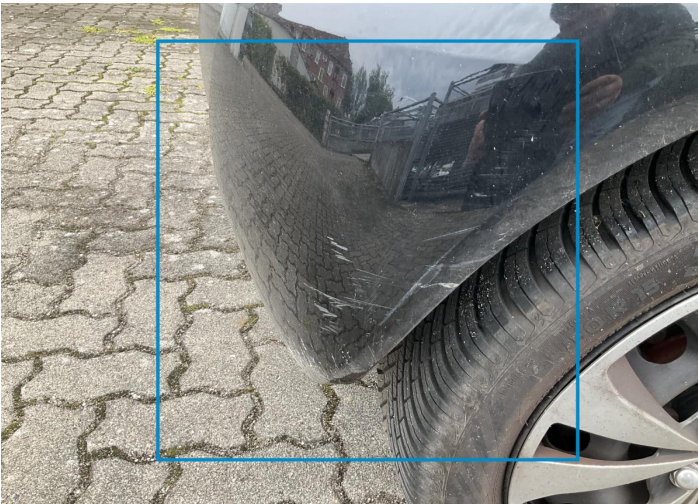

19. Bumper / Back
Paint / Scratch / Scuff -



20. Seat / Front Left
Interior / Holed -



21. HandBrake Handle
Interior / Ripped -



22. Roof
Paint / Scratch / Scuff -

Mechanical Condition

Control Lights

Display Defect	✓	Service Light	!
ABS Warning Light	!	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	!
Audio Equipment	!	AC / Heating System	✓
Other Equipments	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel

Steering | Noise / Anomaly 

Engine

Engine Noise	NA	The Gears Scratch / Skip / Abnormal Operation	NA
Fume Quantity		Power Loss	

Clutch

Clutch Functioning 

Brake

Brake System Anomaly NA

General

Test Driven Status NA

-  No troubles detected, good condition or correct tests, according to vehicle age and mileage
-  Damages or malfunction detected that requires repairs by the buyer
- NA Not applicable
-  Not tested

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)