

MINI Mini Countryman F60 2020 Diese

Mini Countryman 1.5 One D Business auto

VIN NO WMW21BT0303M75800

Registration Number GE444EN



MOT Date

2025-02-27

Last Service



Number of Owners



Last Service Mileage



Number of Keys



First Registration Date

2021-02-26

Odometer Reading

98956 km

Country First Registered

Italy

Inspection Report Summary

Customer	BCA Lodi	Report Number	P20250925165855
Inspection Date / Place	2025-09-25 / BCA Lodi	Cosmetic Grade	5

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Gearbox Type	Sequential
Colour	Black	Engine Size (cc)	1496
Engine Size	1.5	No of Doors	5
Body Type	SUV	Drive Train	Front
Seat Colour	Black	No of Seats	5
Seat Covering Name		Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	106

Vehicle History & Documents

Service Book Available	-	Next Service Mileage	km
Previous Usage	Normal Use	Imported	No
Manufacturer Warrenty			

Equipment

Central locking	Rear parking sensors	Digital Radio	Satellite navigation
Parcel Shef	Remote central locking	Trip Computer	Stability control
Power assisted steering	Alloys wheels	Electrically folding wing mirrors	Volante multifuncion
Remote adjusting wing mirrors	Cruise control	Tyre Mobility Kit	


Wheels & Tyres

Mounted Tires


Tyre / Wheel Type	Summer	
	PIRELLI PIRELLI-CINTURATO P7	225/55//R17 - 97Y / 2 mm
	PIRELLI PIRELLI-CINTURATO P7	225/55//R17 - 97Y / 2 mm
	PIRELLI PIRELLI-CINTURATO P7	225/55//R17 - 97Y / 3 mm
	PIRELLI PIRELLI-CINTURATO P7	225/55//R17 - 97Y / 3 mm

Cosmetic Damage

17 Danni

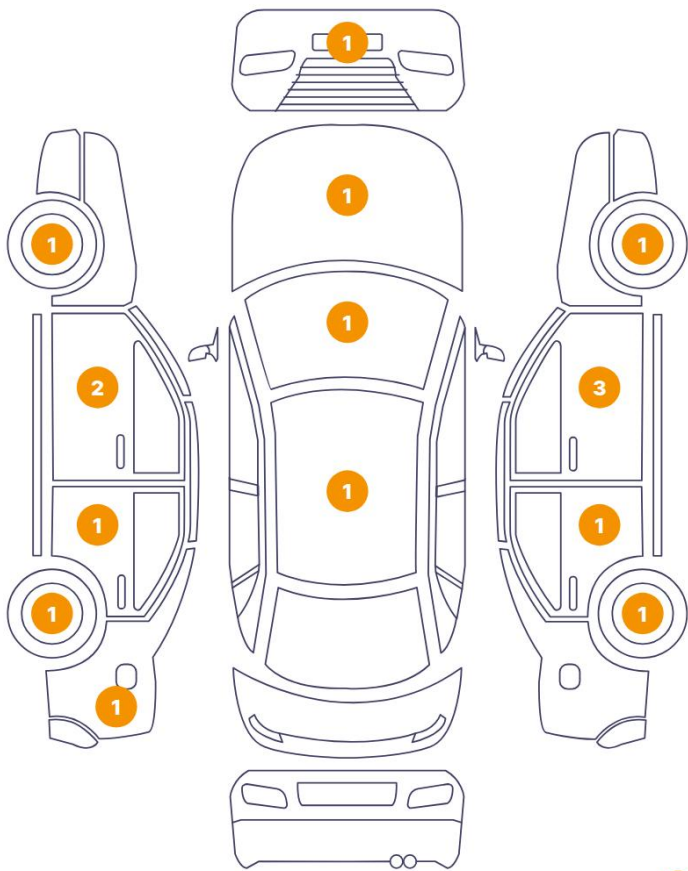


1 Danni

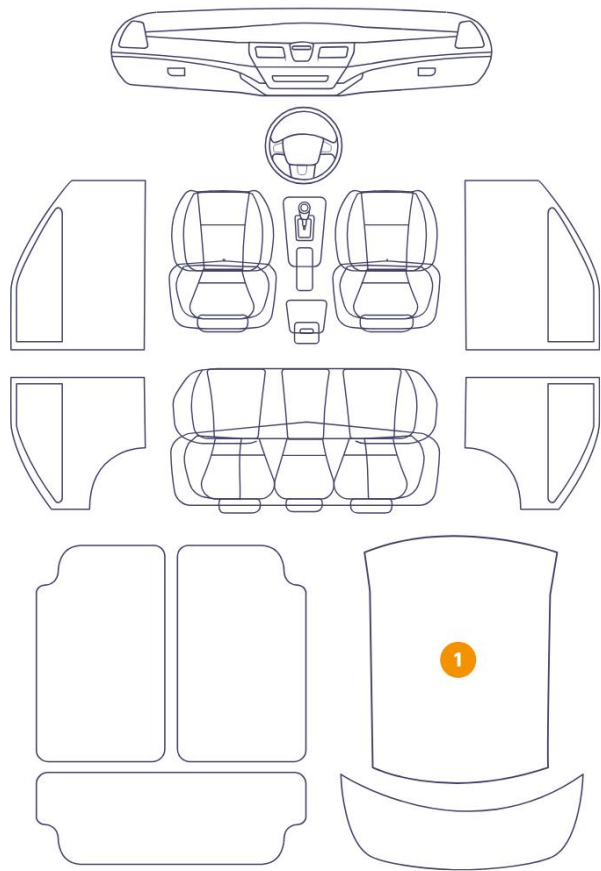

Component		Damage	Comments
1	Roof Upholstery	Interior / Scratched	
2	Hood	Bodywork / Dent / Hail Area	
3	Bumper / Front	Bodywork / Dent	
4	Rim / Front Right	Out of Bodywork / Scratch	
5	Mirror Shell / Front Right	Paint / Scratch / Line	
6	Windshield / Front	Glass Break / Impact	
7	Rim / Front Left	Out of Bodywork / Scratch	
8	Door / Front Left	Bodywork / Poor Previous Repair	
9	Door / Back Left	Paint / Scratch / Line	
10	Rim / Back Left	Out of Bodywork / Scratch	
11	Fender / Back Left	Bodywork / Dent / Hail Area	
12	Pillar / Front Left	Bodywork / Dent / Hail Area	

13	Rim / Back Right	Out of Bodywork / Scratch
14	Door / Back Right	Bodywork / Poor Previous Repair
15	Door / Front Right	Bodywork / Dent
16	Other	Bodywork / Dent / Hail Area
17	Pillar / Front Right	Bodywork / Dent / Hail Area
18	Roof	Bodywork / Dent / Hail Area

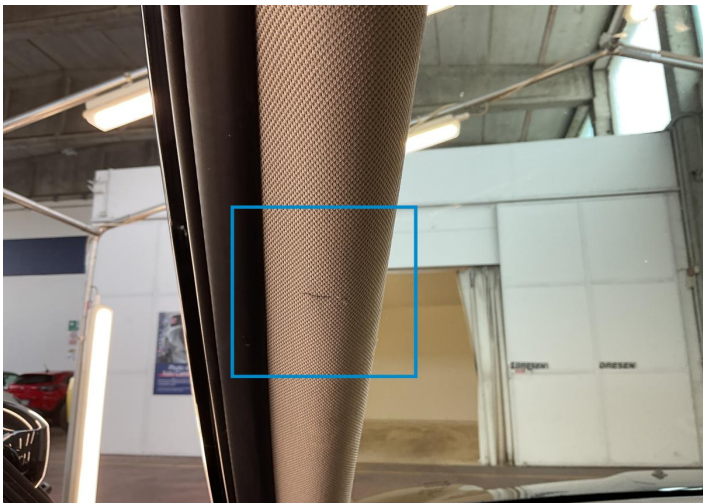

1. Roof Upholstery
Interior / Scratched -




2. Hood
Bodywork / Dent / Hail Area -



3. Bumper / Front
Bodywork / Dent -



4. Rim / Front Right
Out of Bodywork / Scratch -

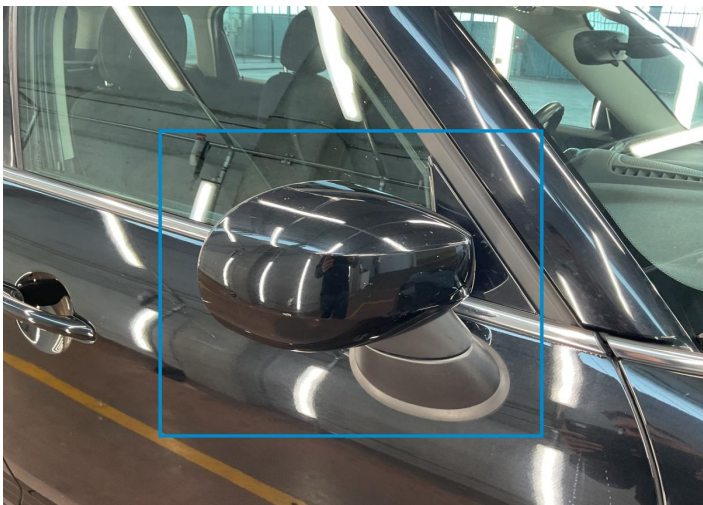

5. Mirror Shell / Front Right
Paint / Scratch / Line -



6. Windshield / Front
Glass Break / Impact -



7. Rim / Front Left
Out of Bodywork / Scratch -




8. Door / Front Left
Bodywork / Poor Previous Repair -




9. Door / Back Left
Paint / Scratch / Line -



10. Rim / Back Left
Out of Bodywork / Scratch -

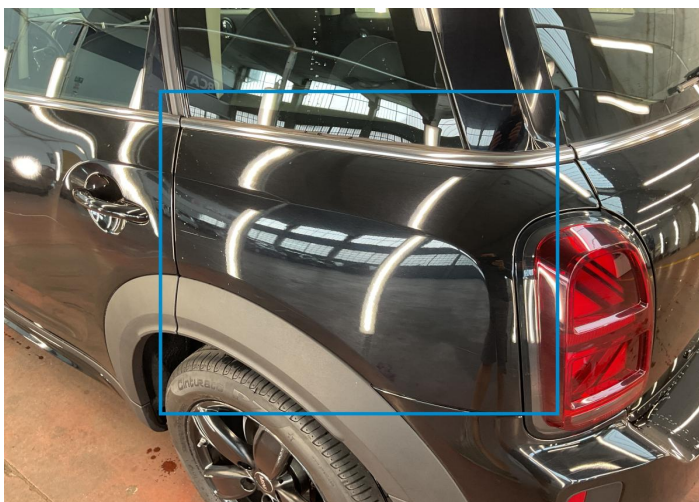

11. Fender / Back Left
Bodywork / Dent / Hail Area -

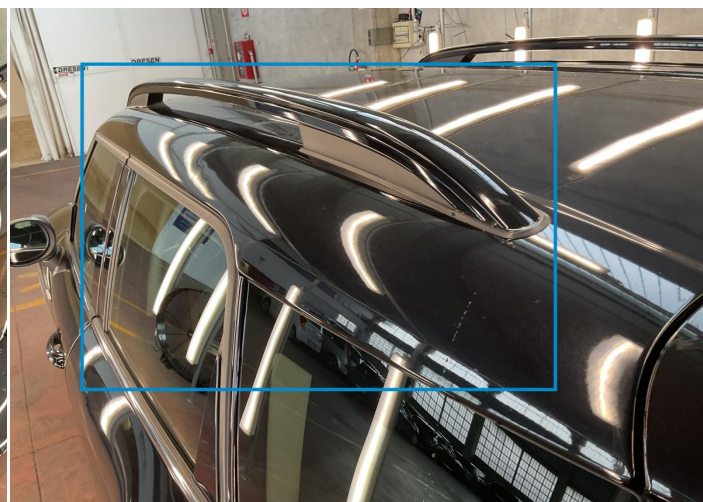

12. Pillar / Front Left
Bodywork / Dent / Hail Area -



13. Rim / Back Right
Out of Bodywork / Scratch -



14. Door / Back Right
Bodywork / Poor Previous Repair -



15. Door / Front Right
Bodywork / Dent -



16.
Bodywork / Dent / Hail Area -



17. Pillar / Front Right
Bodywork / Dent / Hail Area -



18. Roof
Bodywork / Dent / Hail Area -

Mechanical Condition

Engine			
Vehicle Start - up	✓	Engine Starts	✓
Engine Leak Visible	✓		
Clutch			
Clutch Functioning	✓		
Equipments Test			
Other Equipments	✓	AC / Heating System	✓
Levels			
Brakes Fluid	✓	Coolant Fluid	✓

Test Drive Inspection

Other Checks			
Brakes	✓	Steering	✓
Suspension	✓		
Gearbox			
Manual Gearbox	✓		
General			
Test Driven Status	✓	Test Drive Comment	BATTERY KO
Equipments Test			
Steering Noise / Anomaly	✓		
Engine			
Power Loss	✓	Fume Quantity	✓
Engine Noise	!		
✓ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
☐ Not tested			