



MINI COUNTRYMAN

Mini Cooper S Countryman All4

VIN NO WMWZC510X0WK77341
Registration Number 0X0WK77341



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2026-07-01	3	2	70959 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-03-16	62476	2014-09-25	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20251009102406
Inspection Date / Place	2025-10-09 / BCA Oberndorf	Cosmetic Grade	2

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Yes
Colour	Black	Engine Size (cc)	1598
Engine Size	1.6	No of Doors	5
Body Type	Sedan	Drive Train	All-Wheel-Drive permanent
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz/ Rot	Seat Covering	Cloth/Leather
Charging Cables		NEDC CO2 Rating (q/km)	148
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





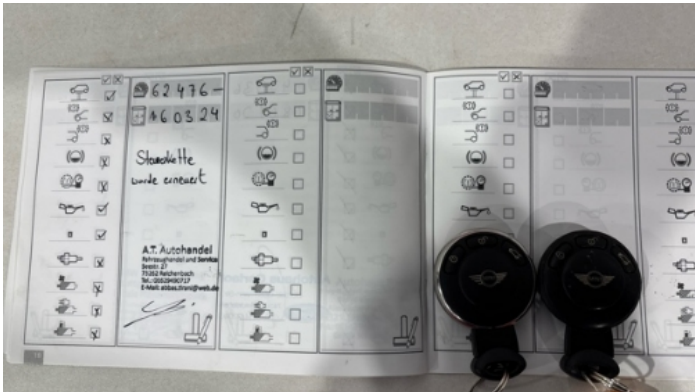

Equipment

Tinted Glass	Airbag Status	Anti-lock braking	Bluetooth telephone interface
Front fog lamps	Remote central locking	Stability control	Xenon headlamps
Central locking	Radio	USB Socket	Alloys wheels
Auxiliary Socket	Cruise control	Remote adjusting wing mirrors	Split folding rear seats
Sunroof	CD Player	Leather steering wheel	Rear parking sensors

Equipment Details

Air Conditioning	Climate Control	Alloy Wheel Size	18
Seat Heating	Front	Sunroof Type	Opening Panoramic

Wheels & Tyres

Left Rear Tyre Depth	6	Right Front Tyre Depth	6
Left Front Tyre Depth	6	Right Rear Tyre Depth	6

Cosmetic Damage

	Component	Damage	Comments
1	Blade/spoiler / Front	Paint / Scratch / Scuff	
2	Corner Bumper / Back Left	Paint / Scratch / Scuff	
3	Hood	Bodywork / Dent / Dent	
4	Door Edge / Back Left	Paint / Scratch / Line	
5	Monogram/Emblem / Back Center	Paint / Scratch / Scuff	
6	Other	Paint / Other	
7	Door Edge / Back Right	Bodywork / Dent / Dent	
8	Other	Paint / Scratch / Scuff	
9	Tailgate	Bodywork / Dent / Dent	
10	Corner Bumper / Front Left	Paint / Stone Chip	



1. Blade/spoiler / Front
Paint / Scratch / Scuff -



2. Corner Bumper / Back Left
Paint / Scratch / Scuff -




3. Hood
Bodywork / Dent / Dent -



4. Door Edge / Back Left
Paint / Scratch / Line -



5. Monogram/Emblem / Back Center
Paint / Scratch / Scuff -

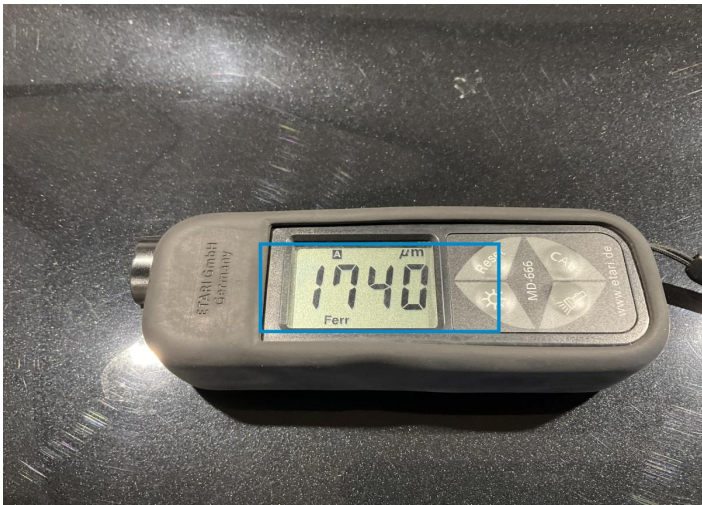

6.
Paint / Other -



7. Door Edge / Back Right
Bodywork / Dent / Dent -



8.
Paint / Scratch / Scuff -



9. Tailgate
Bodywork / Dent / Dent -



10. Corner Bumper / Front Left
Paint / Stone Chip -

Mechanical Condition

Equipments Test

Central Locking	✓	Electric Windows	✓
Audio Equipment	✓	AC / Heating System	✓
Main & Spare Keys Functioning	✓	Parking Sensors / Cameras Functioning	✓
Other Equipments	✓		

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	✓
Tire Pressure Monitoring System	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	!
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel

Steering | Noise / Anomaly

Engine

Engine Noise The Gears Scratch / Skip / Abnormal Operation

Fume Quantity Power Loss

Brake

Brake System Anomaly

Clutch

Clutch Functioning

General

Test Driven Status Not Performed

- No troubles detected, good condition or correct tests, according to vehicle age and mileage
- Damages or malfunction detected that requires repairs by the buyer
- Not applicable
- Not tested

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)