

VW CADDY MAXI LIFE 2.0 TDI BLUEMOTION

Vehicle information

License plate	GJP112	Inspected by	A.H.
Year model	2019	Date of inspection	2025-03-13
Manuf. year/month	2018-10	City	Falkenberg
First day in traffic	2018-10	Keys	2
Colour	Vit	Service book	Elektronisk servicebok
Mileage	299 770 km	Latest service	2024-02-12
Fuel	Diesel	Mileage at the latest service	254 010 km
Transmission	DSG Sekventiell	Summer tires	16" plåtfälg 6/6/7/7
Engine effect	75 kW	Winter tires	plåtfälg dubbat 6/4/4/6

Damages

Location	Damage	Comments	Costs excluding VAT
Other, Other	Other	Sliten ratt	-
Wing, Rear left	Scratches 30-100 mm		100 €
Door, Rear left	Dents below 30 mm	Vänster transport dörr	70 €
Bumper, Rear	Small scratches, under 3 cm		70 €
Door, Right sliding door	Scratches below 30 mm		70 €
Door, Righ side mirror	Paint retouch traces		10 €
Bonnet	Chip		70 €
Glass, Windshield	Cracks small (max 30 mm)		270 €
Tak, Tak	Chip	Rost	70 €
Other, Other	Other	NOx givare AdBlue motor lampan kom tillbaka	-
Other, Other	Other	Missljud hjullager fram	-
Brakes and Chassi, Brakes front	Worn brake discs	Kraftigt Broms vibrationer fram vid inbromsning	360 €
Brakes and Chassi, Brakes front	Worn brake pads		180 €
Total excl. VAT			1 270 €

Service occasions

3500-mil, 8000-mil, 15000-mil

Images

[See all images in large format](#)












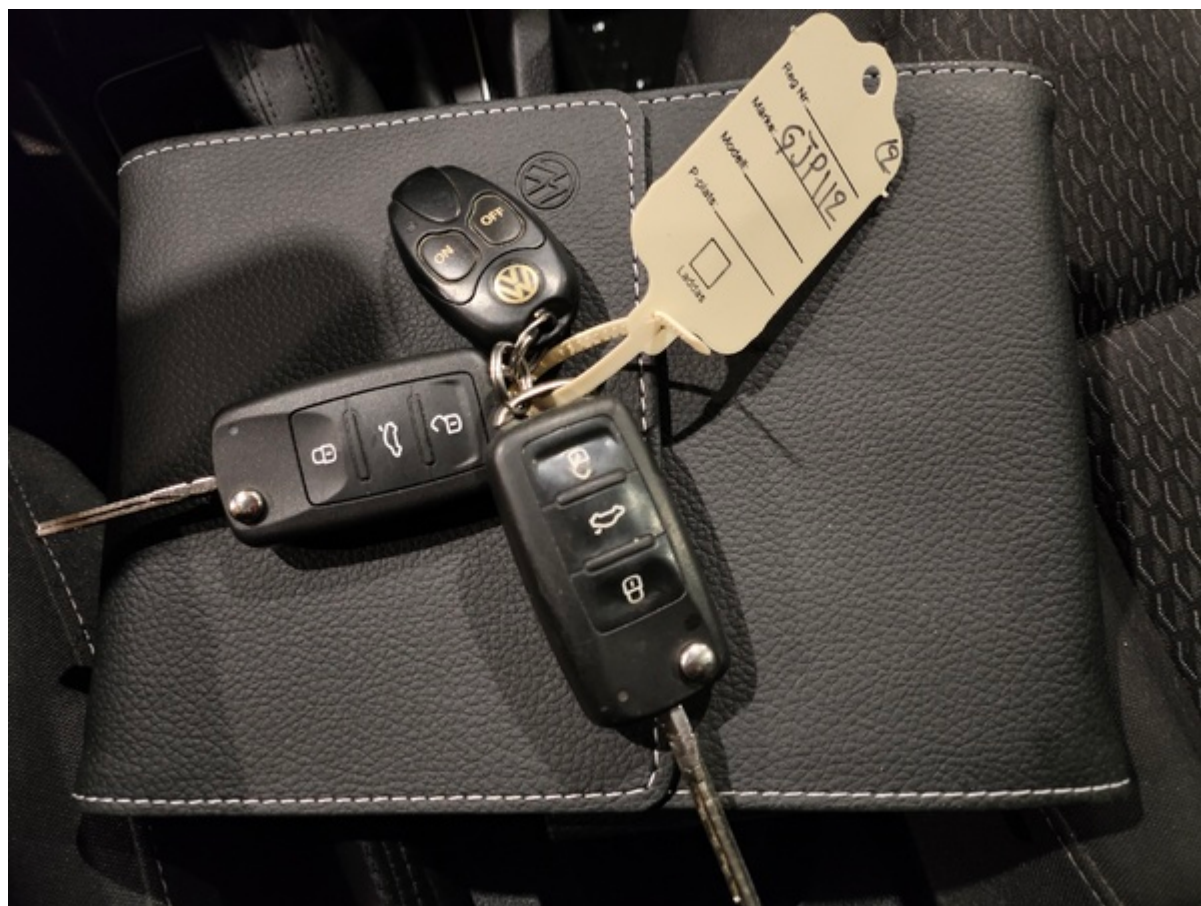

Serviceprotokoll			
Ordernr 549775	Modellkod SAJT26	Registreringsnr GJP112	Registrering 2018-11-23
Chassinummer WV2ZZZ2KZKX039182	MMB DFSD	Mätarställning 254010	Serviceraådgivare 
Modellkod Caddy Maxi KOTrend 75 CRD AG6	VMB SYB	Årsmodell 2019	Datum 12.02.2024
Inspektion med oljebyte (flexibel)			
		Ok/genomförd	Inte ok åtgärdat
Direktväxellåda (DSG): Byta DSG-olja och filter		☒	☐ ☐
Elsystem		Ok/genomförd	Inte ok åtgärdat
Batteri: Kontrollera med batteriprovaren VAS 6161 (rephandboken måste beaktas)		☒	☐ ☐





Övrigt Övrigt Övrigt Sliten ratt



Skärm Vänster bak Repor 3-10 cm 1 100 kr



Dörr Vänster bak Bucklor under 3 cm Vänster transport dörr 800 kr



Stötfångare Bak Repor små, under 3 cm 800 kr



Dörr Höger skjutdörr Repor under 3 cm 800 kr



Dörr Höger backspegel Lackbättring 50 kr




Motorhuv Stenskott 800 kr



Glas Vindruta Sprickor små (max 3 cm) 3 000 kr



Tak Tak Stenskott Rost 800 kr

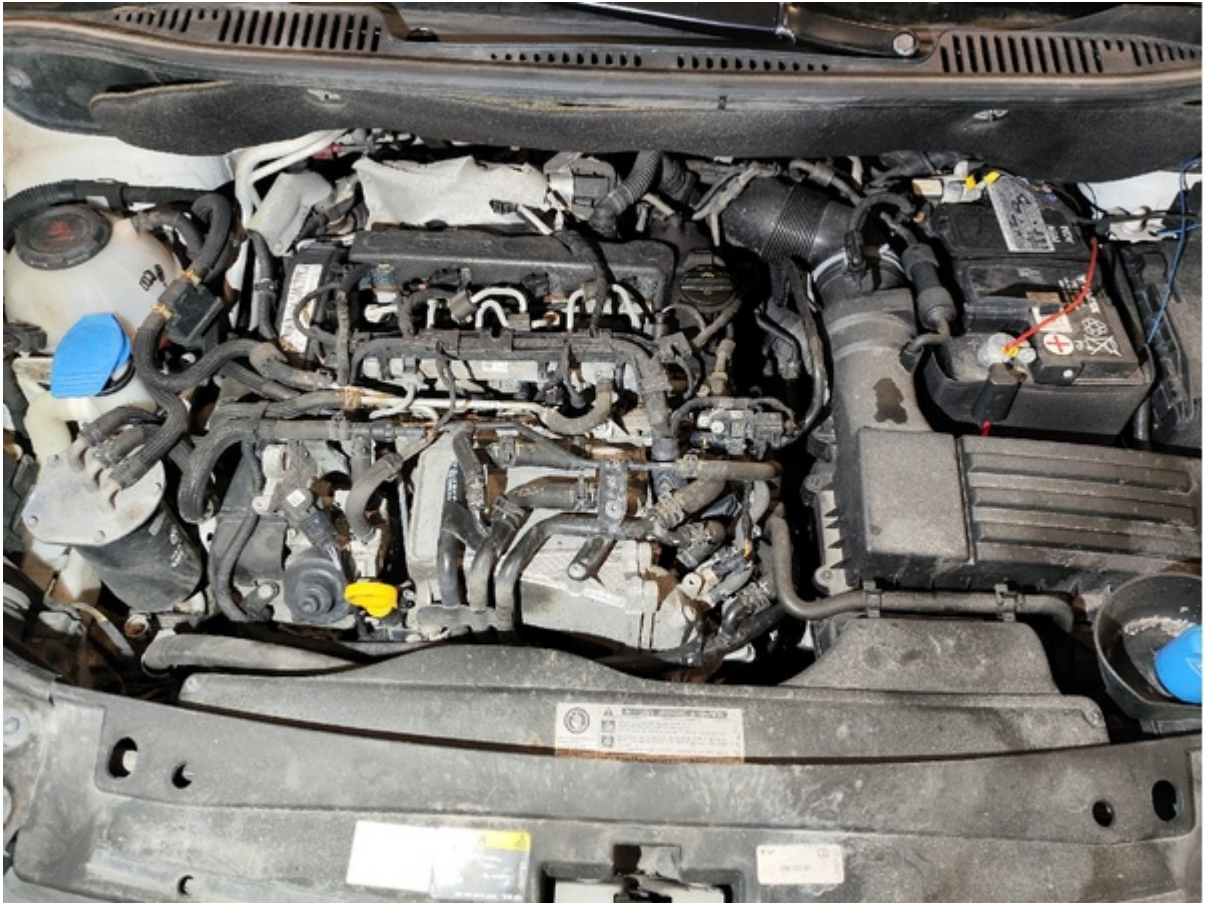





V11.20

Volkswagen CV > Automatiskt val > Auto scan

Systemlista

DTCs: 1

VCB 11.9V

100%

1 01 - Motorelektronik

Fel 1



U029E NOx-sensor 2 ingen kommunikation

Aktiv/statisk

2 02 - Växellådslektronik

Passering |
Inget fel

3 03 - Bromselektronik

Passering |
Inget fel

4 08 - Klimat-/värmeelektronik

Passering |
Inget fel

5 09 - Elektronisk centralelektronik

Passering |
Inget fel

6 10 - Parkeringshjälp 2

Passering |
Inget fel

7 13 - Distansreglering

Passering |
Inget fel

8 15 - Airbag

Passering |
Inget felChassi nr:
WVZZZZKX039182
Info:
Volkswagen-transportbilar/SA-
Pedia 2015

Fjärrexpert

Rapport

Snabb
radering

Felskanning

Änge
system

ESC

100% 07:30