



# VOLKSWAGEN Tiguan

## Tiguan 1.4 TSI 4Motion

VIN NO WVGBV3AX7DW581941  
Registration Number X7DW581941



MOT Date



Last Service



Number of Owners




Last Service Mileage




Number of Keys



First Registration Date



Odometer Reading



Country First Registered



### Inspection Report Summary

|                         |                        |                |                 |
|-------------------------|------------------------|----------------|-----------------|
| Customer                | BCA Online             | Report Number  | P20250911090834 |
| Inspection Date / Place | 2025-09-11 / BCA Neuss | Cosmetic Grade | 9               |

### Vehicle Summary

|                    |           |                        |                           |
|--------------------|-----------|------------------------|---------------------------|
| Vehicle Condition  | Runner    | VAT Type               | Margin                    |
| Fuel Type          | Petrol    | Road Worthy            | Yes                       |
| Colour             | Black     | Engine Size (cc)       | 1390                      |
| Engine Size        | 1.4       | No of Doors            | 5                         |
| Body Type          | SUV       | Drive Train            | All-Wheel-Drive permanent |
| Seat Colour        |           | No of Seats            | 5                         |
| Seat Covering Name | Beige     | Seat Covering          | Synthetic Leather         |
| Charging Cables    |           | NEDC CO2 Rating (q/km) | 178                       |
| Gearbox Type       | Automatic |                        |                           |



### Vehicle History & Documents

|                        |         |                      |    |
|------------------------|---------|----------------------|----|
| Service Book Available | Missing | Next Service Mileage | km |
| Previous Usage         |         | Imported             | No |
| Manufacturer Warrenty  |         |                      |    |







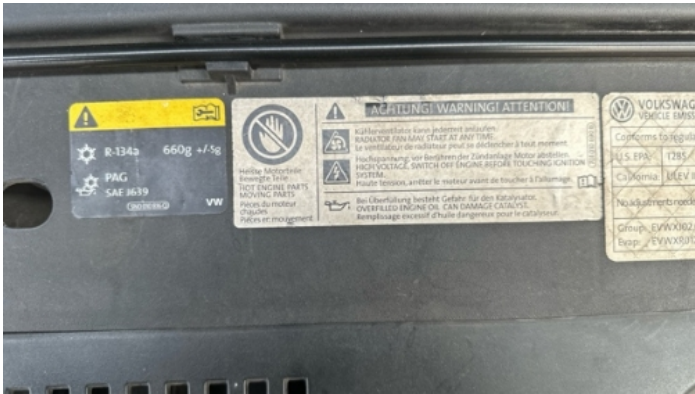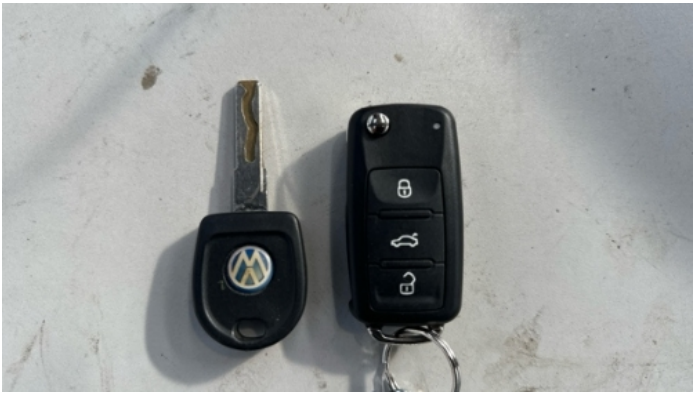



Equipment


|                               |                      |                        |                        |
|-------------------------------|----------------------|------------------------|------------------------|
| Airbag Status                 | Anti-lock braking    | Heated wing mirrors    | Remote central locking |
| Stability control             | Rear parking sensors | Alloys wheels          | Cruise control         |
| Remote adjusting wing mirrors | Roof rails           | Leather steering wheel |                        |

Equipment Details


|                        |              |                  |       |
|------------------------|--------------|------------------|-------|
| Air Conditioning       | Yes          | Alloy Wheel Size | 18    |
| Extra Wheel / Tyre Set | Winter Tyres | Seat Heating     | Front |

Cosmetic Damage

29 Schäden

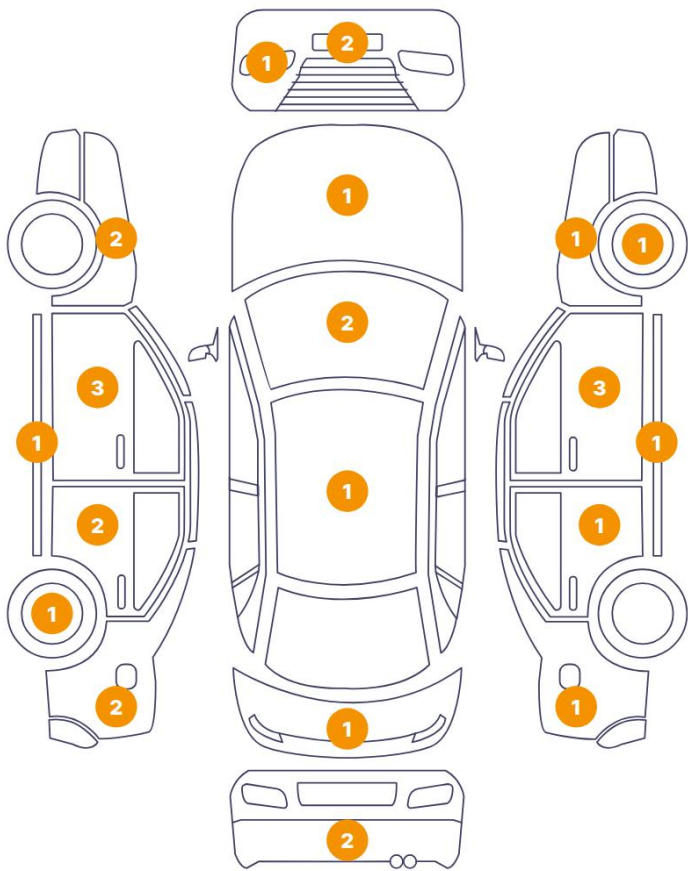


4 Schäden

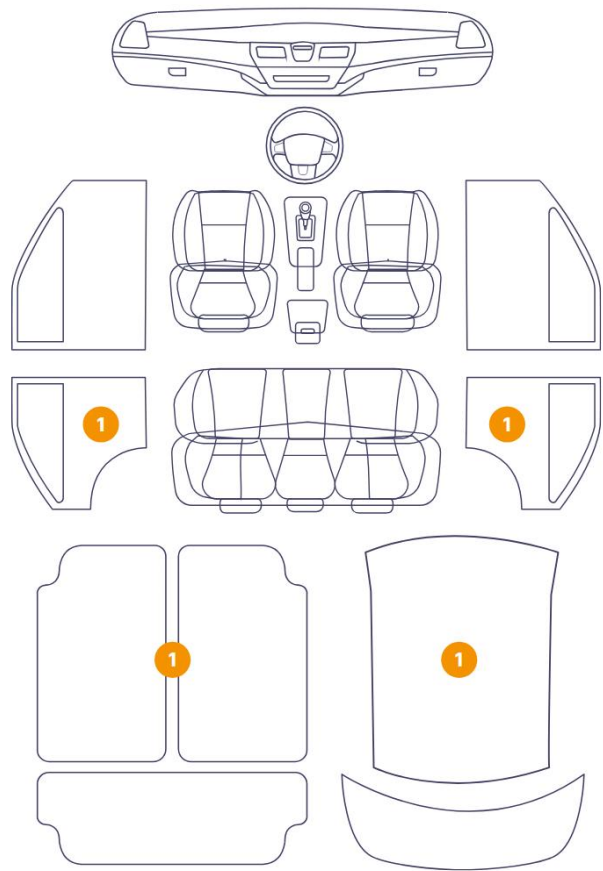

| Component |                            | Damage                       | Comments |
|-----------|----------------------------|------------------------------|----------|
| 1         | Hood                       | Paint / Poor Previous Repair |          |
| 2         | Wing Repeater / Left       | Paint / Poor Previous Repair |          |
| 3         | Door / Front Left          | Paint / Poor Previous Repair |          |
| 4         | Door / Back Left           | Paint / Poor Previous Repair |          |
| 5         | Fender / Back Left         | Paint / Poor Previous Repair |          |
| 6         | Fender / Front Right       | Paint / Poor Previous Repair |          |
| 7         | Door / Front Right         | Paint / Poor Previous Repair |          |
| 8         | Rim / Front Right          | Out of Bodywork / Scratch    |          |
| 9         | Bumper / Front             | Paint / Poor Previous Repair |          |
| 10        | Corner Bumper / Front Left | Bodywork / Breakage / Crack  |          |
| 11        | Front Light / Front Left   | Glass Break                  |          |
| 12        | Windshield / Front         | Glass Break / Impact         |          |

|    |                             |                             |
|----|-----------------------------|-----------------------------|
| 13 | Windshield Joint / Front    | Paint / Chemical Damage     |
| 14 | Roof                        | Paint / Corrosion           |
| 15 | Wing Stick / Front Left     | Bodywork / Breakage / Crack |
| 16 | Door / Front Left           | Paint / Scratch / Scuff     |
| 17 | Door / Front Left           | Bodywork / Dent / Dent      |
| 18 | Rocker Panel / Center Left  | Bodywork / Dent / Dent      |
| 19 | Door / Back Left            | Bodywork / Dent / Dent      |
| 20 | Panel Filling / Back Left   | Interior / Broken           |
| 21 | Rim / Back Left             | Out of Bodywork / Scratch   |
| 22 | Side Panel / Back Left      | Paint / Scratch / Scuff     |
| 23 | Tailgate                    | Bodywork / Dent / Dent      |
| 24 | Floor Carpet                | Interior / Holed            |
| 25 | Bumper / Back               | Paint / Scratch / Scuff     |
| 26 | Corner Bumper / Back Right  | Bodywork / Breakage / Crack |
| 27 | Fender / Back Right         | Bodywork / Dent / Dent      |
| 28 | Door / Back Right           | Bodywork / Dent / Dent      |
| 29 | Panel Filling / Back Right  | Interior / Broken           |
| 30 | Door / Front Right          | Bodywork / Dent / Dent      |
| 31 | Mirror Repeater / Right     | Paint / Scratch / Scuff     |
| 32 | Rocker Panel / Center Right | Bodywork / Dent / Dent      |
| 33 | Roof Upholstery             | Interior / Broken           |

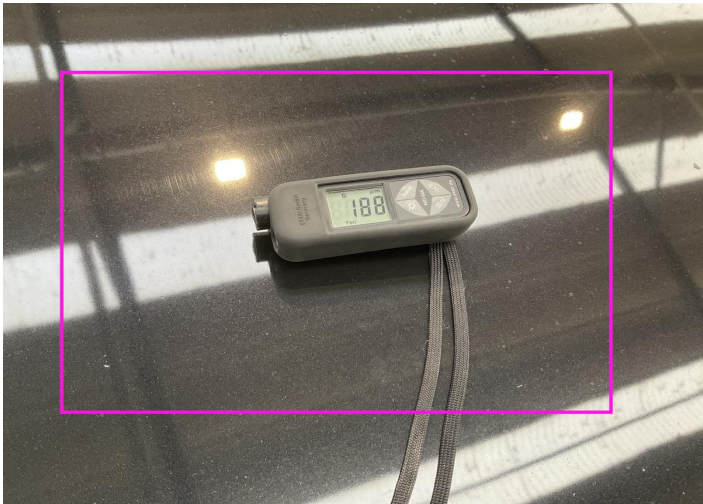

1. Hood  
Paint / Poor Previous Repair -



2. Wing Repeater / Left  
Paint / Poor Previous Repair -



3. Door / Front Left  
Paint / Poor Previous Repair -



4. Door / Back Left  
Paint / Poor Previous Repair -



5. Fender / Back Left  
Paint / Poor Previous Repair -



6. Fender / Front Right  
Paint / Poor Previous Repair -





7. Door / Front Right  
Paint / Poor Previous Repair -




8. Rim / Front Right  
Out of Bodywork / Scratch -




9. Bumper / Front  
Paint / Poor Previous Repair -



10. Corner Bumper / Front Left  
Bodywork / Breakage / Crack -

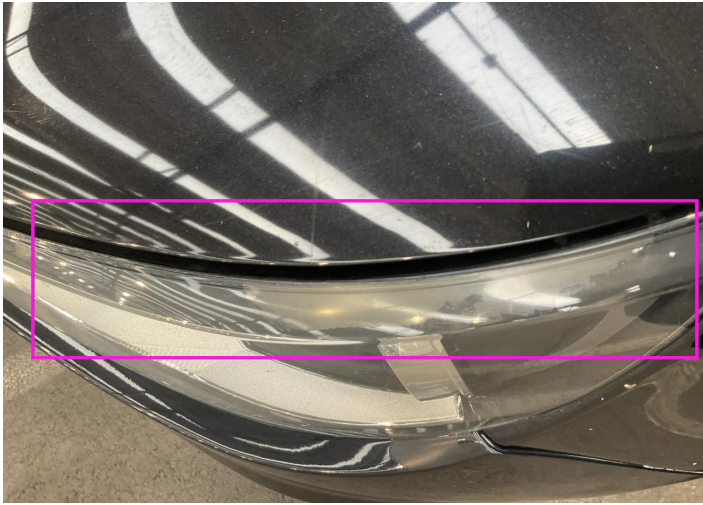


11. Front Light / Front Left  
Glass Break -

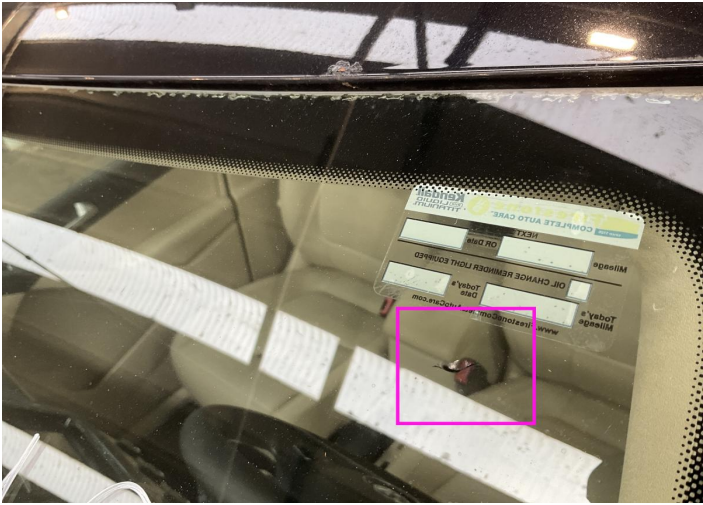

12. Windshield / Front  
Glass Break / Impact -



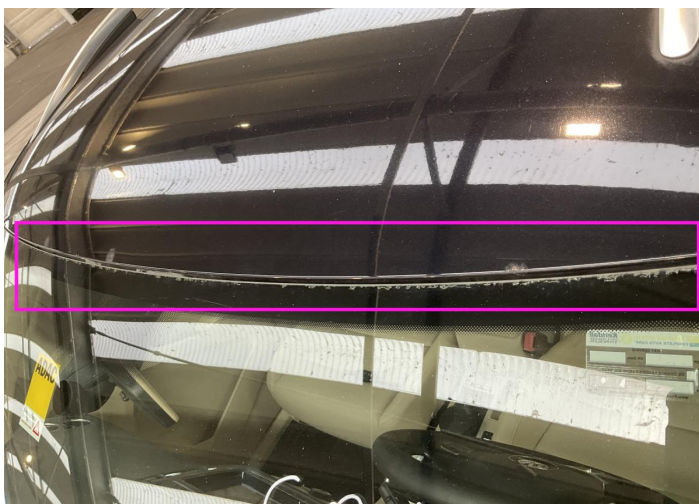

13. Windshield Joint / Front  
Paint / Chemical Damage -




14. Roof  
Paint / Corrosion -



15. Wing Stick / Front Left  
Bodywork / Breakage / Crack -



16. Door / Front Left  
Paint / Scratch / Scuff -

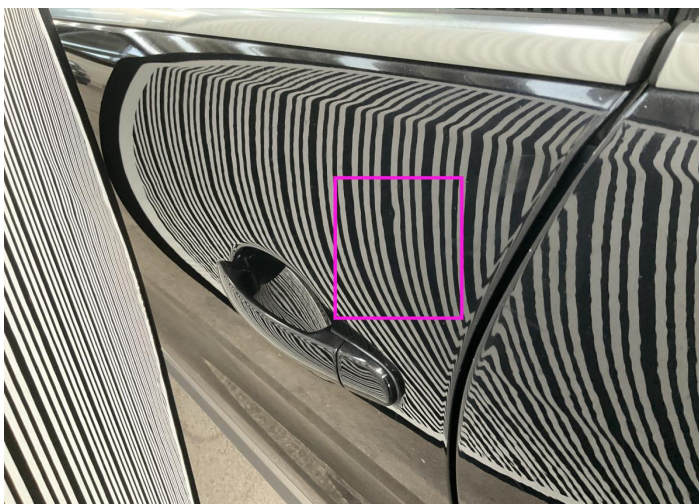


17. Door / Front Left  
Bodywork / Dent / Dent -



18. Rocker Panel / Center Left  
Bodywork / Dent / Dent -



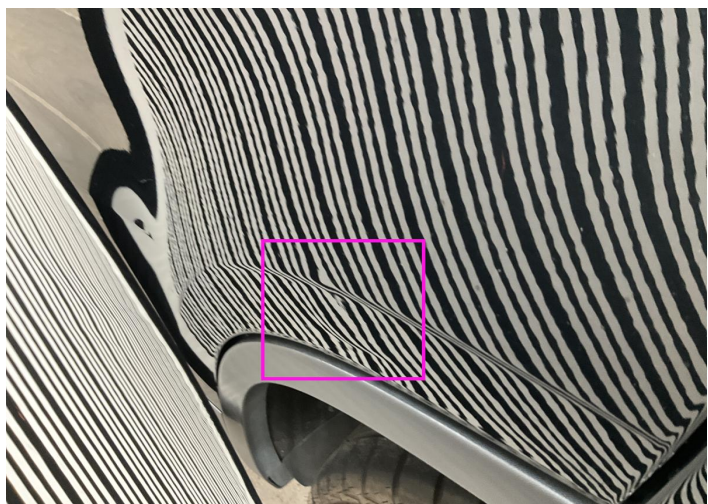

19. Door / Back Left  
Bodywork / Dent / Dent -




20. Panel Filling / Back Left  
Interior / Broken -




21. Rim / Back Left  
Out of Bodywork / Scratch -



22. Side Panel / Back Left  
Paint / Scratch / Scuff -

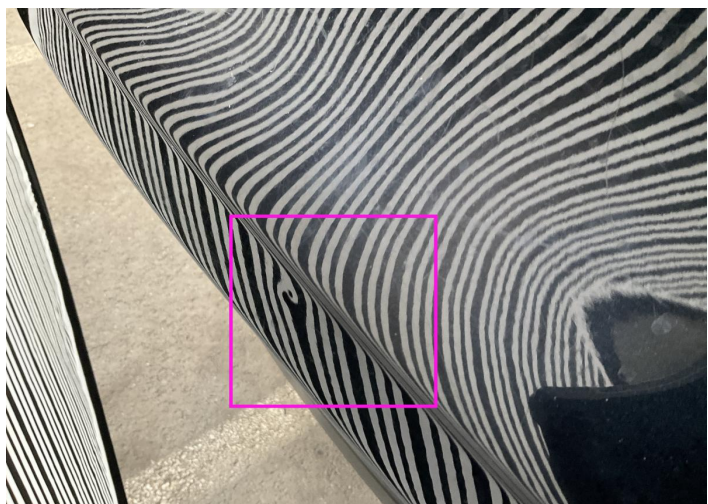

23. Tailgate  
Bodywork / Dent / Dent -

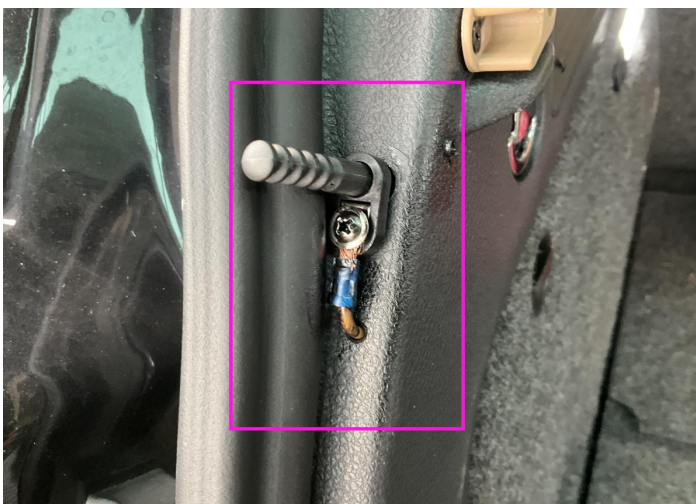


24. Floor Carpet  
Interior / Holed -







25. Bumper / Back  
Paint / Scratch / Scuff -

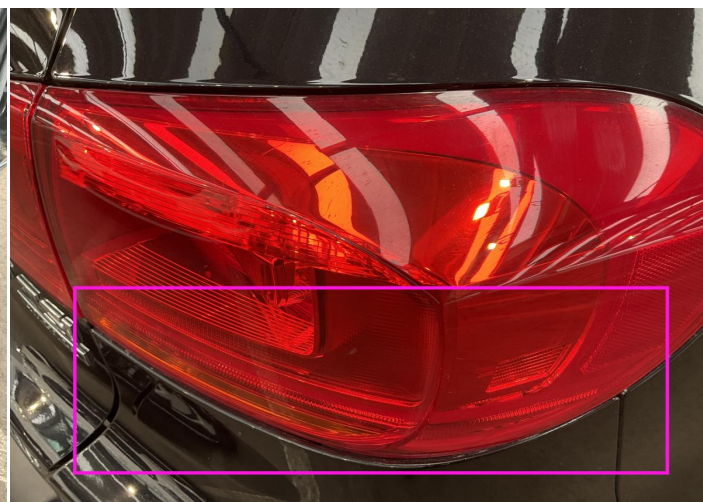

26. Corner Bumper / Back Right  
Bodywork / Breakage / Crack -

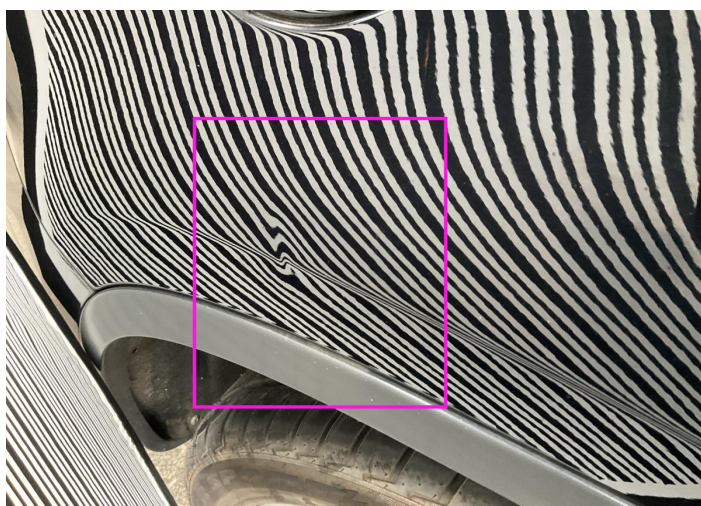


27. Fender / Back Right  
Bodywork / Dent / Dent -

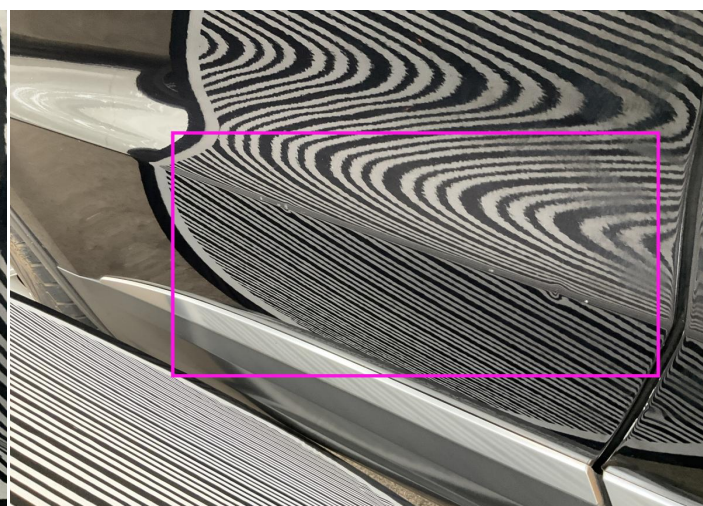

28. Door / Back Right  
Bodywork / Dent / Dent -



29. Panel Filling / Back Right  
Interior / Broken -

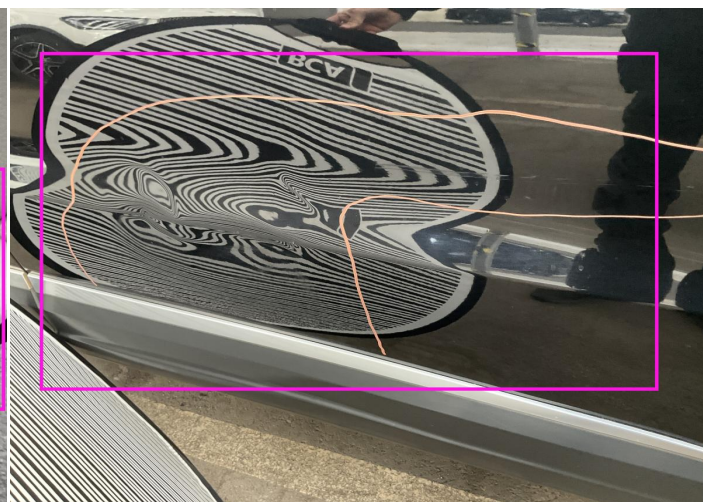

30. Door / Front Right  
Bodywork / Dent / Dent -





31. Mirror Repeater / Right  
Paint / Scratch / Scuff -



32. Rocker Panel / Center Right  
Bodywork / Dent / Dent -



33. Roof Upholstery  
Interior / Broken -



## Mechanical Condition

### Control Lights

|                                              |   |                                 |   |
|----------------------------------------------|---|---------------------------------|---|
| Display Defect                               | ✓ | ABS Warning Light               | ✓ |
| ESP Fault/Traction Control Malfunction Light | ✓ | Airbag Warning Light            | ✓ |
| Oil Pressure Warning Light                   | ✓ | Brake Warning Light             | ✓ |
| Power Steering Warning Light                 | ✓ | Alternator / Battery            | ✓ |
| No Dashboard Lights                          | ✓ | Tire Pressure Monitoring System | ✓ |
| All - wheel Drive                            | ✓ |                                 |   |

### Engine

|                     |   |                     |   |
|---------------------|---|---------------------|---|
| Engine Status / EML | ✓ | Engine Leak Visible | ✓ |
| Engine Starts       | ✓ |                     |   |

### Gearbox

|          |   |
|----------|---|
| Gear Box | ✓ |
|----------|---|

### Equipments Test

|                  |    |                                       |   |
|------------------|----|---------------------------------------|---|
| Electric Windows | ✓  | Navigation System                     | ! |
| Audio Equipment  | NA | Parking Sensors / Cameras Functioning | ! |

### Levels

|              |   |               |   |
|--------------|---|---------------|---|
| Brakes Fluid | ✓ | Coolant Fluid | ✓ |
|--------------|---|---------------|---|

Test Drive Inspection

| Steering Wheel                                                                                       |   |                                               |   |
|------------------------------------------------------------------------------------------------------|---|-----------------------------------------------|---|
| Steering   Noise / Anomaly                                                                           |   | ✓                                             |   |
| Engine                                                                                               |   |                                               |   |
| Engine Noise                                                                                         | ✓ | The Gears Scratch / Skip / Abnormal Operation | ✓ |
| Fume Quantity                                                                                        | ✓ | Power Loss                                    | ✓ |
| Brake                                                                                                |   |                                               |   |
| Brake System Anomaly                                                                                 |   | ✓                                             |   |
| General                                                                                              |   |                                               |   |
| Test Driven Status                                                                                   |   | ✓                                             |   |
| ✓ <i>No troubles detected, good condition or correct tests, according to vehicle age and mileage</i> |   |                                               |   |
| ! <i>Damages or malfunction detected that requires repairs by the buyer</i>                          |   |                                               |   |
| NA <i>Not applicable</i>                                                                             |   |                                               |   |
| = <i>Not tested</i>                                                                                  |   |                                               |   |

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)