



Expertise

Protocol number: 41359588
Order No. / Reference: 25094225
Inspection date: 3 Sept 2025

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Highline

VIN: WVGZZZ1TZNW005376



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Highline	
Vehicle Identification number	WVGZZZ1TZNW005376
Mileage (Read)	226,404 km
First registration	22 Dec 2021
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	uranograu
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	29,700 km
Last maintenance on / at	08/2025 at 226,062 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF434184
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWR 00313		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres (Without wheel rim)	Continental	3mm / 3mm
2)	215/55 R17 98V	Winter tyres (Without wheel rim)	Continental	7mm / 7mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- 2 USB-C ports at the front
- Storage compartments in the roof console
- Airbag, head airbag system for front and rear passengers
- Exterior mirrors electrically adjustable and heated
- Brake light, third
- Headlining in Storm Grey
- Decorative inlays "Piano Black"
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- Luggage compartment cover
- Luggage compartment floor height adjustable
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with switch-off delay and dimming function, 2 reading lights front and rear
- Instrument cluster with electronic speedometer, odometer, trip meter, tachometer
- Front headrests
- Paint finish: Uni
- Steering wheel: Multifunction steering wheel in leather, with shift paddles
- Multifunction display "Premium" with multi-color display
- Fog lights and cornering lights
- Emergency braking assistant "Front Assist"
- Package: Ambient lighting
- Upholstery: Cloth
- Radio
- Radio accessories: 8 speakers
- Tire pressure monitoring indicator (passive)
- Wheels: Tire Mobility Set no longer available
- Front windscreen washer nozzles automatically heated
- Drawers under the front seats
- Seat belts: 3 three-point automatic belts at the rear
- Seats: 3 individual seats in the 2nd row
- Seats: Passenger seat backrest completely foldable
- Seats: Lumbar supports in front
- Seats: Front seats height adjustable
- 12V socket on the rear center console
- Daytime running light
- First aid kit and warning triangle and safety vest
- Washer fluid level warning light
- Warning sound and light for unfastened seat belts at the front and rear
- Central locking without safe security, with radio remote control and 2 radio folding keys
- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Airbag: Side airbags for the outer rear seats
- Exterior mirror housings and door handles in body color
- Chrome strips on the side windows
- Roof rails, silver anodized
- diesel particulate filter
- Electronic parking brake including auto-hold function
- Windscreen in heat-insulating glass
- Baggage management package
- Additional luggage compartment lighting
- Speed limiter
- Glove compartment with cooling option
- Rear window wiper with interval control
- ISOFIX anchor points on rear seats
- Air Care Climatronic air conditioning system with 3-zone temperature control and rear controls
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- LED headlights
- Make-up mirrors in the sun visors, illuminated
- Front center armrest
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: Winter package
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: 4 light alloy wheels 6.5 J x 17 "Alexandria"
- Leather gearshift knob
- Headlight cleaning system
- Electromechanical power steering
- Seat belts: Three-point automatic belts in the front with height adjustment and belt tensioner
- Seats: Folding tables on the backs of the front seats
- Seats: Top comfort seats in the front
- Start-stop system
- Bumpers in body color
- Textile floor mats
- Prepared for later activation: Navigation function Discover Media including streaming & internet
- Electronic immobilizer
- Green thermal insulation glazing

Extra equipment



- 2 USB-C ports at the front, 2 USB-C charging ports on the rear center console
- Digital Cockpit Pro (instrument cluster as TFT display with interactive display - various information profiles can be selected (e.g. consumption & range, navigation, driver assistance, efficiency))
- Package: Business Premium (Air Care Climatronic, allergen filter, ACC stop & go, cruise control, Front Assist, front lumbar support, electrically adjustable driver's side with massage function, leather multifunction steering wheel, shift paddles, mesh partition, heated windshield washer, headlight cleaning system, drawer under right front seat, microfleece seat center panels, top-of-the-line comfort seats in the front, heated, emergency brake assist, "Front Assist," height-adjustable front seats, ergoActive seat on the driver's side, washer fluid warning light).
- Package: Mirror package in conjunction with Driver Assistance Package "Plus" (electrically folding exterior mirrors, driver-side dimming, ambient lighting and passenger-side exterior mirror lowering - automatic headlight control with daytime running lights, "leaving home" function and manual "coming home" function - automatically dimming interior mirror - rain sensor)
- Electric panoramic tilt/slide roof (interior lights with delayed switch-off and dimming function, 2 LED reading lights front and rear - panoramic tilt/slide roof with panoramic roof at the rear)
- Auxiliary heating and ventilation (auxiliary heating and ventilation with radio remote control and timer)
- Traffic sign recognition in Vm driver assistance package "Plus"
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Luggage compartment lid with electric opening 4E7
- Tailgate with electric opening and closing
- "Discover Pro" navigation system including "Streaming & Internet" (App-Connect including App-Connect Wireless for Apple CarPlay - 23.4 cm screen diagonal - Touchscreen - FM radio reception - Dual tuner with phase diversity - MP3 - USB-C with Apple compatibility - 4x20 watt output - Map with 2D display - Traffic sign display - Telephone interface - 3-way sound control - Voice control - Digital radio reception DAB+)
- Package: Driver Assistance Package "Plus" (DSG) (Automatic Distance Control, ACC "Stop & Go" speed, Dynamic High Beam Control, Dynamic Light Assist (automatic headlights, daytime running lights, Leaving Home function and manual Coming Home function), Pedestrian Detection + Active, Automatically dimming interior mirror, LED headlights with LED daytime running lights and cornering lights, Dynamic headlight range control with dynamic cornering, Multifunction camera, Lane Change Assist Plus including Lane Assist and rear parking assist, Rain sensor)
- Rear View camera (displays the rear area of the vehicle in real time on the radio/navigation system display)
- Keyless locking and starting system "Keyless Access" with safe security
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
4	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
5	Roof	Roof rail - right side - Scratch(es) - Smart repair
6	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
7	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
8	Rear bumper	Rear bumper - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Missing parts

Description

Heating system - Remote control auxiliary heating

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view ([Online link](#))



Figure 10: Cargo area

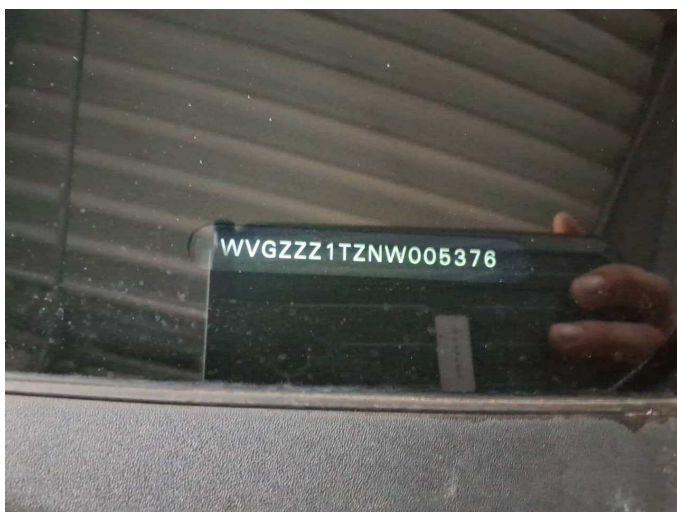


Figure 11: VIN



Figure 12: Mounted tyres

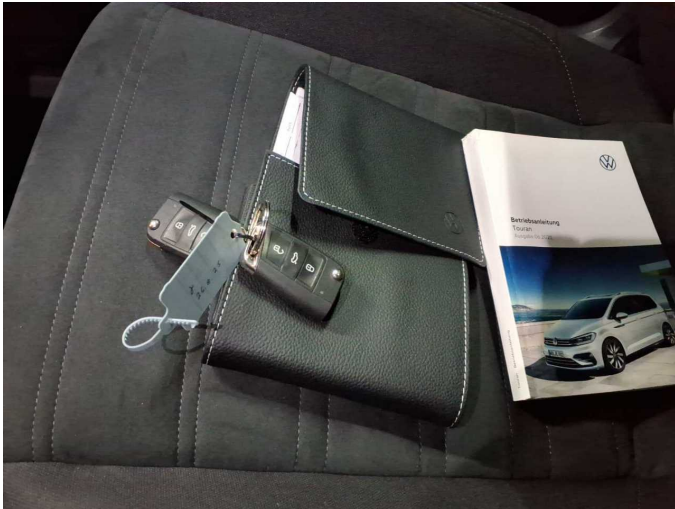


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

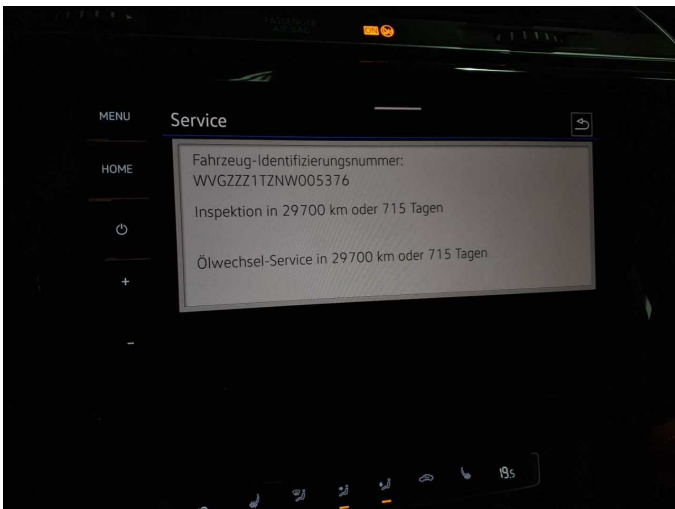


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

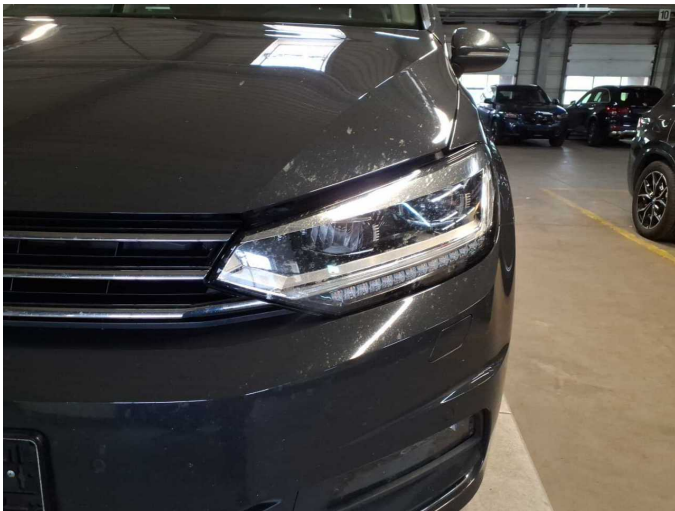


Figure 27: Misc.




Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

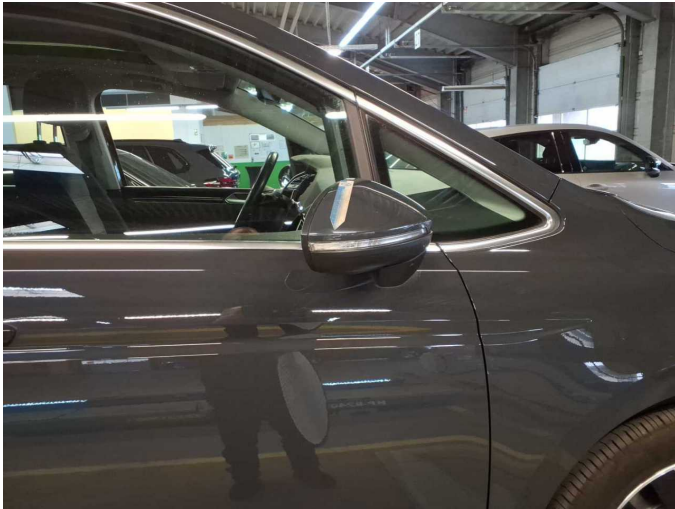

Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

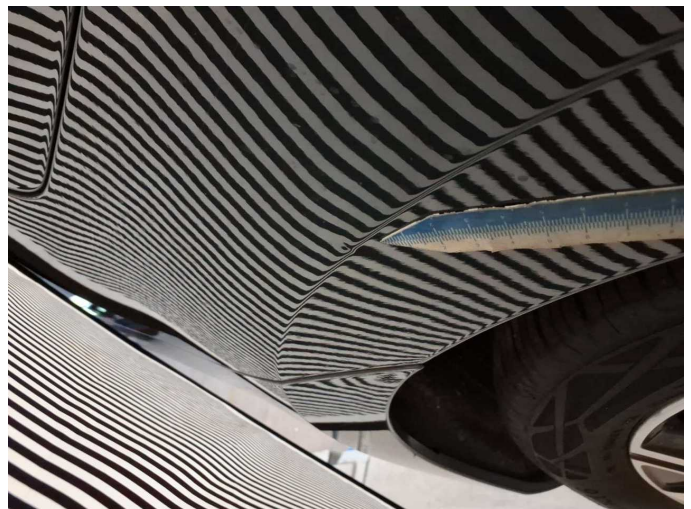

Damage 4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 5: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 5: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value




Damage 6: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 7: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage 7: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

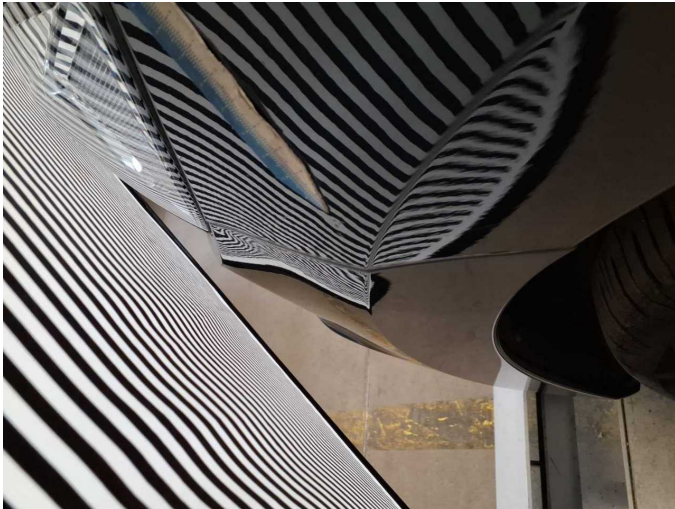

Damage 7: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZNW005376
Hersteller / Modell: VOLKSWAGEN VW Touran 2.0 TDI SCR DSG Highline

Datum	KM-Stand	Beschreibung
21.08.2025	226.062	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Keilrippenriemen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Schwingungsdämpfer ern; Spannrolle ern; Wartung Sonstiges; Wasserpumpe ern; Zahnriemen/ Steuerkett ern
09.04.2025	204.476	Bremse Sonstiges; Bremsklötze hinten
23.12.2024	187.961	AU; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
09.09.2024	174.056	Systemtest/Eigendiagnose
13.06.2024	157.542	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.12.2023	127.867	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.07.2023	100.222	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
04.01.2023	65.778	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.09.2022	32.755	Motoröl b. Wartung; Regelwartungsdienst