

Inspection Protocol



VW ID.5 PRO PERFORMANCE, 204HK, 2023

Vehicle information

License plate	CNN023	Inspected by	A.H.
Year model	2023	Date of inspection	2025-04-14
Manuf. year/month	2022-11	City	Falkenberg
First day in traffic	2022-11	Keys	2
Colour	Svart	Service book	Elektronisk servicebok
Mileage	111 310 km	Latest service	-
Fuel	El (EV)	Mileage at the latest service	-
Transmission	Automat	Summer tires	21" alu-fälg 6/6/6/6
Engine effect	150 kW	Winter tires	alu-fälg odubbat 8/8/8/8

Damages

Location	Damage	Comments	Costs excluding VAT
Boot lid, Boot lid	Scratches below 30 mm		60 €
Rims & Tires, Summer	Rim damage 1 wheel		110 €
Other, Other	Laddkabel Stan saknas		220 €
Bumper, Rear	Small scratches, under 3 cm		60 €
Door, Rear right	Paint retouch traces		0 €
Glass, Windshield	Cracks small (max 30 mm)		220 €
Bumper, Front	Chips, several		60 €
Bonnet	Chip		60 €
Tak, Tak	Chip		60 €

Total excl. VAT	850 €
-----------------	-------

Service occasions

10000-MIL

Images

[See all images in large format](#)

























Fälgar & Däck Sommar Fälgskada 1 hjul 1 500 kr





Stötfångare Bak Repor små, under 3 cm 800 kr



Dörr Höger bak Lackbättring 50 kr




Glas Vindruta Sprickor små (max 3 cm) 3 000 kr



Stötfångare Fram Stenskott flertal 800 kr



Motorhuv Stenskott 800 kr

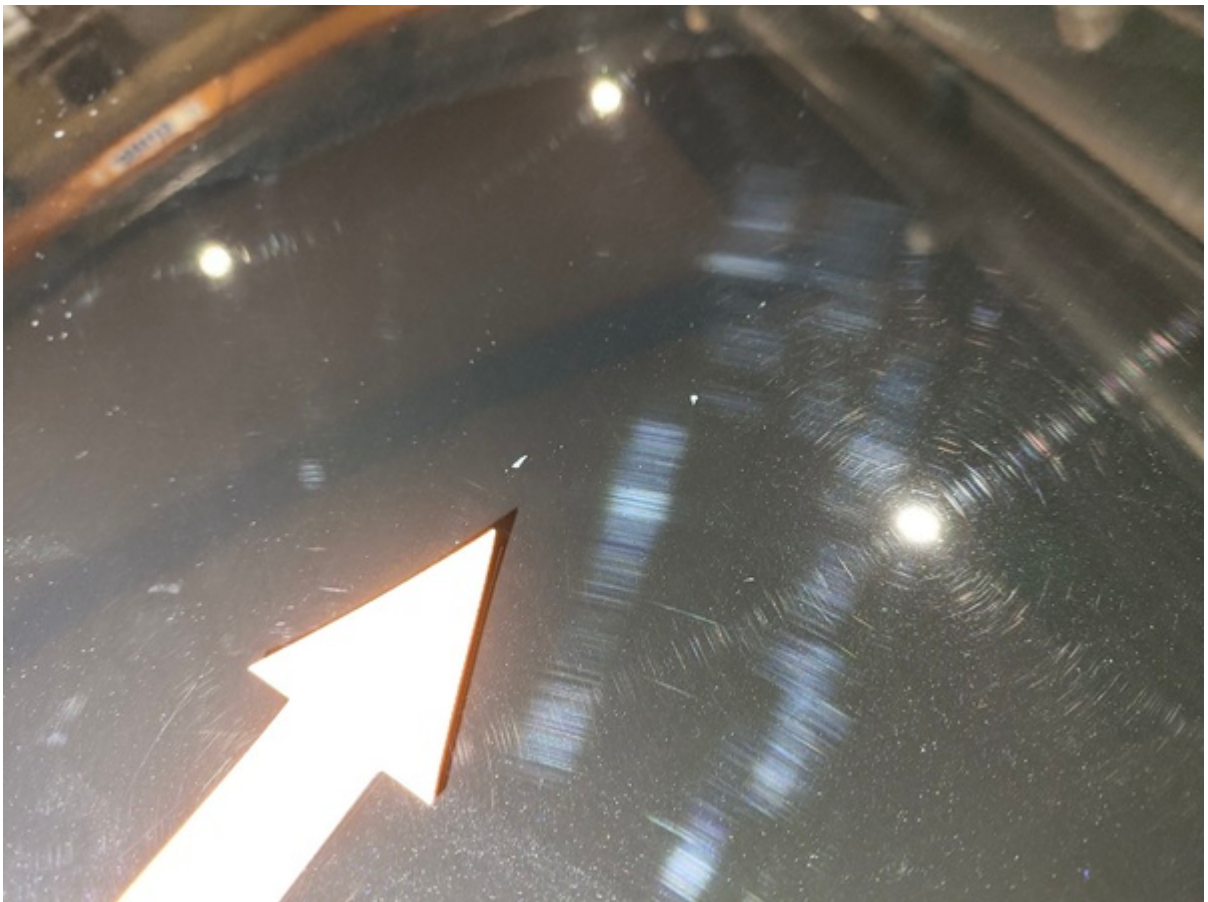

Tak Tak Stenskott 800 kr

