



VOLKSWAGEN Golf V

Golf 1.6

VIN NO WVWZZZ1KZ9P013850
Registration Number KZ9P013850



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2025-08-01	2	2	77735 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
-	-	2008-07-23	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250925144620
Inspection Date / Place	2025-09-25 / BCA Berlin	Cosmetic Grade	4

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Unknown
Colour	Grey	Engine Size (cc)	1595
Engine Size	1.6	No of Doors	3
Body Type	Sedan	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	176
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	Missing	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





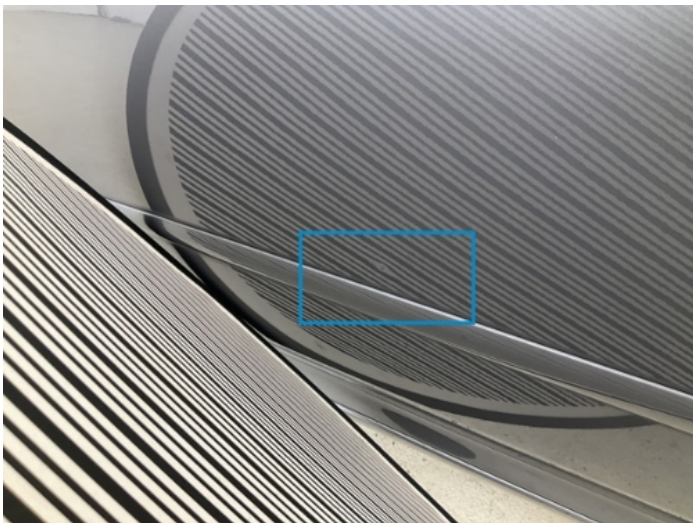

Equipment

Tinted Glass	Airbag Status	Anti-lock braking	Cruise control
Heated wing mirrors	Remote central locking	Stability control	Radio
USB Socket	Alloys wheels	Bluetooth telephone interface	Front fog lamps
Remote adjusting wing mirrors	Split folding rear seats	Leather steering wheel	Rear parking sensors

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	16
Extra Wheel / Tyre Set	Winter Tyres - Steel	Seat Heating	Front
Radio	Zubehörradio nachgerüstet		

Wheels & Tyres


Extra Wheel - 1 Tyre Depth	4	Extra Wheel - 2 Tyre Depth	4
Extra Wheel - 3 Tyre Depth	4	Extra Wheel - 4 Tyre Depth	4
Right Front Tyre Depth	4	Left Front Tyre Depth	4
Right Rear Tyre Depth	4	Left Rear Tyre Depth	41

Cosmetic Damage

28 Schäden

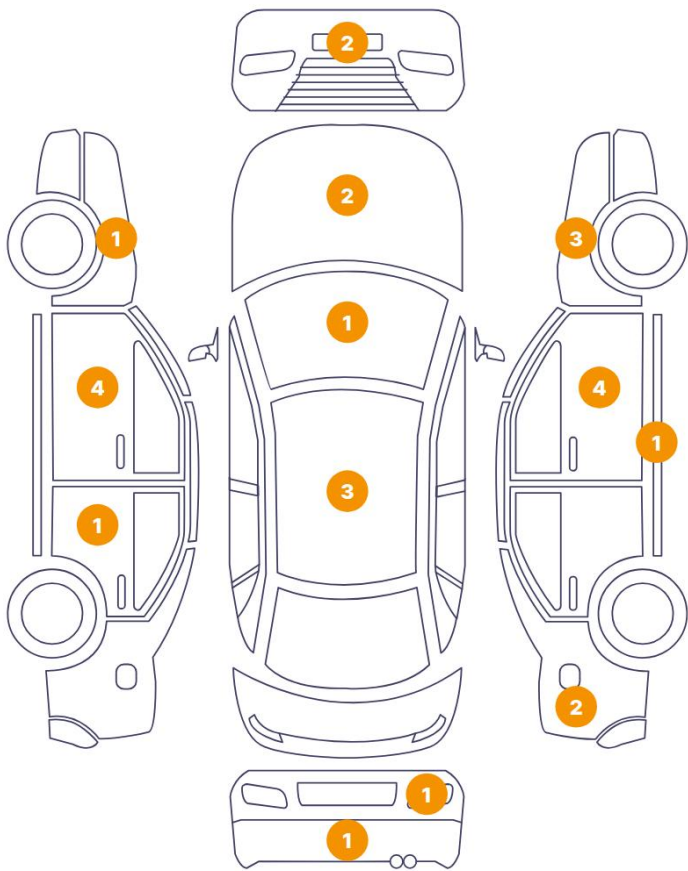

5 Schäden

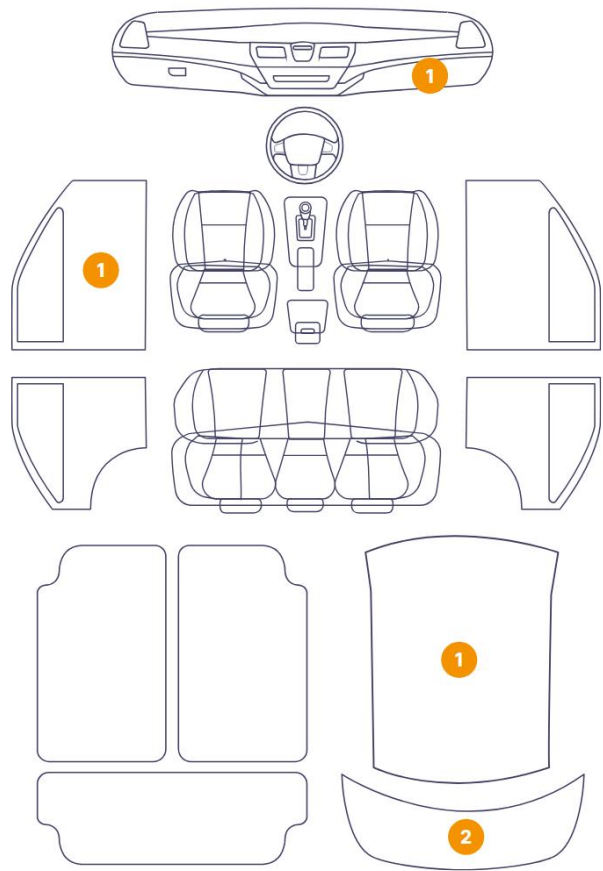

Component		Damage	Comments
1	Panel Filling / Front Left	Interior / Loose	
2	Roof Upholstery	Interior / Loose	
3	Trunk Upholstery / Back	Interior / Scratched	
4	Ply Lining (LCV)	Interior / Scratched	
5	Center Console	Interior / Worn - out	
6	Windshield / Front	Glass Break / Impact	
7	Corner Bumper / Front Right	Paint / Scratch / Scuff	
8	Corner Bumper / Front Left	Paint / Scratch / Scuff	
9	Hood	Paint / Stone Chip	
10	Wing Expander / Front Left	Paint / Scratch / Scuff	
11	Mirror / Front Left	Paint / Scratch / Scuff	
12	Door / Front Left	Paint / Scratch / Scuff	

13	Bumper / Back	Paint / Scratch / Scuff
14	Back Light / Right	Glass Break
15	Side Panel / Back Right	Paint / Scratch / Scuff
16	Rocker Panel / Center Right	Bodywork / Dent / Dent
17	Door / Front Right	Paint / Scratch / Scuff
18	Mirror / Front Right	Paint / Scratch / Scuff
19	Roof	Bodywork / Dent / Dent
20	Roof	Bodywork / Dent / Dent
21	Roof	Bodywork / Dent / Dent
22	Hood	Bodywork / Dent / Dent
23	Fender / Front Right	Bodywork / Poor Previous Repair
24	Fender / Front Right	Bodywork / Dent / Dent
25	Fender / Front Right	Bodywork / Dent / Dent
26	Door / Front Right	Bodywork / Dent / Dent
27	Door / Front Right	Bodywork / Dent / Dent
28	Side Panel / Back Right	Bodywork / Dent / Dent
29	Door / Back Left	Bodywork / Dent / Dent
30	Door / Front Left	Bodywork / Dent / Dent
31	Door / Front Left	Bodywork / Dent / Dent



1. Panel Filling / Front Left
Interior / Loose -



2. Roof Upholstery
Interior / Loose -



3. Trunk Upholstery / Back
Interior / Scratched -




4. Ply Lining (LCV)
Interior / Scratched -



5. Center Console
Interior / Worn - out -



6. Windshield / Front
Glass Break / Impact -

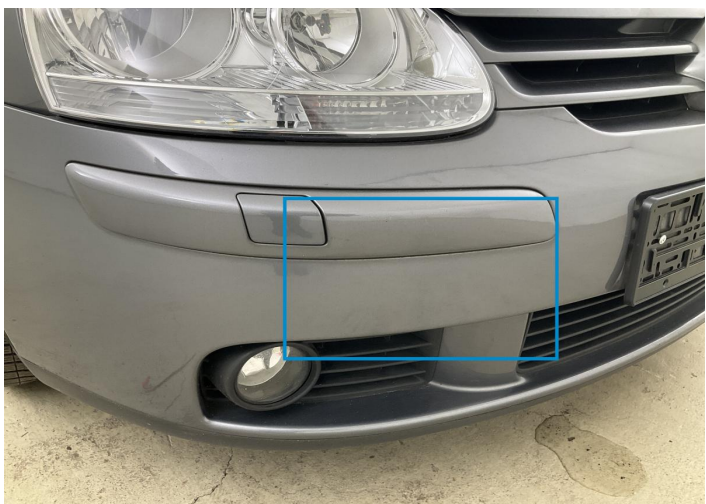

7. Corner Bumper / Front Right
Paint / Scratch / Scuff -



8. Corner Bumper / Front Left
Paint / Scratch / Scuff -




9. Hood
Paint / Stone Chip -



10. Wing Expander / Front Left
Paint / Scratch / Scuff -



11. Mirror / Front Left
Paint / Scratch / Scuff -

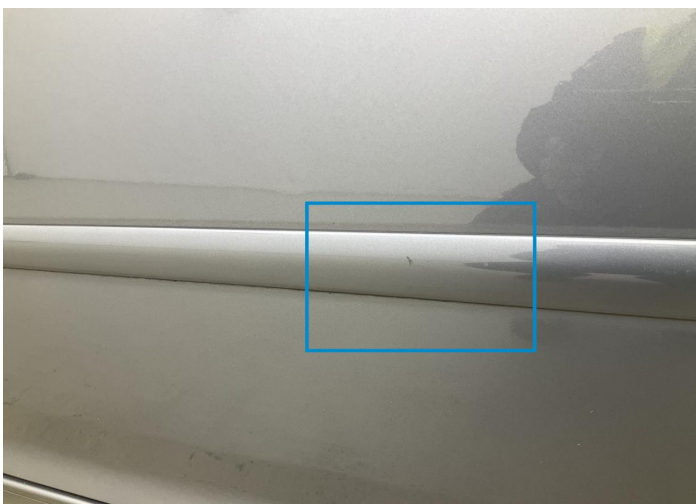


12. Door / Front Left
Paint / Scratch / Scuff -




13. Bumper / Back
Paint / Scratch / Scuff -



14. Back Light / Right
Glass Break -

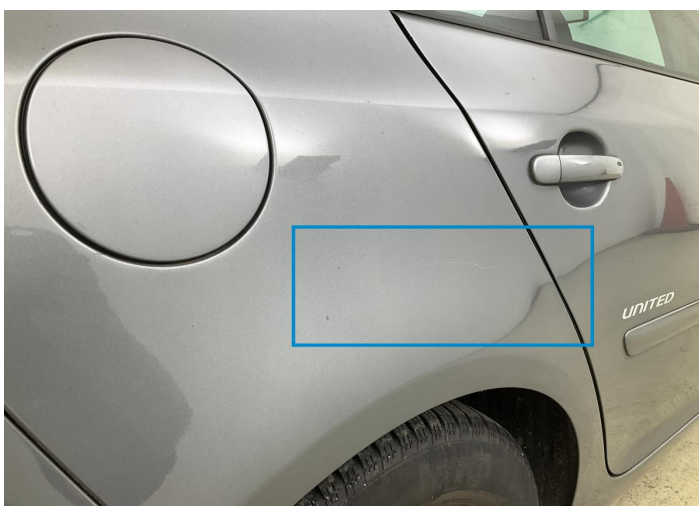

15. Side Panel / Back Right
Paint / Scratch / Scuff -

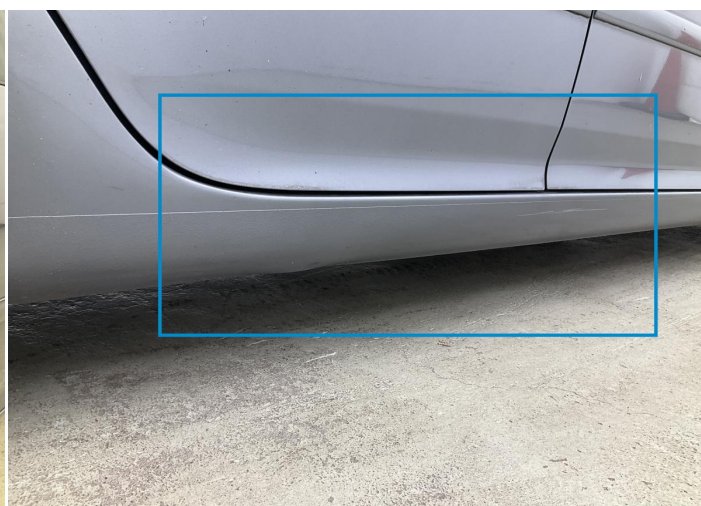


16. Rocker Panel / Center Right
Bodywork / Dent / Dent -




17. Door / Front Right
Paint / Scratch / Scuff -




18. Mirror / Front Right
Paint / Scratch / Scuff -

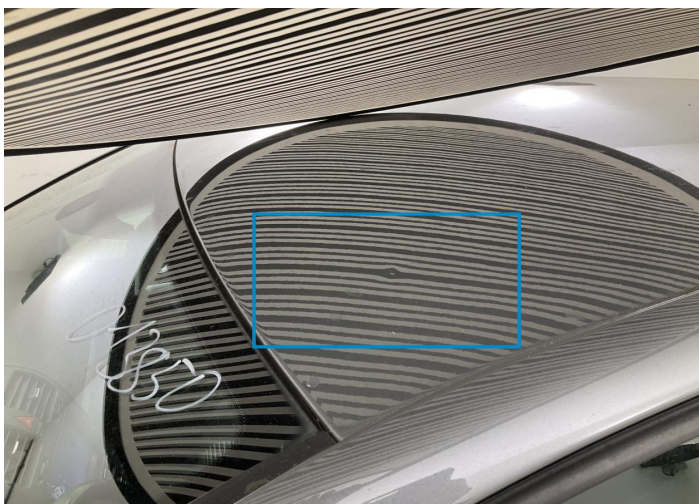


19. Roof
Bodywork / Dent / Dent -

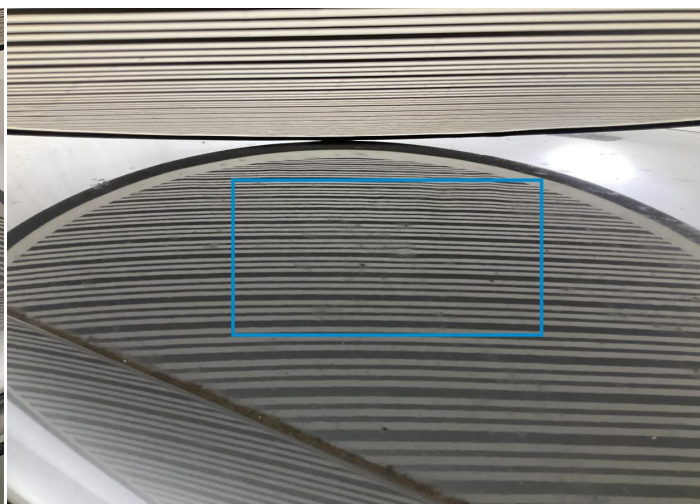

20. Roof
Bodywork / Dent / Dent -

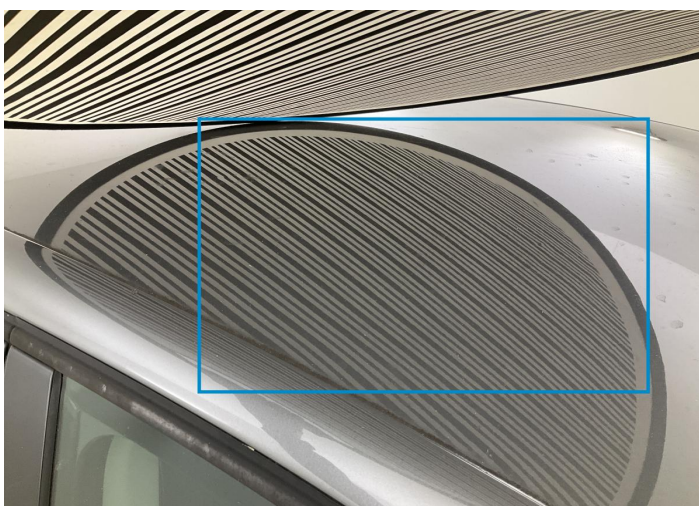


21. Roof
Bodywork / Dent / Dent -

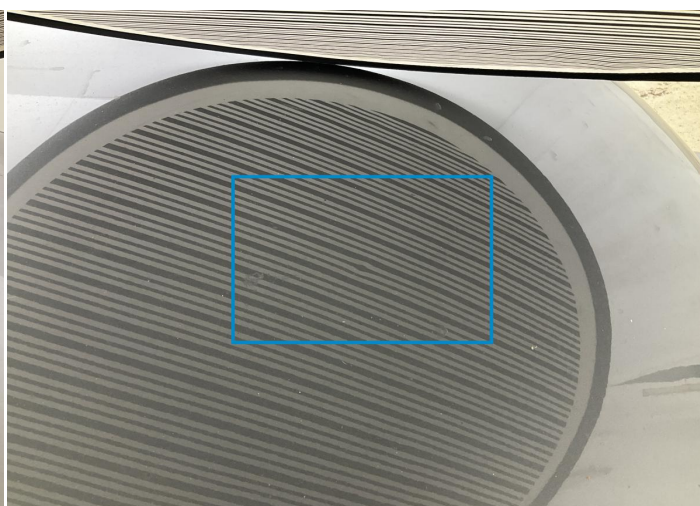


22. Hood
Bodywork / Dent / Dent -




23. Fender / Front Right
Bodywork / Poor Previous Repair -

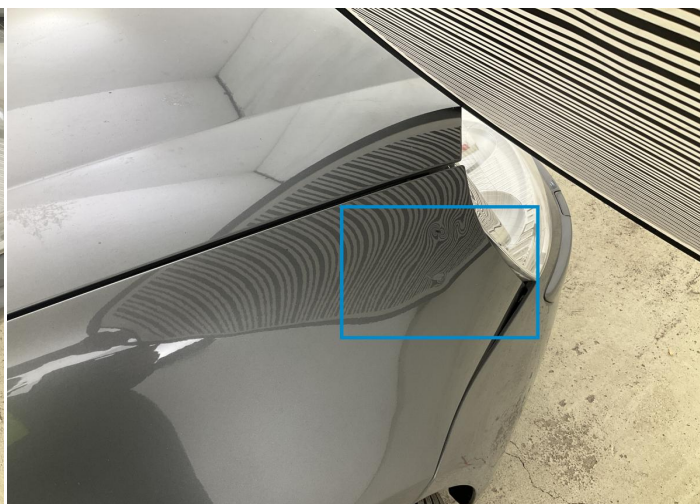

24. Fender / Front Right
Bodywork / Dent / Dent -

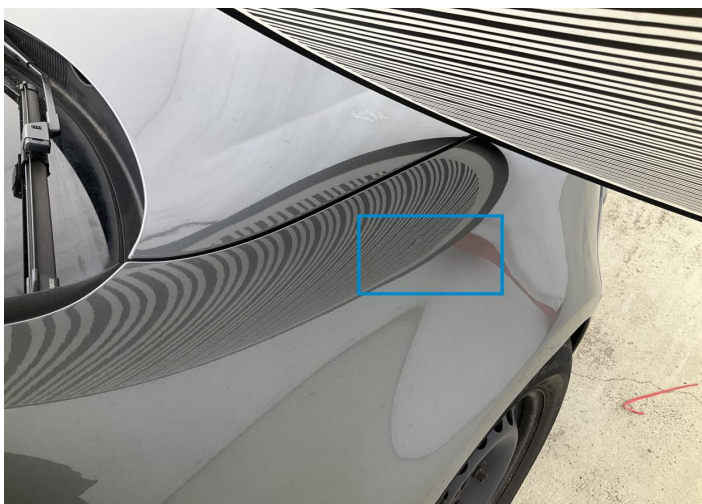


25. Fender / Front Right
Bodywork / Dent / Dent -

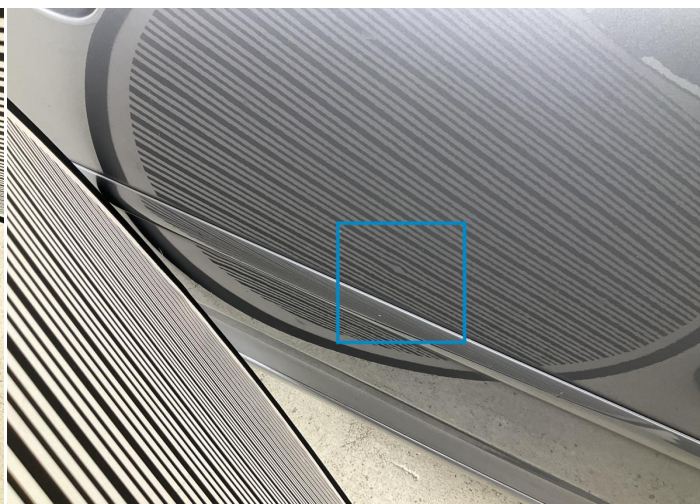

26. Door / Front Right
Bodywork / Dent / Dent -



27. Door / Front Right
Bodywork / Dent / Dent -

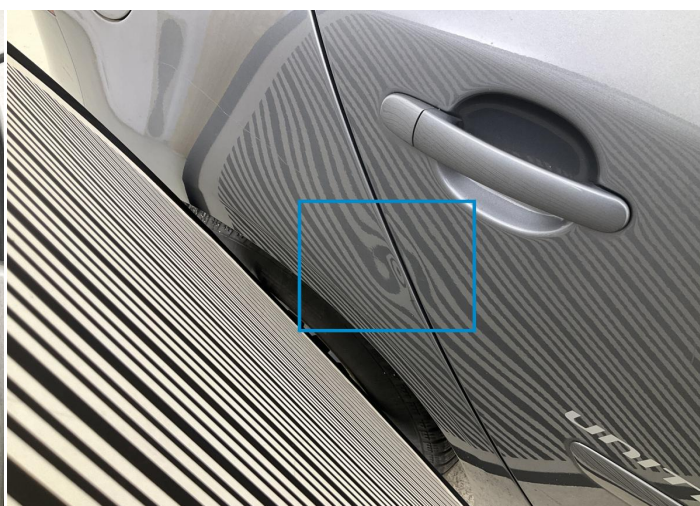


28. Side Panel / Back Right
Bodywork / Dent / Dent -



29. Door / Back Left
Bodywork / Dent / Dent -



30. Door / Front Left
Bodywork / Dent / Dent -

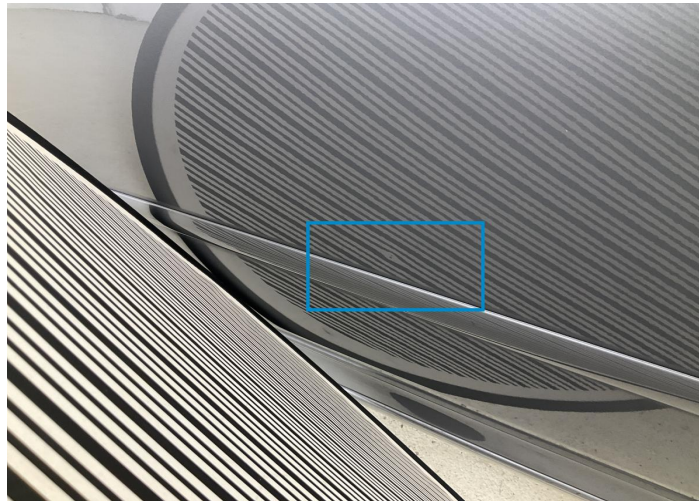

31. Door / Front Left
Bodywork / Dent / Dent -

Mechanical Condition

Control Lights

ABS Warning Light	❗	ESP Fault/Traction Control Malfunction Light	❗
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	❗	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	❗

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Equipments Test

Main & Spare Keys Functioning	✓	Electric Windows	✓
Audio Equipment	✓	Parking Sensors / Cameras Functioning	✓
AC / Heating System	✓		

Hybrid/EV

Hybrid System Fault	NA
---------------------	----

Test Drive Inspection

Engine			
Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓
Brake			
Brake System Anomaly	✓		
Steering Wheel			
Steering Noise / Anomaly	✓		
Clutch			
Clutch Functioning	✓		
General			
Test Driven Status	✓		

- ✓ *No troubles detected, good condition or correct tests, according to vehicle age and mileage*
- ! *Damages or malfunction detected that requires repairs by the buyer*
- NA *Not applicable*
- ☐ *Not tested*

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)