



# VOLKSWAGEN Passat

## Passat Variant 1.8 TSI

VIN NO WVWZZZ3CZCE017115  
Registration Number CZCE017115



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2024-09-01	1	2	132206 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-10-24	124900	2011-07-15	Germany

### Inspection Report Summary

Customer	BCA Online	Report Number	P20250828131341
Inspection Date / Place	2025-08-28 / BCA Oberndorf	Cosmetic Grade	3

### Vehicle Summary

Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Yes
Colour	Grey	Engine Size (cc)	1798
Engine Size	1.8	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth/Synthetic Leather
Charging Cables		NEDC CO2 Rating (q/km)	160
Gearbox Type	Manual		

### Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			









## Equipment

Tinted Glass	Airbag Status	Anti-lock braking	Cruise control
Front parking sensors	Remote adjusting wing mirrors	Roof rails	Split folding rear seats
CD Player	Leather steering wheel	Rear parking sensors	Tow ball
Alloys wheels	Auxiliary Socket	Front fog lamps	Heated wing mirrors
Remote central locking	Satellite navigation	Stability control	Central locking

Radio

## Equipment Details

Tow Ball Type	Pivoted	Air Conditioning	Dual Zone Climate Control
Alloy Wheel Size	17	Extra Wheel / Tyre Set	Winter Tyres - Steel
Seat Heating	Front		


## Wheels & Tyres

Right Front Tyre Depth	3	Left Front Tyre Depth	3
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5
Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	7	Extra Wheel - 4 Tyre Depth	7




Cosmetic Damage

4 Schäden

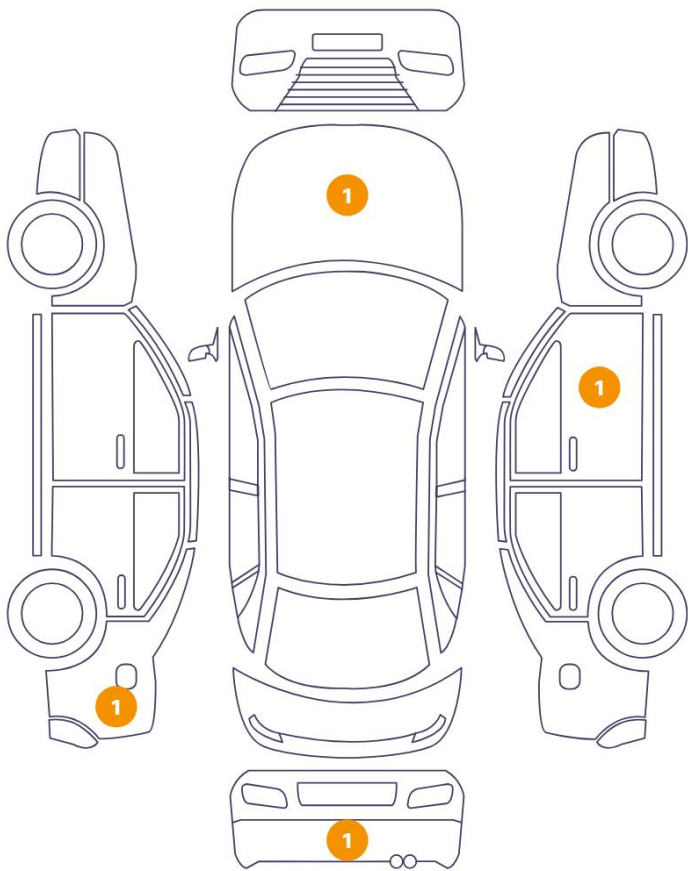

4 Schäden

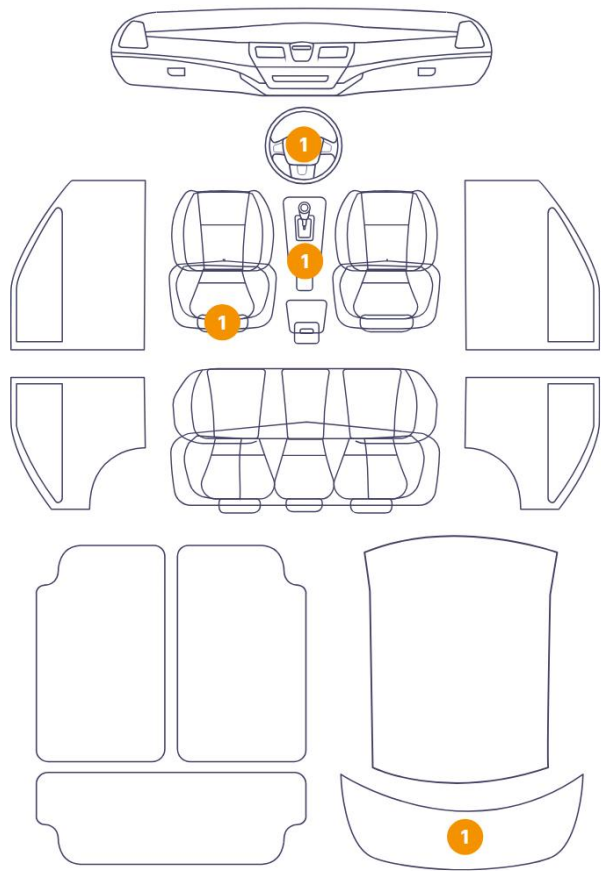

Component	Damage	Comments
1 Hood	Bodywork / Dent / Dent	
2 Seat / Front Left	Interior / Ripped	
3 Steering Wheel / Front	Interior / Scratched	
4 Side Panel / Back Left	Paint / Scratch / Line	
5 Bumper / Back	Bodywork / Dent / Dent	
6 Trunk Upholstery / Back	Interior / Scratched	
7 Door / Front Right	Bodywork / Dent / Dent	
8 Gear Knob	Interior / Scratched	



1. Hood  
Bodywork / Dent / Dent -




2. Seat / Front Left  
Interior / Ripped -



3. Steering Wheel / Front  
Interior / Scratched -



4. Side Panel / Back Left  
Paint / Scratch / Line -

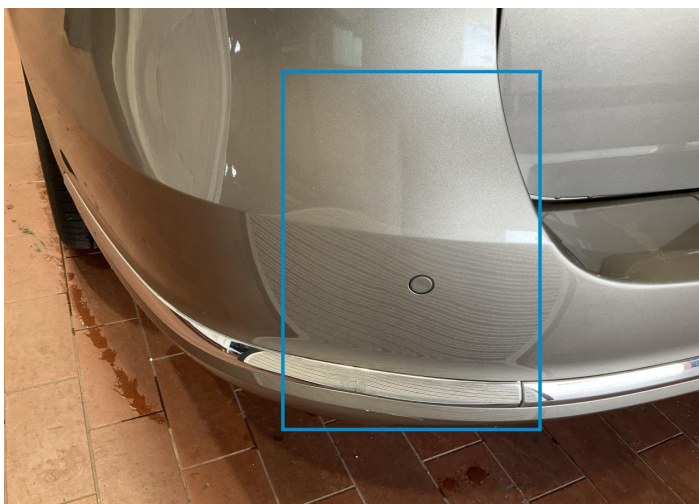


5. Bumper / Back  
Bodywork / Dent / Dent -



6. Trunk Upholstery / Back  
Interior / Scratched -



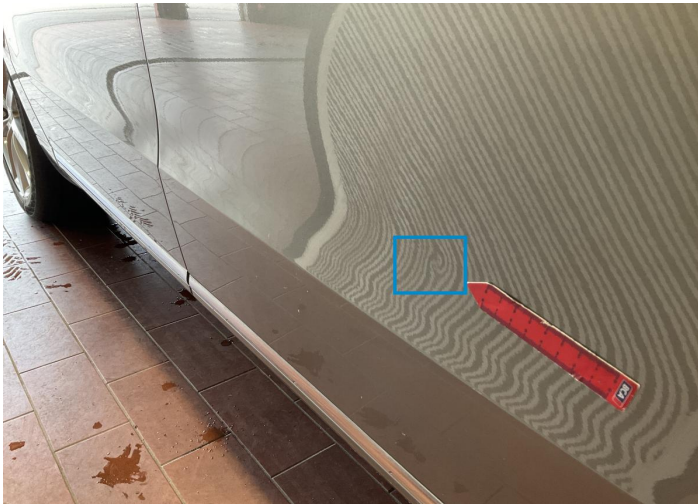

7. Door / Front Right  
Bodywork / Dent / Dent -



8. Gear Knob  
Interior / Scratched -



## Mechanical Condition

### Control Lights

Display Defect	✓	Service Light	✓
ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓

### Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Navigation System	✓
Audio Equipment	✓	Parking Sensors / Cameras Functioning	✓
AC / Heating System	✓	Other Equipments	✓

### Engine

Engine Status / EML	✓	Engine Leak Visible	!
Engine Starts	✓		

### Gearbox

Gear Box	✓
----------	---

### Levels



Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

# Test Drive Inspection


Steering Wheel

Steering | Noise / Anomaly 


Engine

Engine Noise		The Gears Scratch / Skip / Abnormal Operation	
Fume Quantity		Power Loss	

Clutch





Clutch Functioning 

Brake

Brake System Anomaly 

General

Test Driven Status      Not Performed

-  **No troubles detected, good condition or correct tests, according to vehicle age and mileage**
-  **Damages or malfunction detected that requires repairs by the buyer**
-  **Not applicable**
-  **Not tested**

## Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)