



Expertise

Protocol number: 41173000
Order No. / Reference: 25136848
Inspection date: 21 Aug 2025

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG Business

VIN: WVVZZZ3CZME131186



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Passat Variant 2.0 TDI SCR DSG Business

Vehicle Identification number WVVZZZ3CZME131186
Mileage (Read) 103,330 km
First registration 15 Jun 2021
Number of holders 1
Next periodical technical inspection 06/2026
(Report on hand)

Power / Engine displacement 110 kw / 1,968 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic transmission / 7
Type of drive Front drive
Type of vehicle Station wagon
Colour / colour code oryxweiss perlmutteffekt (0K1)
Doors / Seats 5 / 5
Upholstery type Leather
Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	396 Tag(e)
Last maintenance on / at	11/2024 at 87,689 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GC336839
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BQS 00799		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	215/60 R16 95V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Airbag for driver and front passenger • Anti-lock braking system (ABS) • Automatic distance control ACC "stop & go", including speed limiter • Cup holders (2) front • Brake light, third • Headlining in Mistral Grey • diesel particulate filter • Parking aid - warning signals for obstacles in the front and rear areas • Electronic stabilization program and electromechanical brake booster • Front windscreen in laminated safety glass, heat and sound insulating • Transmission: 7-speed DSG • ISOFIX anchorage points • Headrests (3) rear • LED fog lights and cornering lights • LED headlights with daytime running lights • Headlight range adjustment • Front center armrest height and length adjustable, with storage box • Mesh partition • Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h) • Upholstery: "Weave" fabric • Radio "Composition" • Radio accessories: Digital radio reception DAB+ • Wheels: 4 light alloy wheels "Sepang" 6.5 J x 16 • Rear seat bench undivided, backrest asymmetrically divided and foldable, with center armrest • Power steering • Seats: Comfort seats in the front • Seats: Front seats height adjustable • Start-stop system • Telephone interface • First aid kit, warning triangle and safety vest • Electronic immobilizer | <ul style="list-style-type: none"> • Airbag, head airbag system for front and rear passengers • App Connect • Exterior mirrors electrically adjustable, heated, ambient lighting • Hill start assist • Chrome strips on the side windows • Roof rails black • tachometer • LED entry/warning lights in the front doors • Electronic parking brake including auto-hold function • Automatic headlight switching • Remote release for the trunk lid • Pedestrian detection • Luggage compartment floor can be raised • Interior lights with switch-off delay and dimming function • Air conditioning • Front headrests • LED taillights • Steering wheel: Multifunction steering wheel in leather, with shift paddles • Multifunction display "Premium" with multi-color display • Fatigue detection • Non-smoking version • Emergency call service • Package: Light and Vision Package "Plus" • Proactive occupant protection system in conjunction with "Front Assist" • Tire pressure monitoring indicator (passive) • Wheels: Tire Mobility Set • Leather gearshift knob • Keyless start system without safe lock • Seat belts: three-point automatic seat belt • Seats: Lumbar supports in front • Lane keeping assistant "Lane Assist" • 12V socket on the rear center console • Textile floor mats • Warning sound and light for unfastened seat belts at the front and rear |
|--|---|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Anti-theft alarm system (interior monitoring, backup horn and tow-away protection - illuminated vanity mirror in the sun visors, extendable sun visors) • Finish: mother-of-pearl effect • Keyless start system with safe security • Navigation system "Discover Media" including "Streaming & Internet" | <ul style="list-style-type: none"> • App-Connect Wireless (Volkswagen offers three interfaces for connecting smartphones with numerous options: - Apple CarPlay - Android Auto from Google - MirrorLink) • Auxiliary heating and ventilation (with radio remote control and timer) • Folding trailer hitch (with electric release) • Luggage net |
|---|--|



- Package: "Vienna" leather package with top comfort seats in the front in conjunction with the Business Premium package (seat center panels and inner bolsters of the front seats and the outer rear seats in "Vienna" leather - top comfort seats in the front - heated front seats - automatically heated windshield washer nozzles in the front)
- Package: Ambient lighting (ambient lighting, 1-color - entry/warning lights in LED technology in all doors)
- Package: Winter
- Seats: ergoComfort seat with 14-way power adjustment, memory and massage on the driver's side. In conjunction with the Business Package (electrically folding exterior mirrors, dimming on the driver's side, ambient lighting and memory - electrically adjustable front lumbar supports, massage function on the driver's side - electrically adjustable front seats, ergoComfort seat on the driver's side, with memory function and easy entry)
- Package: "Business Premium" package including navigation (from Business) (2 USB-C ports in the front, 1 USB-C charging socket in the rear, 230 V socket, App-Connect including wireless, Apple CarPlay, Android Auto, "Travel Assist" driving assistant and "Lane Assist" lane keeping assistant, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, electric lumbar supports on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Rear side windows and rear window tinted
- Steering wheel: Multifunction steering wheel in leather, heated, with shift paddles
- Telephone interface "Comfort" with inductive charging function

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
4	Body	Body (linke Fahrzeugseite) - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Rear bumper	Rear bumper (Schutzfolie) - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

Das ganze Fahrzeug erweist gleichmäßig erhöhte Lackwerte.

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigten, nicht demontierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.

Der Winterradsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument panel



Figure 8: interior 360° view ([Online link](#))



Figure 9: Cargo area

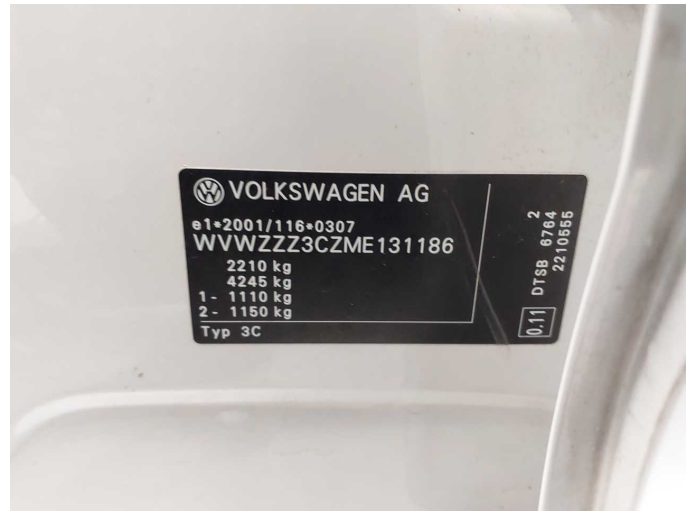


Figure 10: VIN



Figure 11: Mounted tyres

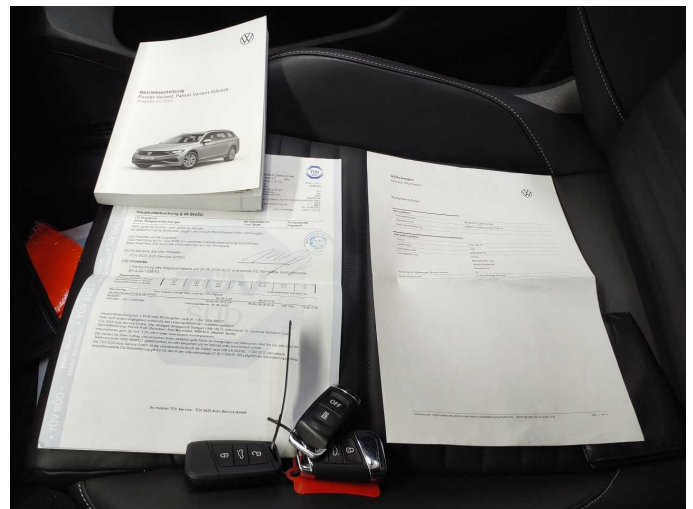


Figure 12: Documents



Figure 13: Documents

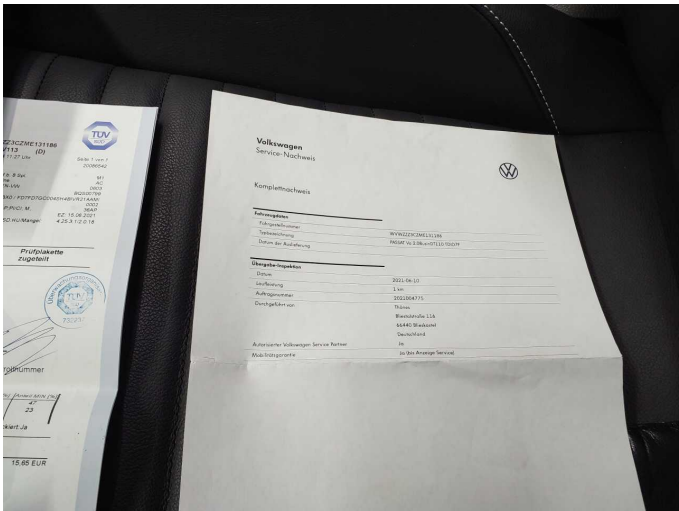


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

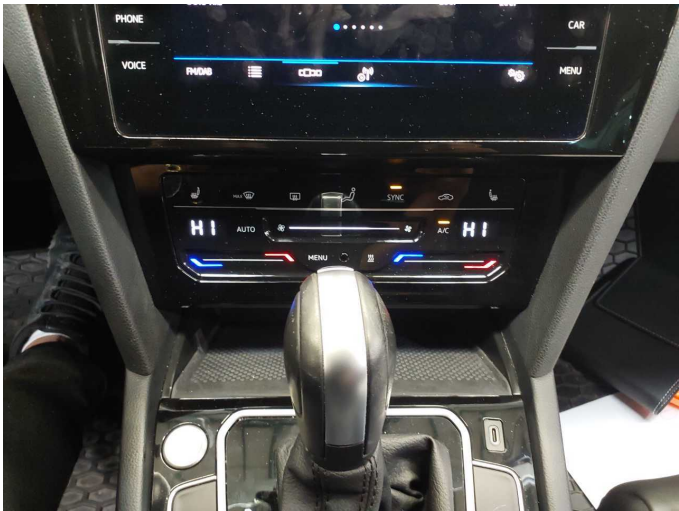


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.



Figure 35: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

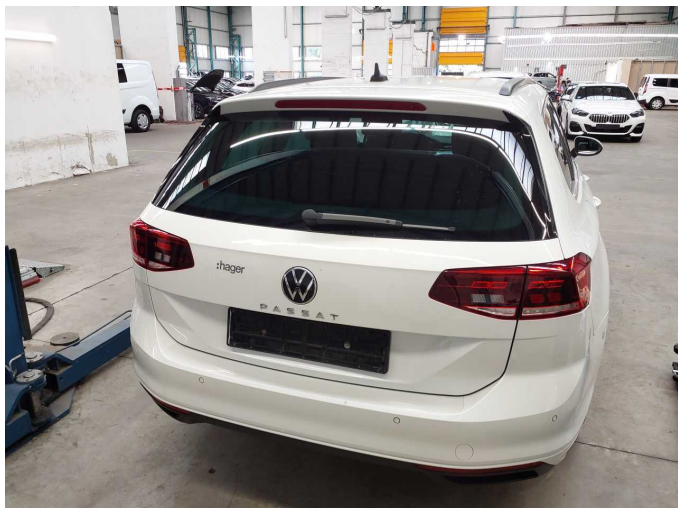


Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

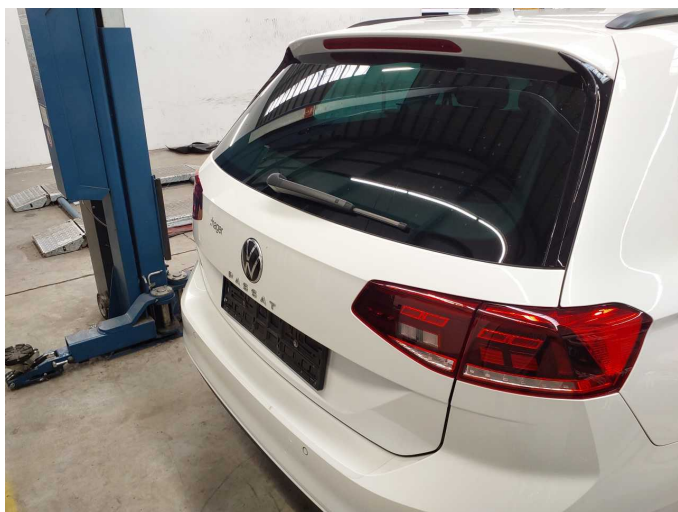

Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

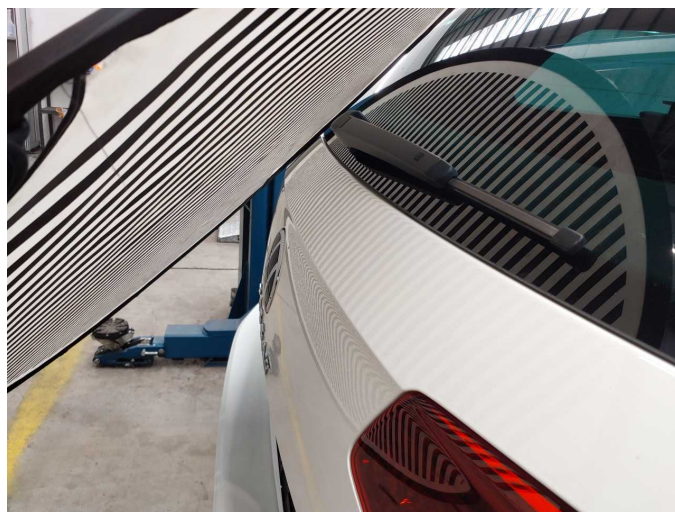

Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 4: Body: Body (linke Fahrzeugseite) - Scratched - Repair and paint



Damage 4: Body: Body (linke Fahrzeugseite) - Scratched - Repair and paint




Damage 4: Body: Body (linke Fahrzeugseite) - Scratched - Repair and paint



Damage 4: Body: Body (linke Fahrzeugseite) - Scratched - Repair and paint



Damage 4: Body: Body (linke Fahrzeugseite) - Scratched - Repair and paint

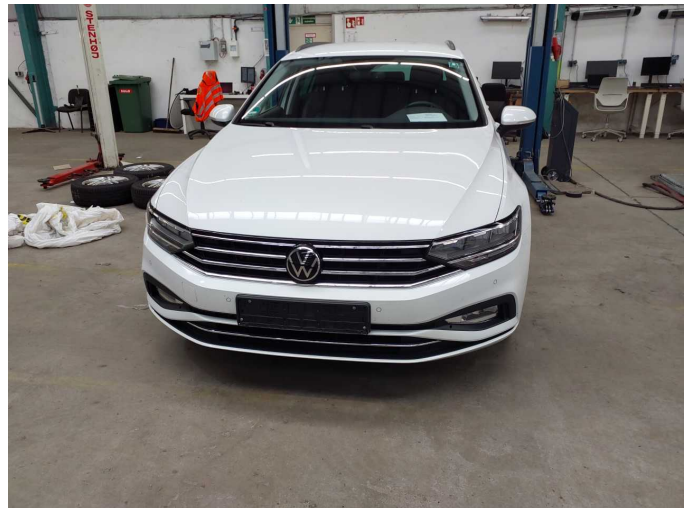

Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 2: Rear bumper: Rear bumper (Schutzfolie) - Scratch(es)
- No deduction



Wear and tear 2: Rear bumper: Rear bumper (Schutzfolie) - Scratch(es)
- No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZ3CZME131186

Hersteller / Modell: VOLKSWAGEN VW Passat Variant 2.0 TDI SCR DSG Business

Datum	KM-Stand	Beschreibung
13.03.2025	94.656	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.11.2024	87.689	Kraftstofffilter ern; Regelwartungsdienst; Wartung Sonstiges
20.06.2024	76.013	AU
06.05.2024	72.555	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Wartung Sonstiges
05.02.2024	64.035	Funktionsprüfung; Systemtest/Eigendiagnose; Wartung Sonstiges
22.11.2023	59.604	Regelwartungsdienst
29.09.2023	56.665	Systemtest/Eigendiagnose
21.06.2023	48.795	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.09.2022	29.249	Regelwartungsdienst