



Expertise

Protocol number: 41582391
Order No. / Reference: 25238448
Inspection date: 16 Sept 2025

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG Elegance

VIN: WVGZZZ3CZNE032221



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 2.0 TDI SCR DSG Elegance	
Vehicle Identification number	WVGZZZ3CZNE032221
Mileage (Read)	159,119 km
First registration	5 Jan 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report not on hand)	
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mangangrau-metallic (B7R)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	1,500 km
Last maintenance on / at	11/2024 at 130,559 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF434270
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CON 00340		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,180 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	235/40 R19 96W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Michelin	3mm / 3mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Michelin	5mm / 5mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Automatic distance control ACC "stop & go", including speed limiter
- Cup holders (2) front
- Hill start assist
- Chrome strips on the side windows
- Roof rails, silver anodized
- diesel particulate filter
- Parking aid - warning signals for obstacles in the front and rear areas
- Electronic stabilization program and electromechanical brake booster
- Front windscreen in laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- Interior mirror automatically dimming
- ISOFIX anchorage points
- Air Care Climatronic air conditioning system with 3-zone temperature control and allergen filter
- Steering wheel: Multifunction steering wheel in leather, with shift paddles
- Front center armrest height and length adjustable, with storage box
- Mesh partition
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Package: Winter
- Radio "Composition"
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring indicator (passive)
- Wheels: AirStop tires 215/55 R 17
- Leather gearshift knob
- Keyless start system without safe lock
- Seat belts: three-point automatic seat belt
- Seats: Front seats height adjustable
- Start-stop system
- Telephone interface
- First aid kit, warning triangle and safety vest
- Electronic immobilizer
- Airbag, head airbag system for front and rear passengers
- App Connect
- Exterior mirrors electrically adjustable and heated
- Exterior mirrors with ambient lighting and passenger mirror lowering
- Brake light, third
- Headlining in Mistral Grey
- Decorative inlays in brushed aluminum
- tachometer
- LED entry/warning lights in the front doors
- Electronic parking brake including auto-hold function
- Automatic headlight switching
- Remote release for the trunk lid
- Pedestrian detection
- Luggage compartment floor can be raised
- Interior lights with switch-off delay and dimming function
- IQ.LIGHT - LED matrix headlights, including LED taillights dark red
- Headrests (3) rear
- Front headrests
- Make-up mirror illuminated in the sun visors, extendable sun visors
- Multifunction display "Premium" with multi-color display
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: "Design and Comfort"
- Proactive occupant protection system in conjunction with "Front Assist"
- Rain sensor
- Wheels: 4 light alloy wheels "Istanbul" 7 J x 17
- Rear seat bench undivided, backrest asymmetrically divided and foldable, with center armrest
- Power steering
- Seats: Lumbar supports in front
- Lane keeping assistant "Lane Assist"
- 12V socket on the rear center console
- Textile floor mats
- Warning sound and light for unfastened seat belts at the front and rear

Extra equipment



- "Discover Pro" navigation system including "Streaming & Internet" (4x20W app-controlled, wireless digital cockpit, operation with proximity sensor, dual tuner with phase shift, DAB vehicle menu, speed, volume adjustment, gesture control, 32GB SSD hard drive, 2D map display, sound control, triple TFT display with touchscreen, MP3 navigation for Europe, voice control, telephone contact address, telephone interface, "Comfort" with inductive charging, 2 USB iPod/iPhone traffic signs, "We Connect Plus" including "We Connect" destination guidance, dynamic RDS TMC tuner, pre-programmed mobile key, for vehicle, Smart.)
- Airbags: Driver's knee airbag, side airbags, and rear seat belt pretensioners (driver and front passenger airbags with passenger airbag deactivation, including driver's knee airbag - three-point automatic seat belts with seat belt pretensioners for the outer rear seats - side airbags for the outer rear seats, including front side airbags and head airbag system)
- Keyless access locking and starting system with safe security (automatic locking and starting system where the vehicle key is carried but not in the hand – if you carry the vehicle key with you and approach the vehicle, it is automatically unlocked; the engine is started conveniently using the start button)
- Package: "Easy Open & Close" package including safe security (extendable and removable luggage compartment cover with electric opening - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe security)
- Package: R-Line "Exterior", Volkswagen R (With individual installation - R-Line rear spoiler in "R" styling in body color - lower side trims in chrome - bumpers and sill extensions in "R" styling, design trims in the rear bumper - variant)
- Radio accessories: Harman Kardon sound system (10+1 speakers, 700 watts total power, 16-channel digital amplifier, subwoofer)
- Anti-theft alarm system (interior monitoring, backup horn and tow-away protection - illuminated vanity mirror in the sun visors, extendable sun visors)
- Folding trailer hitch (with electric release)
- Headliner in titanium black (with individual installation)
- Package: "Business Premium" package including navigation (from Business) (2 USB-C ports in the front, 1 USB-C charging socket in the rear, 230 V socket, App-Connect including wireless, Apple CarPlay, Android Auto, "Travel Assist" driving assistant and "Lane Assist" lane keeping assistant, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, electric lumbar supports on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Package: Ambient Lighting "Plus" (multi-colored ambient lighting - LED entry/warning lights in all doors - interior lights with switch-off delay and dimming function, 2 LED reading lights each at the front and rear)
- Package: Luggage compartment divider package without storage compartments (divisible luggage compartment floor - loading sill protection in stainless steel)
- Package: R-Line Sport Package (Progressive steering - tinted rear side windows and rear window, 65% light-absorbing - electronic differential lock XDS - sports suspension, body lowered by approx. 15mm)
- Paint finish: metallic
- Steering wheel: Multifunction steering wheel in leather, heated, with shift paddles
- Voice control
- Wheels: 4 light alloy wheels 8 J x 19 "Verona" Volkswagen R (painted in Sterling Silver - AirStop tires 235/40 R 19 - with individual installation - wheel locks with extended theft protection)
- Wheels: Tire Mobility Set no longer available

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Equipment	Vehicle key (Batterie) - Empty - Replace



No.	Component group	Description
3	Body	Body - Glued / labelled - De-glue / neutralise
4	Indicator - front	Mirror - right side - Scratched - Replace
5	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
6	Wing mirror - right side	Cap - Scratched - Paint
7	Door - rear right side	Door - Scratch(es) - Smart repair
8	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
9	Wheel / tyres	Tyre - rear right side (Flanke) - Damaged - Replace
10	Wheel / tyres	Tyre - front left side (Flanke) - Damaged - Replace
11	Front bumper	Spoiler - Scratched - Paint
12	Front bumper	Front bumper - Scratch(es) - Paint
13	Rear bumper	Rear bumper - Scratch(es) - Paint
14	Wheel / tyres	Alloy rim - front left side (Materialabtrag) - Scratched - Replace
15	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Seat - front	Seat cover - left side - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Accident damages

No. Accident

- Side - left

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Der beiliegende Winterradsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view ([Online link](#))



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

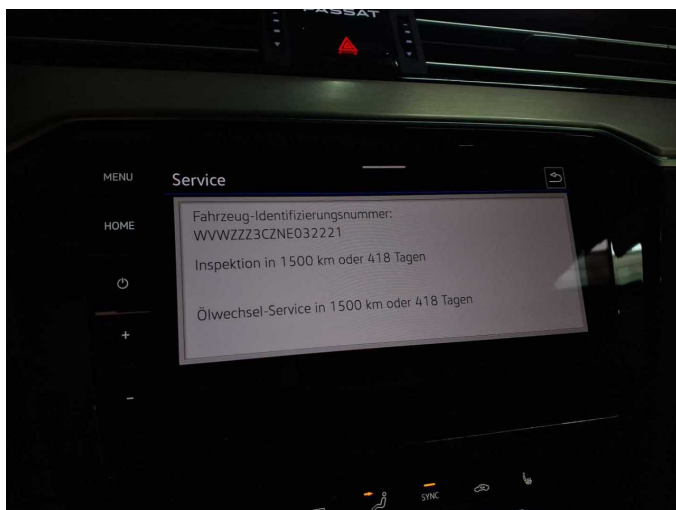


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

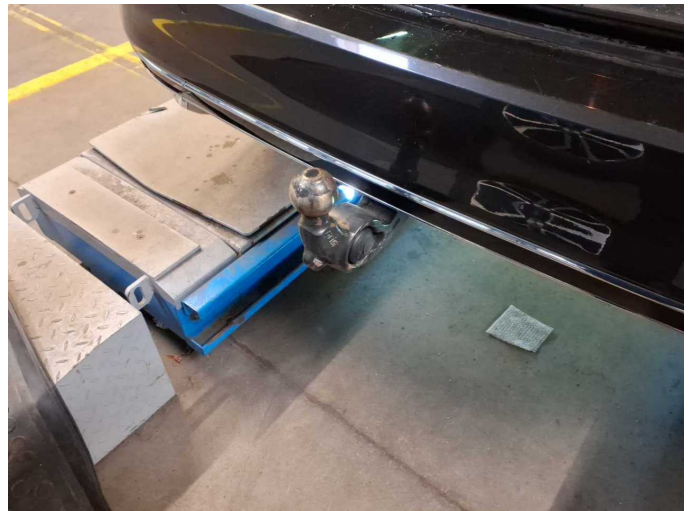


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 2: Equipment: Vehicle key (Batterie) - Empty - Replace



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Damage 4: Indicator - front: Mirror - right side - Scratched - Replace



Damage 4: Indicator - front: Mirror - right side - Scratched - Replace



Damage 5: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 5: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 6: Wing mirror - right side: Cap - Scratched - Paint



Damage 6: Wing mirror - right side: Cap - Scratched - Paint




Damage 6: Wing mirror - right side: Cap - Scratched - Paint



Damage 6: Wing mirror - right side: Cap - Scratched - Paint



Damage 7: Door - rear right side: Door - Scratch(es) - Smart repair

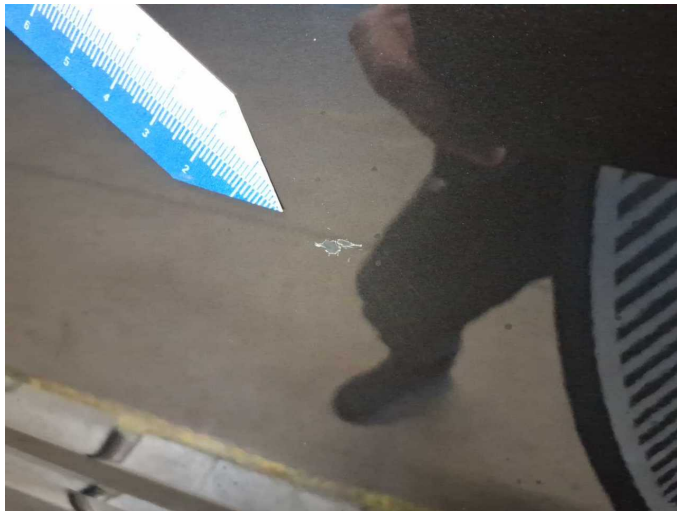


Damage 7: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 9: Wheel / tyres: Tyre - rear right side (Flanke) - Damaged - Replace




Damage 9: Wheel / tyres: Tyre - rear right side (Flanke) - Damaged - Replace

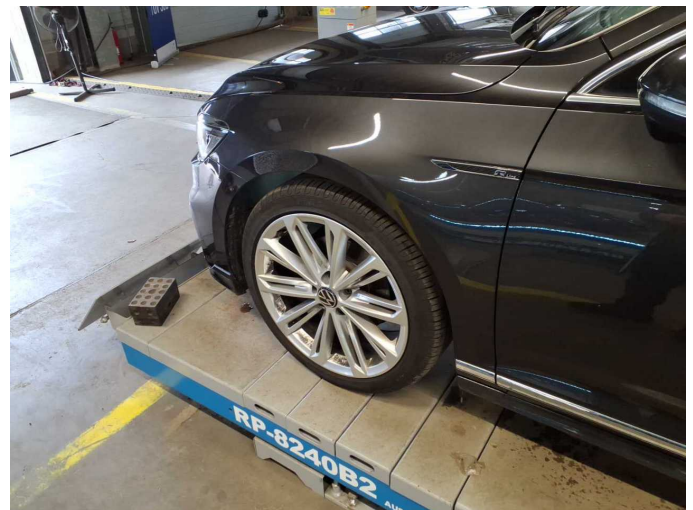

Damage 10: Wheel / tyres: Tyre - front left side (Flanke) - Damaged - Replace



Damage 10: Wheel / tyres: Tyre - front left side (Flanke) - Damaged - Replace

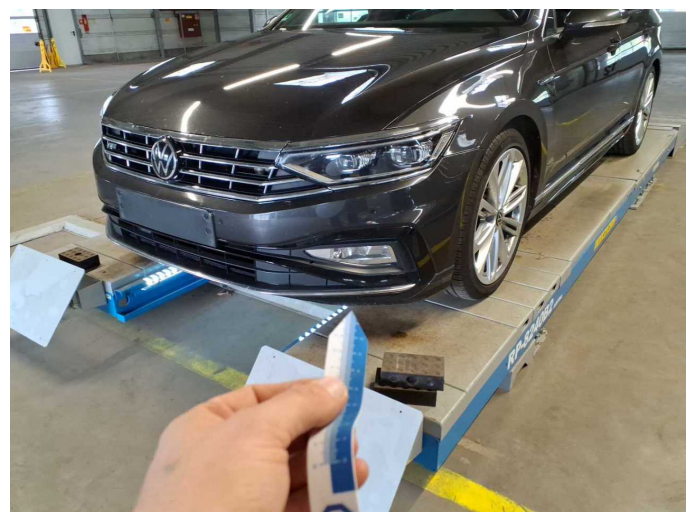

Damage 11: Front bumper: Spoiler - Scratched - Paint



Damage 11: Front bumper: Spoiler - Scratched - Paint




Damage 12: Front bumper: Front bumper - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Scratch(es) - Paint

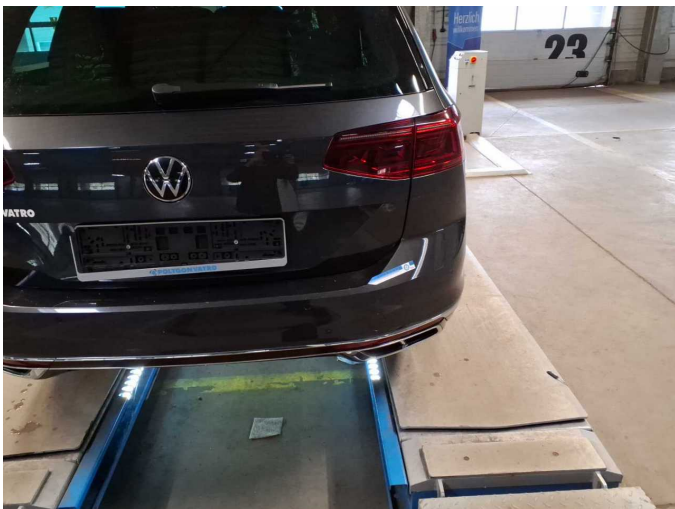

Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 14: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 14: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace



Damage 14: Wheel / tyres: Alloy rim - front left side (Materialabtrag) - Scratched - Replace




Damage 15: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 15: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace




Damage 15: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

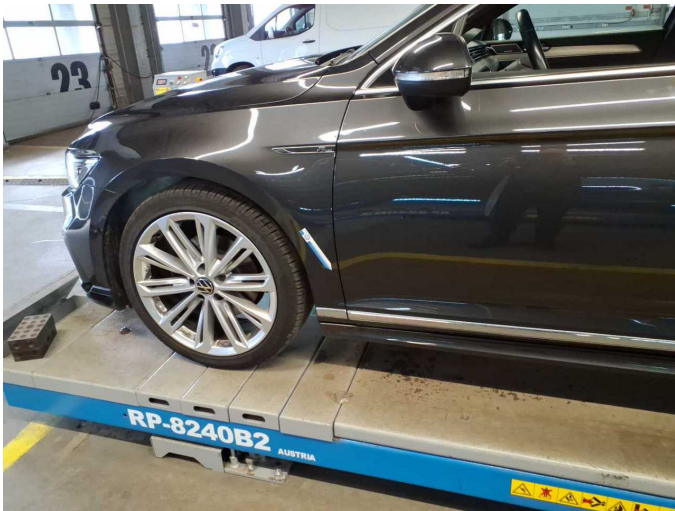


Accident 1: Side - left



Accident 1: Side - left

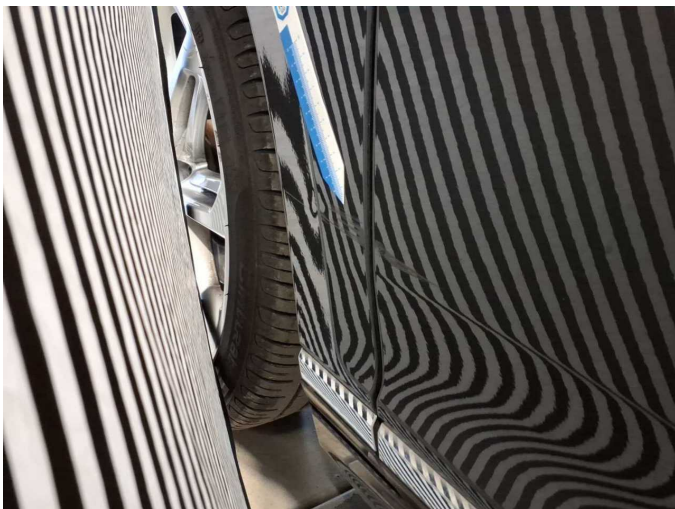

Accident 1: Side - left

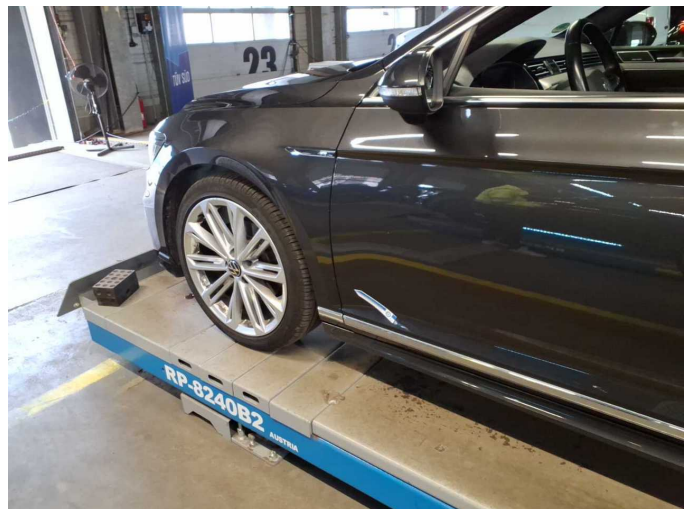

Accident 1: Side - left



Accident 1: Side - left



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZ3CZNE032221

Hersteller / Modell: VOLKSWAGEN VW Passat Variant 2.0 TDI SCR DSG Elegance

Datum	KM-Stand	Beschreibung
24.03.2025	139.424	AU; Batterie ern; Systemtest/Eigendiagnose
11.11.2024	130.559	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.05.2024	100.128	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
14.04.2023	59.105	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.11.2022	39.504	Systemtest/Eigendiagnose
21.09.2022	30.072	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges