



Expertise

Protocol number: 41341288
Order No. / Reference: 24982892
Inspection date: 1 Sept 2025

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG Business

VIN: WVVZZZ3CZNE075745



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 2.0 TDI SCR DSG Business	
Vehicle Identification number	WVVZZZ3CZNE075745
Mileage (Read)	162,221 km
First registration	28 Jun 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report not on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,900 km
Last maintenance on / at	04/2025 at 152,214 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GJ212244
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BQS 02923		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95V	Summer tyres on Light alloy	Nexen	3mm / 3mm
2)	215/60 R16 95V	Summer tyres on Light alloy	Nexen	4mm / 4mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Automatic distance control ACC "stop & go", including speed limiter
- Cup holders (2) front
- Brake light, third
- Headlining in Mistral Grey
- diesel particulate filter
- Parking aid - warning signals for obstacles in the front and rear areas
- Electronic stabilization program and electromechanical brake booster
- Front windscreen in laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- ISOFIX anchorage points
- Headrests (3) rear
- LED fog lights and cornering lights
- LED headlights with daytime running lights
- Headlight range adjustment
- Front center armrest height and length adjustable, with storage box
- Mesh partition
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery: "Business" fabric
- Radio "Composition"
- Radio accessories: Digital radio reception DAB+
- Wheels: 4 light alloy wheels "Sepang" 6.5 J x 16
- Rear seat bench undivided, backrest asymmetrically divided and foldable, with center armrest
- Power steering
- Seats: Comfort seats in the front
- Seats: Front seats height adjustable
- Start-stop system
- Telephone interface
- First aid kit, warning triangle and safety vest
- Electronic immobilizer
- Airbag, head airbag system for front and rear passengers
- App Connect
- Exterior mirrors electrically adjustable, heated, ambient lighting
- Hill start assist
- Chrome strips on the side windows
- Roof rails black
- tachometer
- LED entry/warning lights in the front doors
- Electronic parking brake including auto-hold function
- Automatic headlight switching
- Remote release for the trunk lid
- Pedestrian detection
- Luggage compartment floor can be raised
- Interior lights with switch-off delay and dimming function
- Air conditioning
- Front headrests
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with shift paddles
- Multifunction display "Premium" with multi-color display
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: Light and Vision Package "Plus"
- Proactive occupant protection system in conjunction with "Front Assist"
- Tire pressure monitoring indicator (passive)
- Wheels: Tire Mobility Set
- Leather gearshift knob
- Keyless start system without safe lock
- Seat belts: three-point automatic seat belt
- Seats: Lumbar supports in front
- Lane keeping assistant "Lane Assist"
- 12V socket on the rear center console
- Textile floor mats
- Warning sound and light for unfastened seat belts at the front and rear

Extra equipment

- App-Connect Wireless (Volkswagen offers three interfaces for connecting smartphones with numerous options: - Apple CarPlay - Android Auto from Google - MirrorLink)
- Chassis: Rear suspension with fully automatic level control
- Finish: pearl effect
- Proactive occupant protection system and lane change assistant "Side Assist" (Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" - lane change assistant "Side Assist" and rear traffic assistant)
- Rear side windows and rear window tinted



- "Discover Media" navigation system including "Streaming & Internet" (4x20 watt user interface with proximity sensor, dual tuner with phase diversity, vehicle menu speed, volume adjustment, 2D map display, tone control, triple TFT display with touchscreen operation, "Discover Media" navigation system including "Streaming & Internet," MP3 radio, telephone contact address for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition, "VW Media Control," We Connect Plus, 3 years, including We Connect route guidance, dynamic RDS TMC tuner)
- Seats: Lumbar supports front, driver's side electric including massage function
- "Comfort" telephone interface with inductive charging function (hands-free system)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Seat - front	Seat cover - right side - Soiled - Clean
3	Sill - right side	Sill - dent(s) - Smooth repair work
4	Interior	Interior - Odour - Ozone treatment
5	Interior	Interior (Wassereintritt) - Specify findings - Perform diagnosis
6	Door - front right side	Door - Dent / paintcoat damage - Smart repair
7	Trim / covers	Boot lid - interior trim - Scratched - Replace
8	Interior	Interior (Schimmelbildung) - Soiled - Clean
9	Seat - front	armrests - Scratched - Replace
10	Front bumper	Front bumper - Scratched - Repair and paint
11	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
12	Side panel - rear left side	Side panel (verformt) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Headlight	Headlight - right side - Stone chips - No deduction
2	Headlight	Headlight - left side - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction
5	Rear bumper	Rear bumper - Scratched - No deduction
6	Boot lid / rear door	Boot lid - Scratched - No deduction
7	Vehicle glazing	Rear window - Scratch(es) - No deduction
8	Wing mirror - right side	Cap - Scratched - No deduction
9	Interior	Interior - Scratch(es) - No deduction



No.	Component group	Description
10	Door - front left side	Door edge - Scratched - Smart repair

The vehicle shows signs of wear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit filler

Trim / covers - Floor mats

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

-Innenraum-Schimmelbildung



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view ([Online link](#))



Figure 10: Cargo area

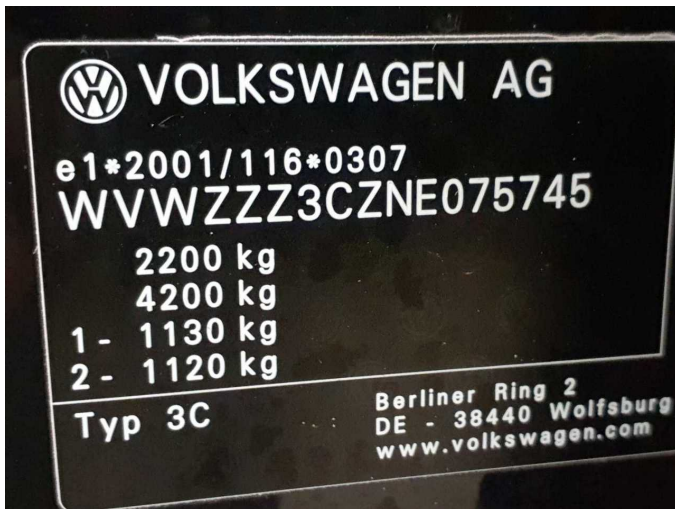


Figure 11: VIN



Figure 12: Mounted tyres

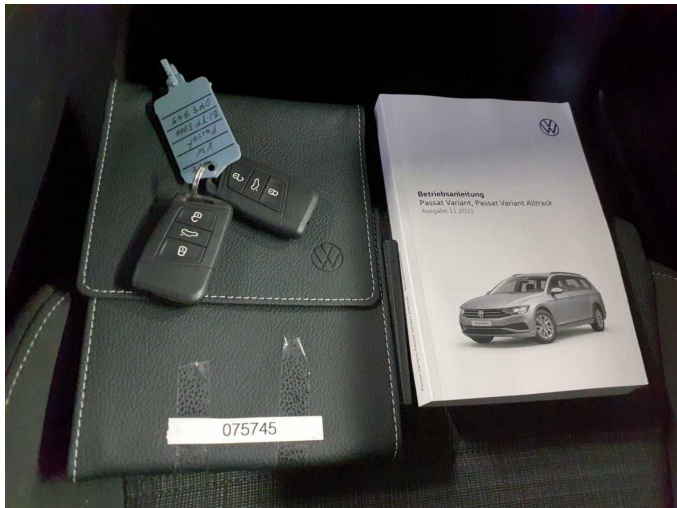


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.

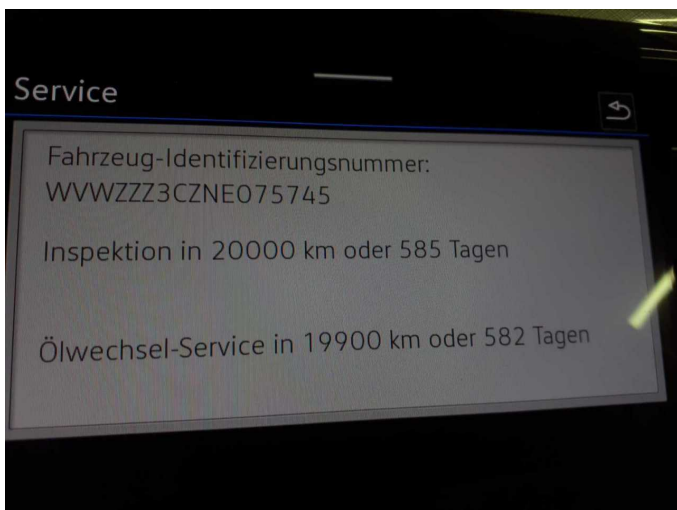


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

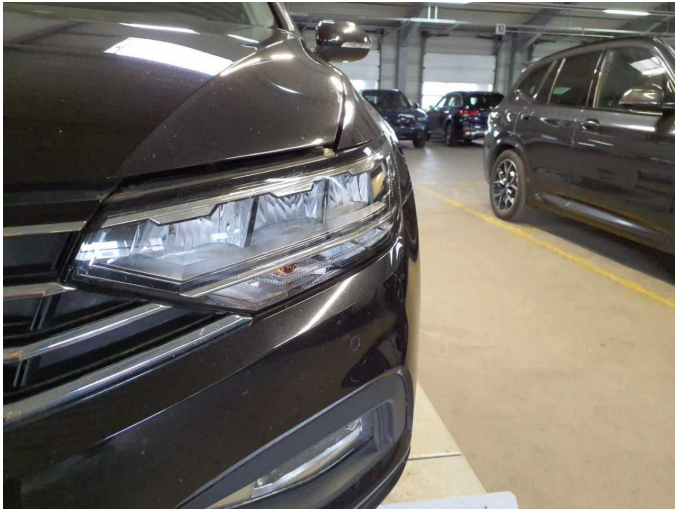


Figure 25: Misc.



Figure 26: Misc.

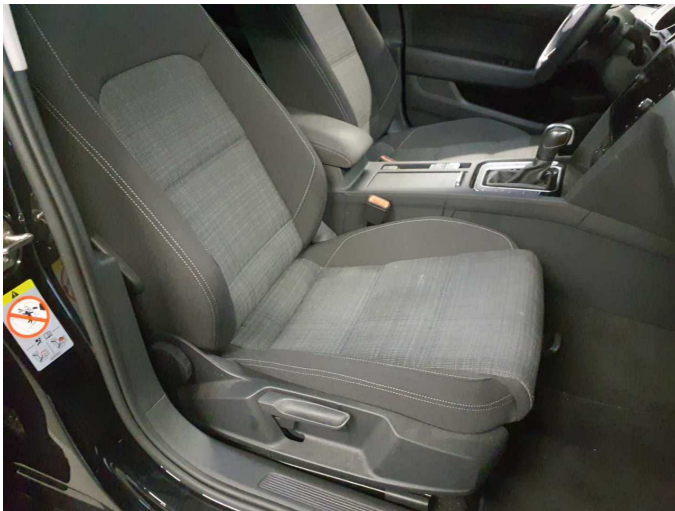


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Damage 2: Seat - front: Seat cover - right side - Soiled - Clean



Damage 3: Sill - right side: Sill - dent(s) - Smooth repair work

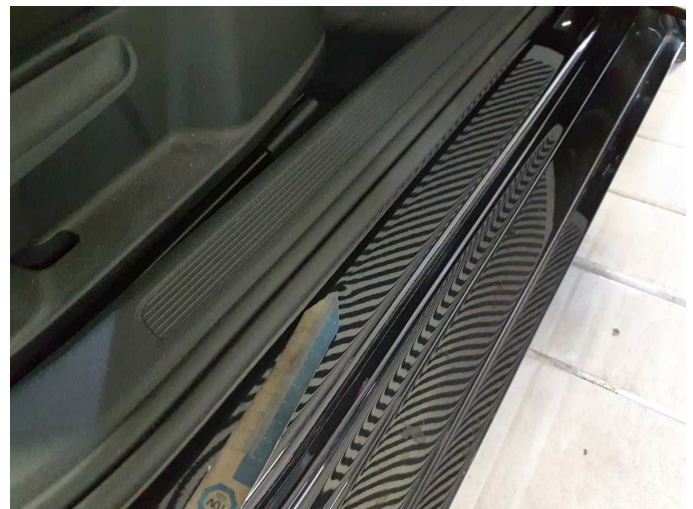


Damage 3: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 4: Interior: Interior - Odour - Ozone treatment




Damage 4: Interior: Interior - Odour - Ozone treatment

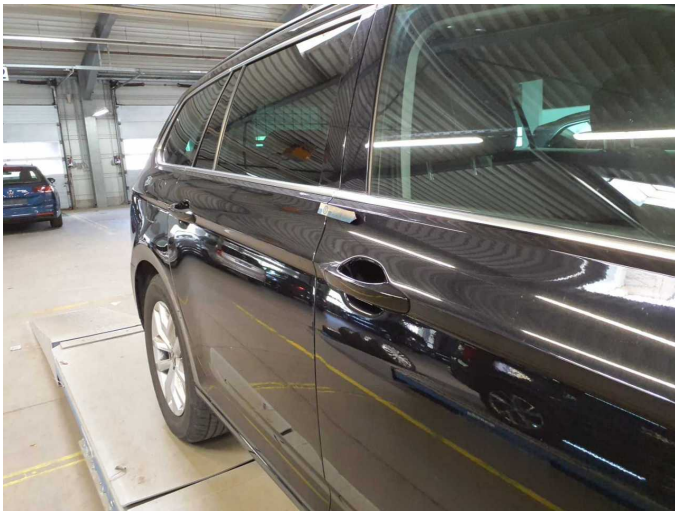

Damage 6: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 6: Door - front right side: Door - Dent / paintcoat damage - Smart repair

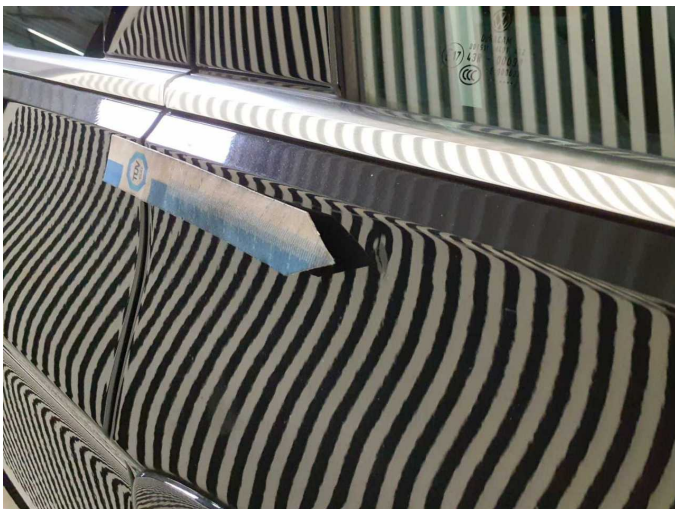

Damage 6: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Replace




Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage 7: Trim / covers: Boot lid - interior trim - Scratched - Replace

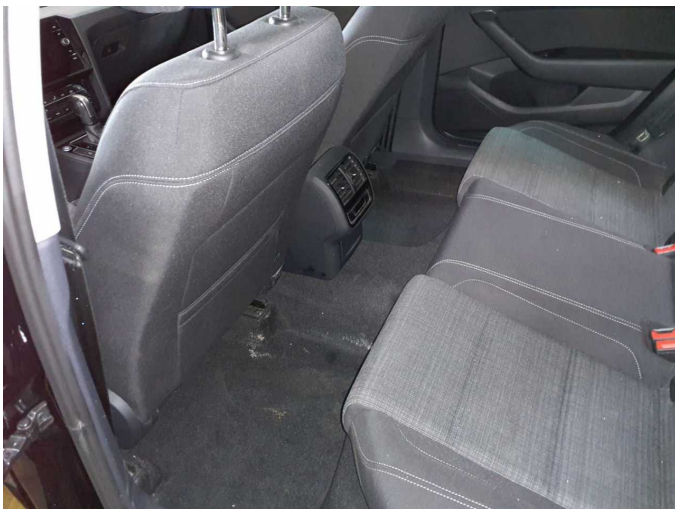

Damage 8: Interior: Interior (Schimmelbildung) - Soiled - Clean



Damage 8: Interior: Interior (Schimmelbildung) - Soiled - Clean



Damage 8: Interior: Interior (Schimmelbildung) - Soiled - Clean



Damage 9: Seat - front: armrests - Scratched - Replace



Damage 9: Seat - front: armrests - Scratched - Replace



Damage 10: Front bumper: Front bumper - Scratched - Repair and paint




Damage 10: Front bumper: Front bumper - Scratched - Repair and paint




Damage 10: Front bumper: Front bumper - Scratched - Repair and paint




Damage 10: Front bumper: Front bumper - Scratched - Repair and paint

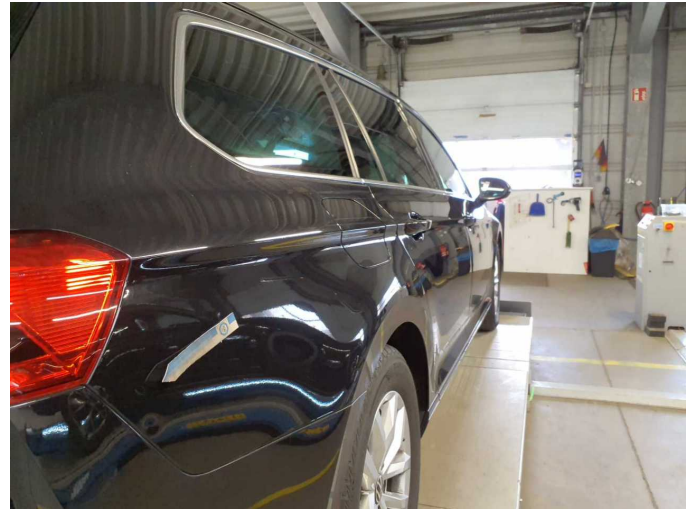

Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

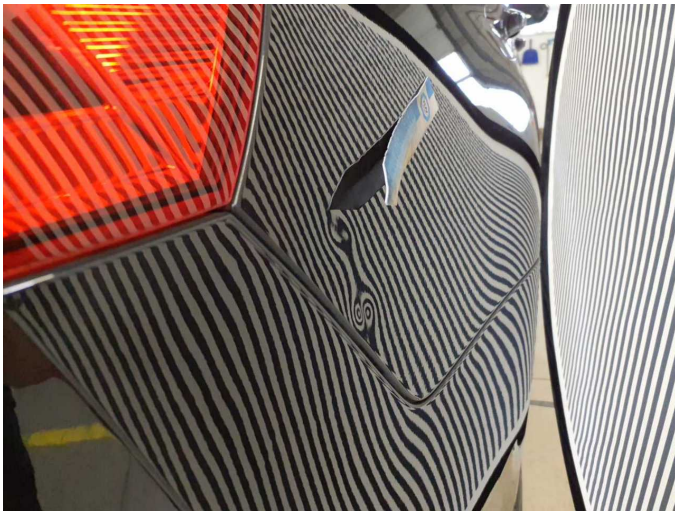


Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

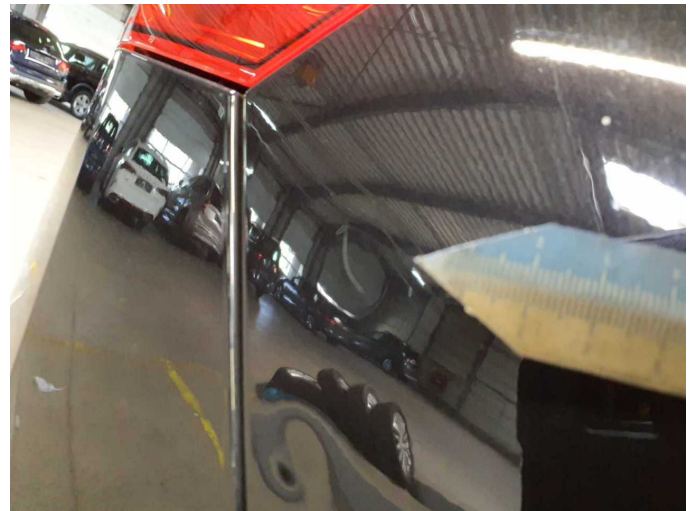

Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

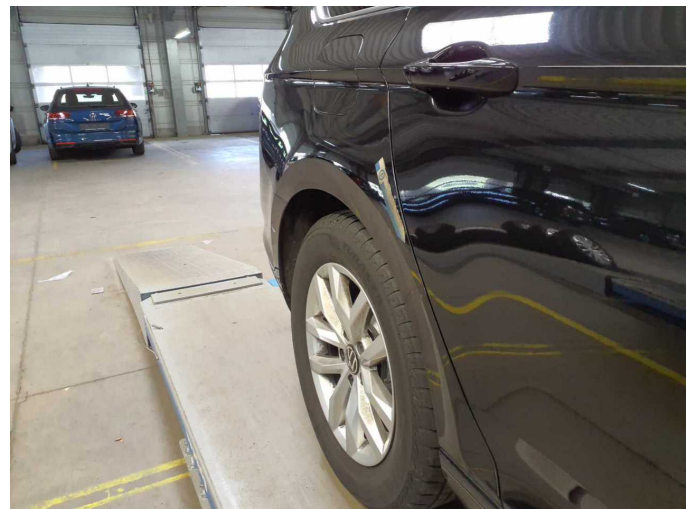


Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 11: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

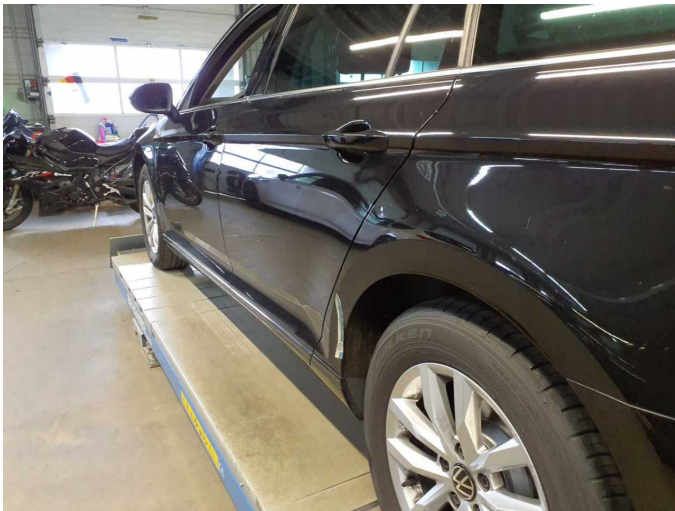

Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint

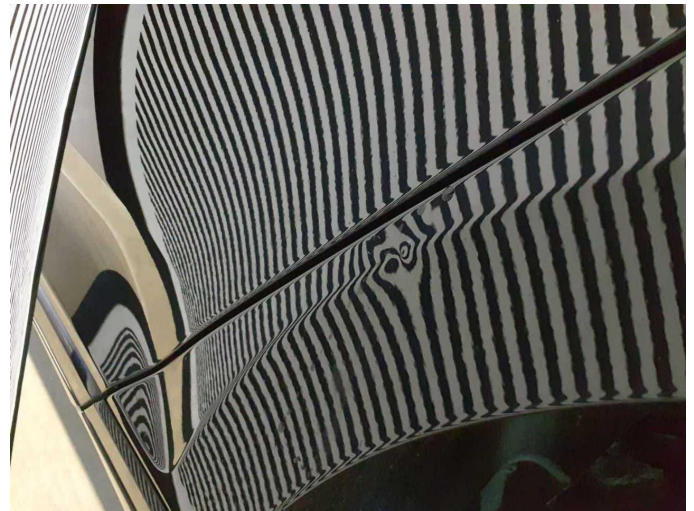

Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint

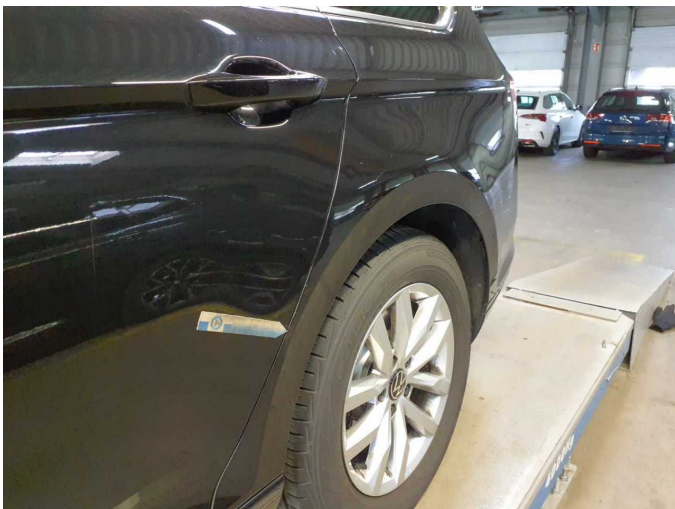


Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint




Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint

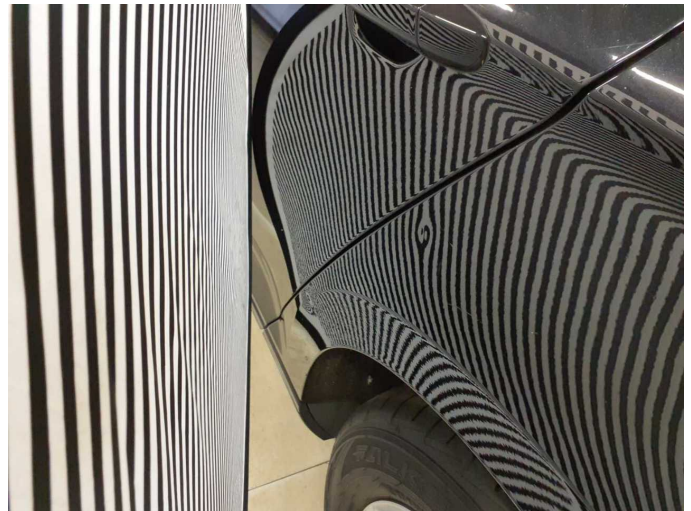

Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint

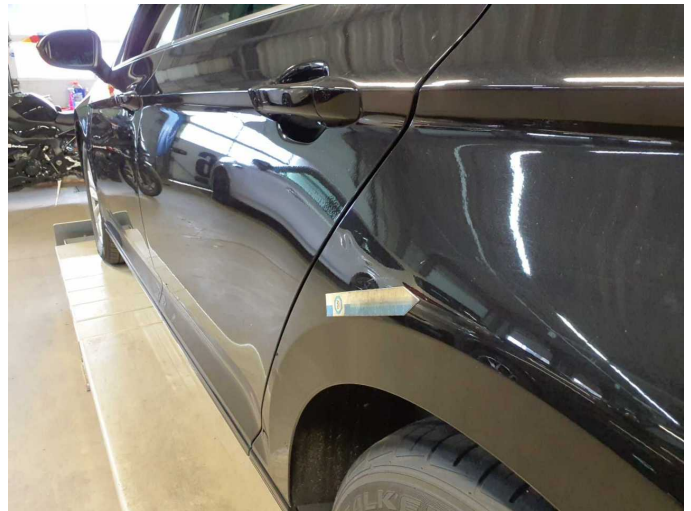

Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear left side: Side panel (verformt) - Dent / paintcoat damage - Repair and paint



Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction

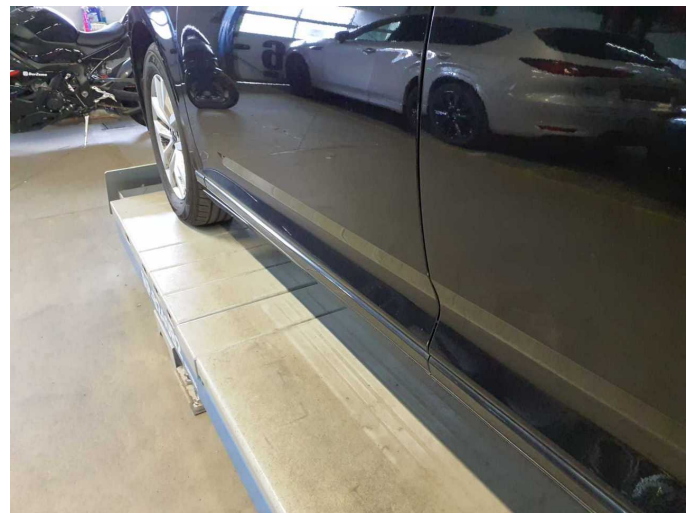


Wear and tear 10: Door - front left side: Door edge - Scratched - Smart repair




Wear and tear 10: Door - front left side: Door edge - Scratched - Smart repair

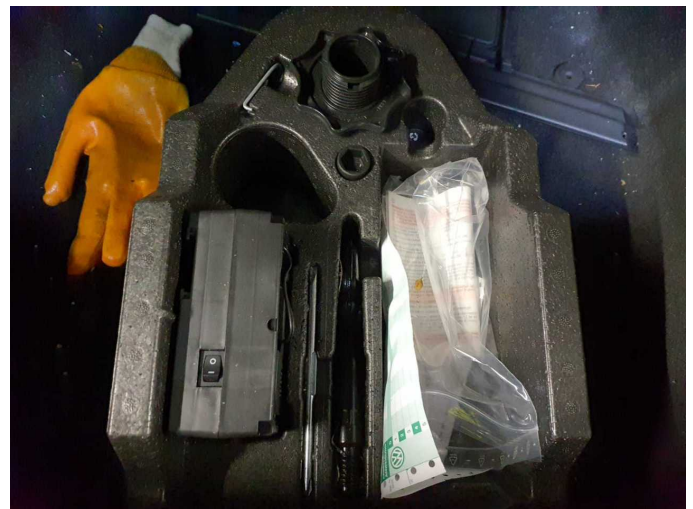

Missing part 1: Equipment: Tirefit filler - Missing - Replace

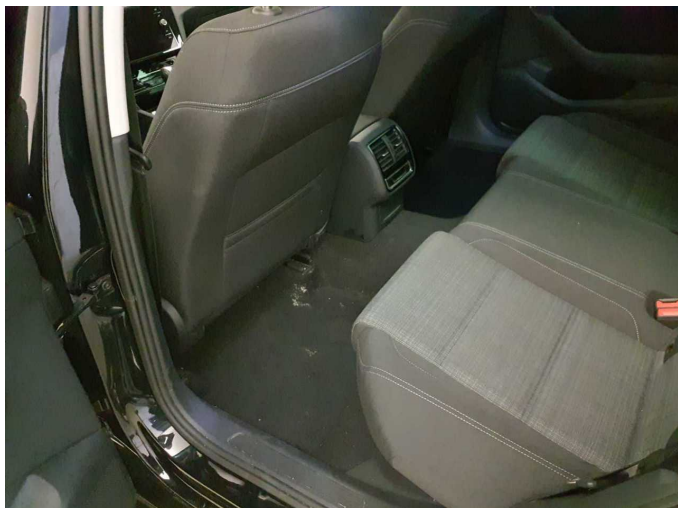

Missing part 2: Trim / covers: Floor mats - Missing - Replace

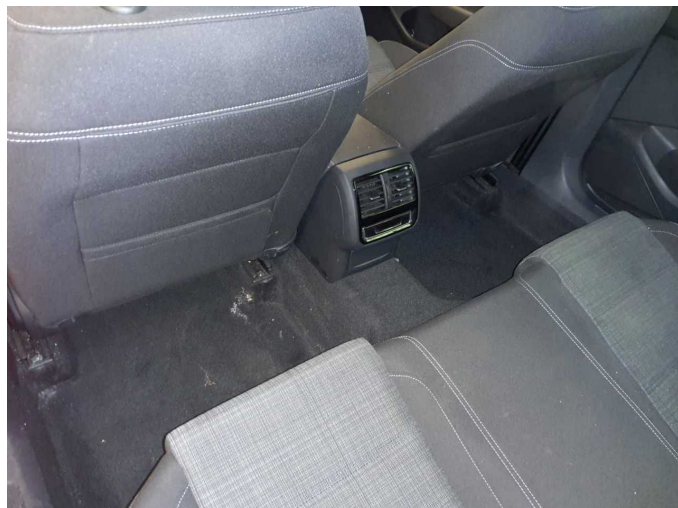

Missing part 2: Trim / covers: Floor mats - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZ3CZNE075745

Hersteller / Modell: VOLKSWAGEN VW Passat Variant 2.0 TDI SCR DSG Business

Datum	KM-Stand	Beschreibung
26.06.2025	161.986	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten
28.04.2025	152.214	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.07.2024	115.690	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
02.03.2024	89.380	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
10.08.2023	63.009	Motoröl b. Wartung; Regelwartungsdienst
07.03.2023	28.061	Motoröl b. Wartung; Regelwartungsdienst