



Expertise

Protocol number: 41237689
Order No. / Reference: 25087111
Inspection date: 27 Aug 2025

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR Conceptline

VIN: WVGZZZ3CZPE030542



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 2.0 TDI SCR Conceptline	
Vehicle Identification number	WVGZZZ3CZPE030542
Mileage (Read)	223,720 km
First registration	18 Jan 2023
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Mangangrau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Dark grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	23,100 km
Last maintenance on / at	07/2025 at 217,669 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GP905380
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BQS 03967		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,170 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Continental	6mm / 6mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Exterior mirrors electrically adjustable and heated
- Hill start assist
- Headlining in Mistral Grey
- diesel particulate filter
- Electronic parking brake including auto-hold function
- Remote release for the trunk lid
- Front windscreen in laminated safety glass, heat and sound insulating
- Rear window heated
- Interior light front and rear with switch-off delay and dimming function
- Front headrests
- LED headlights with daytime running lights
- Headlight range adjustment
- Front center armrest height and length adjustable, with storage box
- Mesh partition
- Emergency call service
- Radio "Composition"
- Tire pressure monitoring indicator (passive)
- Keyless start system without safe lock
- Power steering
- Seats: Front seats height adjustable
- Start-stop system
- Bumpers in body color
- First aid kit, warning triangle and safety vest
- Electronic immobilizer
- Central locking with remote control
- Airbag, head airbag system for front and rear passengers
- App Connect
- Cup holders (2) front
- Brake light, third
- Roof rails black
- tachometer
- Electronic stabilization program and electromechanical brake booster
- Luggage compartment floor can be raised
- Transmission: 6-speed manual transmission
- Rear window wiper
- ISOFIX anchorage points
- Headrests (3) rear
- LED taillights
- Steering wheel: Multifunction steering wheel
- Make-up mirrors in the sun visors
- Multifunction display "Plus"
- Fatigue detection
- Non-smoking version
- Upholstery: "Lizard" fabric
- Radio accessories: Digital radio reception DAB+
- Rear seat bench undivided, backrest asymmetrically divided and foldable, with center armrest
- Seat belts: three-point automatic seat belt
- Lane keeping assistant "Lane Assist"
- 12V socket on the rear center console
- Telephone interface
- Warning sound and light for unfastened seat belts at the front and rear
- Black trim strips on the side windows

Extra equipment

- App-Connect Wireless
- Anti-theft alarm system (interior monitoring, backup horn and tow-away protection - illuminated vanity mirror in the sun visors, extendable sun visors)
- Tailgate with electric opening and closing, electric opening for luggage compartment cover (extendable and removable luggage compartment cover, with electric opening - tailgate with electric opening and closing)
- Premium multifunction display with multi-color display (including: - Outside temperature - Average fuel consumption - Average speed - Distance traveled - Driving time - Gear recommendation - Speed warning - Comfort - Current fuel consumption - Range - Service - Time with extended display options, e.g.: - Digital speedometer - Digital oil temperature indicator - Light & visibility - Language - Auxiliary heating - Winter tires)
- Black roof rails with 2 silver anodized support bars (anti-theft protection and enclosed in a storage bag)
- Parking aid - warning signals for obstacles in the front and rear areas
- "Air Care Climatronic" air conditioning system with 3-zone temperature control and active combination filter
- Paint finish: metallic
- Steering wheel: Multifunction steering wheel in leather
- "Discover Media" navigation system including "Streaming & Internet" (4x20 watt user interface with proximity sensor, dual tuner with phase diversity, vehicle menu speed, volume adjustment, 2D map display, tone control, triple TFT display with touchscreen operation, "Discover Media" navigation system including "Streaming & Internet," MP3 radio, telephone contact address for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition, "VW Media Control," We Connect Plus, 3 years, including We Connect route guidance, dynamic RDS TMC tuner)



- | | |
|---|---|
| <ul style="list-style-type: none"> • Package: Light and Sight Package "Plus" (LED lights in the front footwells, electrically adjustable and heated exterior mirrors, automatically dimming on the driver's side, LED entry/warning lights in the front doors, automatic headlight control with daytime running lights, "leaving home" function, and manual "coming home" function, interior lights with delayed switch-off and dimming function, 2 LED reading lights each at the front and rear, auto-dimming interior mirror, illuminated vanity mirror, retractable sun visors, rain sensor) • Wheels: Tire Mobility Set no longer available • Keyless access locking and starting system with safe security (automatic locking and starting system where the vehicle key is carried but not in the hand – if you carry the vehicle key with you and approach the vehicle, it is automatically unlocked; the engine is started conveniently using the start button) • Textile floor mats (front and rear) | <ul style="list-style-type: none"> • Package: Seat comfort package (passenger seat backrest fully foldable - lumbar supports in front) • Package: Winter (automatically heated windscreen washer nozzles - heated front seats) • Wheels: 4 "Istanbul" alloy wheels (5-twin-spoke design) 7 J x 17 (AirStop tires 215/55 R 17 - wheel locks with enhanced anti-theft protection - rolling resistance class A) • Wheels: Tire pressure monitoring system for driving tires (driving tires with sensors for the tire pressure monitoring system) • Rear side windows and rear window tinted • Sun blinds on the rear door windows • Auxiliary heating and ventilation (with radio remote control and timer) |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Trim / covers	Boot lining - Scratch(es) - No deduction
3	2nd wheel set	1 alloy rim - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 28 Apr 2025	5.489,06 €
2	Front, Provided by user / customer, from 4 Oct 2024	8.092,29 €

Repainting

No.	Repainting
1	Mudguard - left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	216 µm	Bonnet	126 µm
Door - front left side	163 µm		



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area

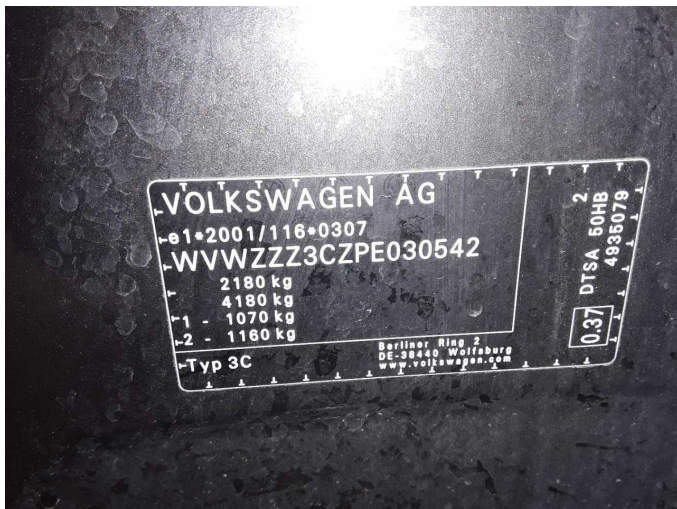


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

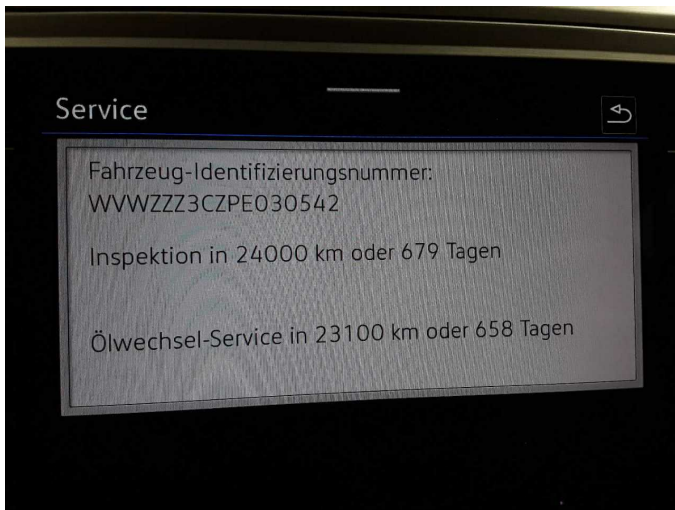


Figure 15: Documents



Figure 16: Additional tyres

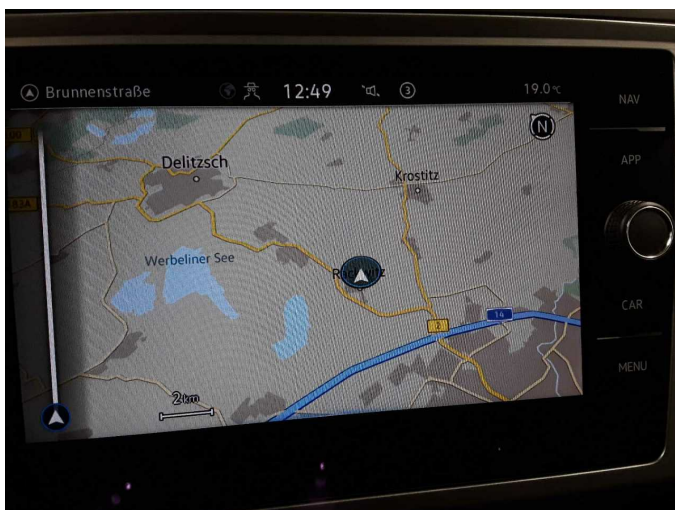


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Wear and tear 2: Trim / covers: Boot lining - Scratch(es) - No deduction



Wear and tear 2: Trim / covers: Boot lining - Scratch(es) - No deduction



Mudguard - left side: 216 µm



Mudguard - left side: 216 µm



Door - front left side: 163 µm



Door - front left side: 163 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZ3CZPE030542

Hersteller / Modell: VOLKSWAGEN VW Passat Variant 2.0 TDI SCR Conceptline

Datum	KM-Stand	Beschreibung
08.07.2025	217.669	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Spannrolle ern; Wartung Sonstiges; Wartung Sonstiges; Zahnriemen/Steuerkett ern
13.02.2025	184.858	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.09.2024	156.518	Motoröl b. Wartung; Regelwartungsdienst
31.05.2024	129.926	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
01.02.2024	96.472	Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
21.09.2023	65.231	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.05.2023	33.797	Motoröl b. Wartung; Regelwartungsdienst