


DEKRA Automotive Solutions

Vehicle details

VIN	WVWZZZAUZ JP595806	Brand	VOLKSWAGEN	Maintenance date	-
Licence Plate	EOJ116	Model	Golf7Variant-BV5-2017	Maintenance mileage	-
Registration date	24/10/2018	Year	2018	Exterior Color	Other
Odometer	187 186 km	Engine size	-	interior Color	
Fuel	Petrol	Body Type	Estate	Next technical inspection	-
Seats	-	Transmission	Automatic	CO2	-
Doors	5	Gears	7		

Inspection Details

Inspection date	18/09/2025	Inspection loc.	Eurotransport Kungsängen
-----------------	------------	-----------------	--------------------------

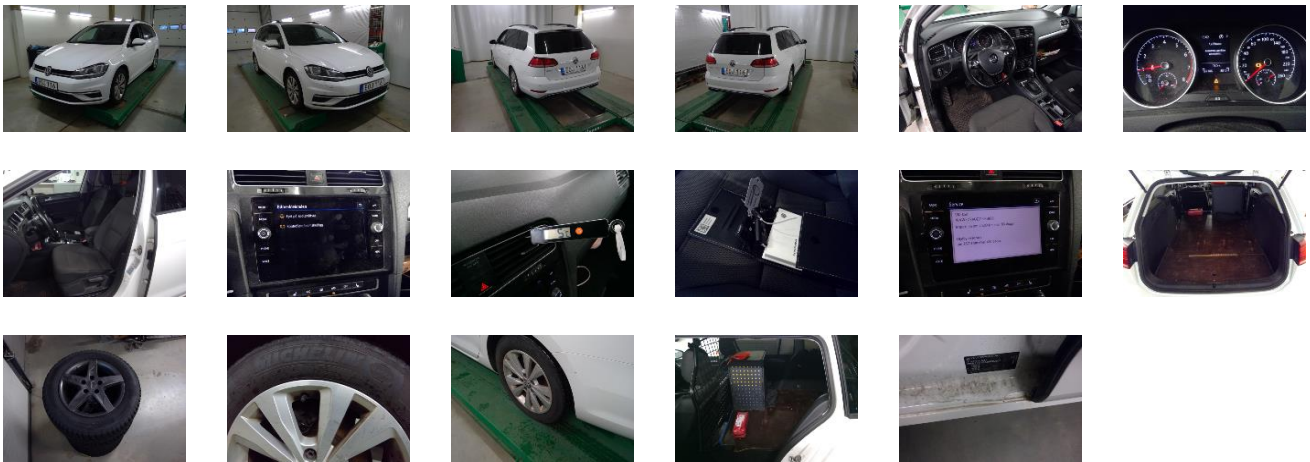

Generic equipment

Manual air-conditioning	✓
Cruise control	✓
Bluetooth	✓
Front radars	✓
Alloy wheel rims	✓
Reversing radars	✓
Automatic Gearbox	✓
Central locking	✓
Side rails	✓
Park Distance Control	✓
Audio System	✓
Adaptive Cruise Control (ACC)	✓

Removable element

Refill emergency kit	✓
Load cover	✗


Technical Document

Service manual holder	✓
User manual	✓
Spare key	✓

DEKRA Automotive Solutions

Tyres

Hankook 205/55/16 H Summer 8.0 mm

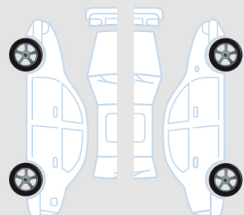

Michelin 205/55/16 H Summer 5.0 mm




Michelin 205/55/16 H Summer 6.0 mm



Hankook 205/55/16 H Summer 8.0 mm

Winter kit

Pirelli 195/65/15 T Winter 9.0 mm

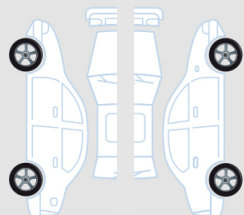

Pirelli 195/65/15 T Winter 9.0 mm



Pirelli 195/65/15 T Winter 9.0 mm



Pirelli 195/65/15 T Winter 9.0 mm

Damages

1



Part	Load cover
Position	-
Damages	Missing
Severity	-
Repair mode	Lumpsum replacement

2



Part	Complete service track record
Position	-
Damages	Missing
Severity	-
Repair mode	Lumpsum

3



Part	Other mechanical
Position	-
Damages	Defective
Severity	-
Repair mode	For info
brake pads/discs worn out	

4



Part	Other interior
Position	-
Damages	Not conform
Severity	-
Repair mode	Replace dismantling of equipment

5



Part	Sill
Position	Right
Damages	Dented
Severity	-
Repair mode	Lumpsum repair

6



Part	Door
Position	Front left
Damages	Scratched
Severity	-
Repair mode	For info

7



Part	Steering wheel
Position	-
Damages	Scratched
Severity	-
Repair mode	For info

8



Part	Door
Position	Back left
Damages	Scratched
Severity	-
Repair mode	For info

9



Part	Fabric door lining
Position	Back left
Damages	Dent & Chips
Severity	-
Repair mode	Lumpsum repair

10



Part	Door sill
Position	Back left
Damages	Scratched
Severity	-
Repair mode	For info

DEKRA Automotive Solutions

11



Part	Bumper
Position	Back
Damages	Scratched
Severity	-
Repair mode	Lumsum Paintworks paint cracked

12



Part	Fabric door lining
Position	Back right
Damages	Scratched
Severity	-
Repair mode	For info

13



Part	Door
Position	Back right
Damages	Dented
Severity	-
Repair mode	For info

14



Part	Wing
Position	Front right
Damages	Dented
Severity	-
Repair mode	For info

15



Part	Bonnet
Position	-
Damages	Stone impact
Severity	-
Repair mode	Lumsum Paintworks rust

16



Part	Roof post A/B/C
Position	Left
Damages	Scratched
Severity	-
Repair mode	For info

17



Part	Wing
Position	Back left
Damages	Dented
Severity	-
Repair mode	For info

18



Part	Wing
Position	Back right
Damages	Dented
Severity	-
Repair mode	For info