



VOLVO XC70

XC70 3.2 AWD Aut.

VIN NO YV1BZ985681000469
Registration Number 5681000469



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2025-04-01	2	2	292423 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2025-03-07	286857	2007-09-04	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250929122635
Inspection Date / Place	2025-09-29 / BCA Neuss	Cosmetic Grade	4

Vehicle Summary



Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Petrol	Road Worthy	Yes
Colour	White	Engine Size (cc)	3192
Engine Size	3.2	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	All-Wheel-Drive permanent
Seat Colour		No of Seats	5
Seat Covering Name	Braun	Seat Covering	Synthetic Leather
Charging Cables		NEDC CO2 Rating (q/km)	258
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





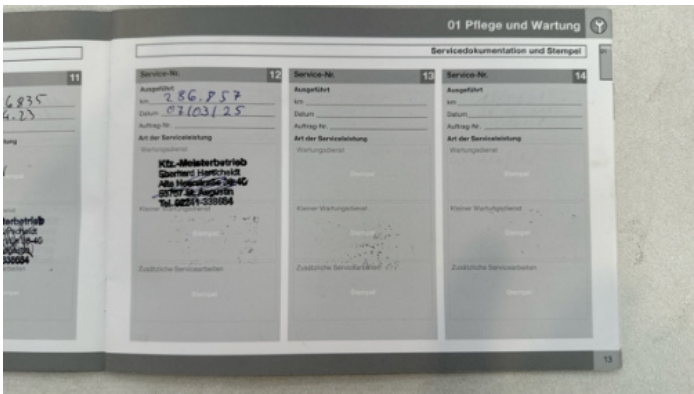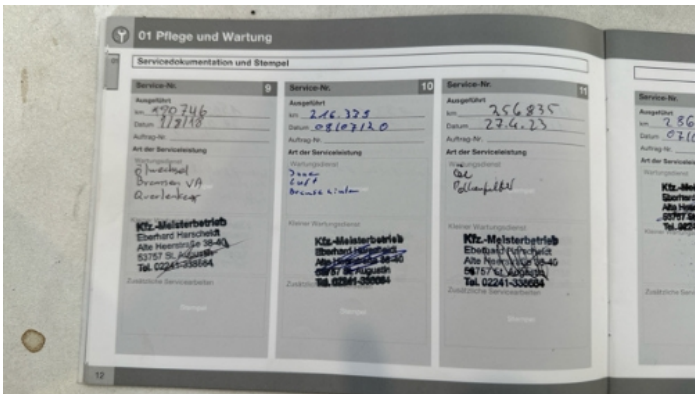

Equipment

Adaptivecruisecontrol	Alloys wheels	Auxiliary Socket	Blindspotassist
Enhanced speaker system	Front parking sensors	Remote central locking	Satellite navigation
Stability control	Electrically adjustable seats	Electrictailgate	Radio
Airbag Status	Anti-lock braking	Bi Xenon Headlamps	Cruise control
Front fog lamps	Remote adjusting wing mirrors	Roof rails	Seatventilation
CD Player	Electrically folding wing mirrors	Leather steering wheel	Rear parking sensors

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	18
Enhanced Speaker System	Dynaudio	Extra Wheel / Tyre Set	Winter Tyres - Alloy
Seat Heating	Front and Rear		

Wheels & Tyres


Right Front Tyre Depth	4	Left Front Tyre Depth	4
Right Rear Tyre Depth	4	Left Rear Tyre Depth	4
Extra Wheel - 1 Tyre Depth	4	Extra Wheel - 2 Tyre Depth	4
Extra Wheel - 3 Tyre Depth	4	Extra Wheel - 4 Tyre Depth	4

Cosmetic Damage

8 Schäden

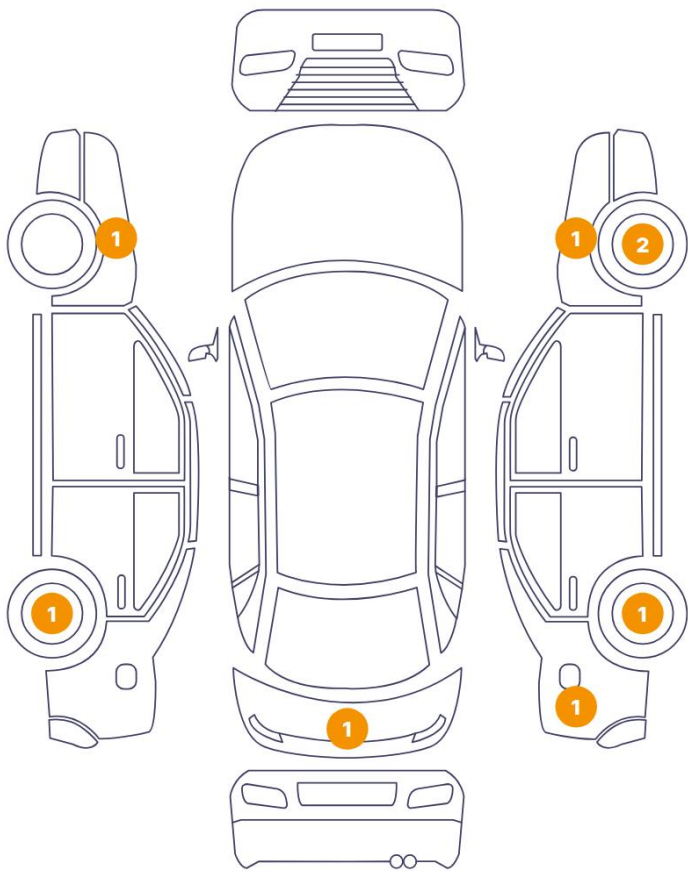


3 Schäden

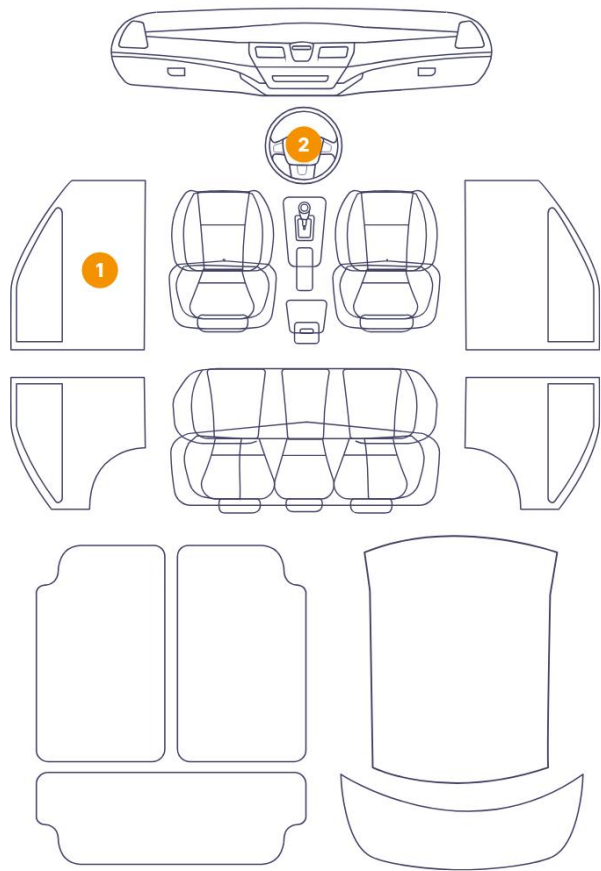

Component		Damage	Comments
1	Tire / Front Right	Tire	
2	Rim / Front Right	Out of Bodywork / Scratch	
3	Rim / Back Right	Out of Bodywork / Scratch	
4	Rim / Back Left	Out of Bodywork / Scratch	
5	Fender / Front Left	Paint / Scratch / Scuff	
6	Fender / Front Right	Paint / Scratch / Scuff	
7	Rear Trunk	Missing Part	
8	Fuel Door / Back Right	Bodywork / Breakage	
9	Steering Wheel / Front	Interior / Worn - out	
10	Steering Wheel / Front	Interior / Worn - out	
11	Panel Filling / Front Left	Interior / Worn - out	



1. Tire / Front Right
Tire -

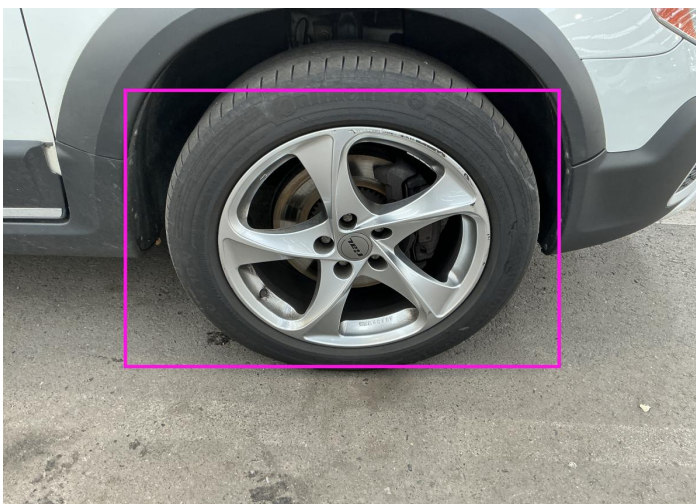

2. Rim / Front Right
Out of Bodywork / Scratch -



3. Rim / Back Right
Out of Bodywork / Scratch -



4. Rim / Back Left
Out of Bodywork / Scratch -




5. Fender / Front Left
Paint / Scratch / Scuff -



6. Fender / Front Right
Paint / Scratch / Scuff -



7. Rear Trunk
Missing Part -

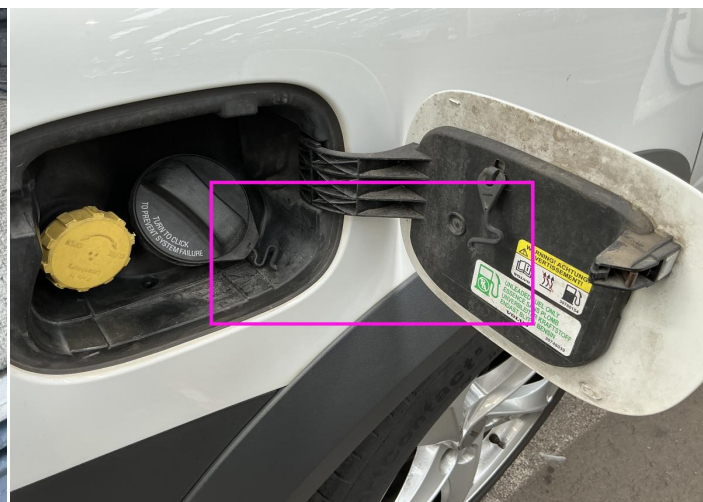

8. Fuel Door / Back Right
Bodywork / Breakage -



9. Steering Wheel / Front
Interior / Worn - out -



10. Steering Wheel / Front
Interior / Worn - out -



11. Panel Filling / Front Left
Interior / Worn - out -

Mechanical Condition

Control Lights

Display Defect	✓	ABS Warning Light	✓
ESP Fault/Traction Control Malfunction Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
All - wheel Drive	✓	No Dashboard Lights	✓
Tire Pressure Monitoring System	✓		

Equipments Test

Main & Spare Keys Functioning	!	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	AC / Heating System	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels





Brakes Fluid	NA	Coolant Fluid	✓
--------------	----	---------------	---

Test Drive Inspection

Steering Wheel

Steering | Noise / Anomaly 


Engine





Engine Noise		The Gears Scratch / Skip / Abnormal Operation	
Fume Quantity		Power Loss	

Brake

Brake System Anomaly 

General

Test Driven Status 

-  **No troubles detected, good condition or correct tests, according to vehicle age and mileage**
-  **Damages or malfunction detected that requires repairs by the buyer**
-  **Not applicable**
-  **Not tested**

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)